

# UNITED STATES ENVIRONMENTAL PROTECTION AGENCY REGION 5

# **MEMORANDUM**

SUBJECT:	Determination of Need for an Investigation Facility Name:
FROM:	Kathleen Miller, Environmental Protection Specialist
TO:	George Hamper, Chief, Corrective Action Section 2
recommend	the following determination regarding the need for an investigation:
Reason Pre PAA Pha Pha Pha Cor Not Enr PAA Sup Sup Sup	Determination of Need for an Investigation-Investigation is not Necessary in for Determination iminary Assessment/Visual Site Inspection (PA/VSI) did not recommend any further investigation VSI recommendations do not warrant RRB attention se 1 Environmental Site Assessment (ESA) did not recommend further investigation se 2 ESA did not recommend further investigation se 1/Phase 2 ESA recommendations do not warrant RRB attention inpany representative asserts that the site is clean subject to corrective action colled in other clean-up program VSI recommendations have been implemented erfund Removal icipating in Voluntary Remediation Program inpleted Voluntary Remediation Program erfund Remedial Action erfund No Further Action Decision erfund Base Relocation and Closure
Reason PAA ESA Oth	
No determ	ination can be made - More Information Needed    Approved

#### **MEMO**

To: File

From: Kathleen Miller

Date: 9/9/10

RE: Premcor Refining Group, Inc. (EPA ID# ILD 005 109 822)

\* new owner: Valero

#### **Summary of Phone Conversations:**

On September 8, 2010, I called the contact person, John Tenison per RCRA Info and was given his cell phone number because he was out of the office. I spoke with Mr. Tenison and was informed that the refinery at the Blue Island facility was shut down in 2002. Premcor Refinery was bought out by Valero which is currently a petroleum marketing terminal. When the refinery was shut down, the tanks were removed from the property. As far as remediation activities, Premcor and the State of Illinois entered into an Agreed Consent Order on March 16, 2004 for Remedial Investigation/Feasibility Study (RI/FS) and Site Investigation at the Premcor Blue Island facility. I asked if I could obtain a copy of this documentation for our records. Mr. Tenison was very willing to provide me with anything that would help update our files. He stated that Thomas Mroz, the environmental manager, will be calling to provide me with the documentation and to answer any other questions I may have. A few minutes later, Mr. Mroz called me and informed me that the Blue Island facility is involved in CERCLA type clean-up activities leading to a Record of Decision (ROD) and an Administrative Record. He was very willing to send me the consent order and the latest RI/FS report via email. Soon after our conversation, I received the consent order, their last monthly RI/FS report submitted to IEPA as well as a submittal register. (\* I did not print the complete consent order- 87 pages.)

I was informed by George Hamper, that if a company representative tells me that the site is involved in a clean-up program (in this case, Premcor is in a **required IEPA** (**CERCLA type**) **remediation program under consent order**) this is a reason to determine a CA070NO- no further investigation is necessary.

#### **Updated contact info for this facility:**

Valero (formerly Premcor Refining Group) 13100 S. Kedzie Ave. Blue Island, IL 60406

John Tenison, Facility Manager 210-345-4665 210-287-4665 (cell)

Tom Mroz, Environmental Manager 708-385-9513 thomas.mroz@valero.com

RE: U.S. EPA request for updated info re (EPA ID# ILD 005 109 822)
Mroz, Thomas
to:
KathleenA Miller
09/08/2010 03:48 PM
Show Details

Good Afternoon Kathleen – Please find attached a copy of the consent order with the State of Illinois for the site. The Consent Order was entered on March 16, 2004. I've also taken this opportunity to provide our last monthly report (July) to IEPA along with our submittal register – providing a list of document submitted on this project. Hopefully you will find the attached information useful. Please don't hesitate to contact me should you have any further questions at 708-385-9513.

Thank You,

Tom

From: Miller.KathleenA@epamail.epa.gov [mailto:Miller.KathleenA@epamail.epa.gov]

Sent: Wednesday, September 08, 2010 11:31 AM

**To:** Mroz, Thomas

Subject: U.S. EPA request for updated info re (EPA ID# ILD 005 109 822)

To Mr. Mroz:

Per our phone conversation today, I am emailing you our request for updated information regarding remediation activities at the Premcor Refining Group (now Valero), Blue Island, IL location. You offered to provide our office with the Agreed Consent Order entered in March of 2004.

I look forward to receiving the documentation! Thank you for your assistance.

Kathleen Miller
Environmental Protection Specialist
RCRA Corrective Action
U.S. EPA Region 5
77 West Jackson Blvd. LU-9J
Chicago, IL 60604
312-886-6761
Miller.KathleenA@epa.gov

# IN THE CIRCUIT COURT OF COOK COUNTY, ILLINOIS COUNTY DEPARTMENT, CHANCERY DIVISION

PEOPLE OF THE STATE OF ILLINOIS, ex rel. LISA MADIGAN, Attorney General of the State of Illinois,	) ) )	•	RECEIVED MAR 0 2 2004
Plaintiff,	), )		URS CORPORATION
-vs-	). }.	No.	04CH01571
THE PREMCOR REFINING GROUP INC., a Delaware corporation,	) ) ) )		the white this - 87 mg
Dofondant	Ñ		

# CONSENT ORDER FOR REMEDIAL INVESTIGATION/FEASIBILITY STUDY AND SITE INVESTIGATION

#### I. BACKGROUND

- A. The People of the State of Illinois, ex. rel Lisa
  Madigan, Attorney General of the State of Illinois, on behalf of
  the Illinois Environmental Protection Agency ("Illinois EPA")
  (together, the "State"), filed a complaint in this matter
  pursuant to Sections 12(a), (d) and (h) and 22.2(f) of the
  Illinois Environmental Protection Act ("Act"), 415 ILCS 5/12(a),
  (d) and (h) and 5/22.2(f) (2002), against The Premcor Refining
  Group, Inc.
- B. The State in its complaint seeks, inter alia: (1) reimbursement of costs incurred by Illinois EPA for response

actions at the Premcor Blue Island facility (as defined below); and (2) an order requiring Premcor to perform a comprehensive remedial investigation of the Premcor Blue Island facility to determine the nature and extent of contamination and to submit to the State a proposal for remedial alternatives based on the results of the remedial investigation and to remediate soil and groundwater contamination at and around the Site.

- C. The Illinois EPA is an administrative agency established in the executive branch of the State government by Section 4 of the Act, 415 ILCS 5/4 (2002).
- D. At all times relevant to this Complaint, Defendant, The Premcor Refining Group, Inc. ("Premcor" or "Defendant"), was and is a Delaware corporation doing business in the State of Illinois.
- E. Premcor, formerly known as Clark Refining and Marketing, Inc., a Delaware corporation, currently owns and operates tank farms and a bulk terminal and leases and operates a marine dock facility at 131st Street and Kedzie Avenue, Blue Island, Cook County, Illinois ("Blue Island facility" or "Site"). Premcor formerly owned and operated an oil refinery at the Site.
- F. The Blue Island facility ceased operations as an oil refinery in January 2001. However, Premcor continues to operate the tank farms, the bulk terminal, the marine dock operations and a waste-water treatment plant on portions of the Blue Island

facility.

- G. The Blue Island facility is generally surrounded on the north by 127th Street and Eisenhower High School, on the south by the Calumet Sag Channel and residences, on the west by an industrial area, and on the east by residences.
- H. The Blue Island facility consists of seven identifiable areas, which are:
  - Area 1. Northwest property
  - Area 2. West property
  - Area 3. Northwest Terminal
  - Area 4. Southwest Terminal
  - Area 5. Triangle property (main refinery)
  - Area 6. Administration offices
  - Area 7. Parco Foods property (aka the Cookie Factory)
- I. The tank farms at the Blue Island facility contain tanks of varying sizes which are located at the Northwest and Southwest Terminals. Defendant uses or used these tanks for the storing or transferring of crude oil, petroleum and petroleum products including gasoline.
- J. From at least 1992, releases of caustic solutions, fluid catalytic cracker spent catalyst, asbestos, gasoline, oil and other petroleum products reportedly occurred, and may be continuing to occur, at the Blue Island facility.
  - K. An investigation confirmed that free product is present

on the groundwater table in the area of the tank farms,

Administration offices, transfer pipelines and truck loading dock.

- L. Groundwater and soil samples taken by Premcor at the Blue Island facility found petroleum products and other chemicals.
- In 1991, as a result of releases from the Blue Island facility, the State filed a complaint which was subsequently amended five times to include additional releases. On September 9, 1998, the United States filed a complaint against Premcor. The State filed its complaint in intervention of the federal case on April 27, 1999. A Consent Order was entered in the cases filed in state court on April 8, 2002 and in the federal case on June 12, 2002. These Consent Orders settled alleged liability for air pollution violations and for operation of the tank farms at the Site only. The Consent Order entered in the State case specifically reserved all rights with respect to claims relating to investigation and/or remediation of any area or media impacted by spills or releases of contaminants at or from the Blue Island facility, at or from the site of the Midlothian Creek pipeline release, or at or from the Site of the Burnham, Illinois pipeline release.
- N. In order to address the releases to land and water,

  Premcor shall perform a remedial investigation and feasibility

study ("RI/FS") at the Blue Island facility on Areas 3, 4 and 5 of the Site pursuant to the RI/FS Statement of Work set forth in Attachment A. Premcor may perform an RI/FS on one or more of Areas 1, 2, 6 or 7 if the Illinois EPA finds that information provided in the Site Investigation Report (as defined below) demonstrates the need for further investigation and remediation.

- O. Premcor shall perform a site investigation of Areas 1, 2, 6 and 7 pursuant to the Site Investigation of the Potentially Unimpacted Areas: 1, 2, 6 and 7 ("Site Investigation") Statement of Work, set forth in Attachment B. Based on the results of the Site Investigation, the Illinois EPA shall determine whether any of Areas 1, 2, 6 or 7, or any portion of those areas, shall be remediated in the RI/FS process (outlined in Section V.7.a. herein) or whether any of the areas qualify for a Site Investigation Certification of Completion pursuant to Section XXV.
- P. Based on the information presently available to Illinois EPA, Illinois EPA believes that Premcor will properly and promptly conduct the RI/FS and Site Investigation (together, the "Work") if conducted in accordance with the requirements of this Consent Order and its appendices.
- Q. Premcor does not admit any liability to the Plaintiff arising out of the transactions or occurrences alleged in the complaint, nor do they acknowledge that the release or threatened

release of hazardous substance(s) at or from the Site constitutes an imminent or substantial endangerment to the public health or welfare or the environment.

- R. The Parties agree that in any judicial action taken under this Consent Order, judicial review of any issues concerning the adequacy of any response action taken shall be limited to the administrative record. The Parties agree that the Work to be performed by Premcor shall constitute response actions.
- S. The Parties recognize, and the Court by entering this Consent Order finds, that this Consent Order has been negotiated by the Parties in good faith and that implementation of this Consent Order will expedite the cleanup of the Site and will avoid prolonged and complicated litigation between the Parties, and that this Consent Order is fair, reasonable, and in the public interest.

NOW, THEREFORE, it is hereby Ordered, Adjudged, and Decreed:

#### II. JURISDICTION

1. This Court has jurisdiction over the subject matter of this action pursuant to Sections 42(d) and (e) and 22.2(f) of the Act, 415 ILCS 5/42.(d) and (e) and 5/22.2(f). Solely for the purposes of this Consent Order and the underlying complaint, Premcor waives all objections and defenses that they may have to

# STATEMENT OF WORK

#### FOR

# REMEDIAL INVESTIGATIONS AND FEASIBILITY STUDIES The Premcor Refining Group Clark Blue Island Facility

#### I. PURPOSE

The purpose of this remedial investigation/feasibility study ("RI/FS") is to investigate the nature and extent of contamination at the Premcor, Clark Blue Island Facility Site, to develop and evaluate remedial alternatives, as appropriate, and to perform additional investigative studies, such as treatability studies, necessary to complete this phase. Premcor shall furnish all necessary personnel, materials, and services needed for, or incidental to, performing the RI/FS, except as otherwise specified herein. Premcor and their consultants shall conduct the RI/FS in accordance with the "Guidance for Conducting Remedial Investigations and Feasibility Studies Under CERCLA" (U.S. EPA, October 1988), "Guidance on Conducting Non-Time Critical Removal Actions Under CERCLA" (U.S. EPA August 1993), "Guidance for Data Usability in Risk Assessment" (OSWER Directive #9285.7-05), and the guidance referenced therein, as may be amended or modified by EPA.

#### II. SCOPE

The specific RI/FS activities to be conducted at the Premcor, Clark Blue Island Facility Site, are segregated into 14 separate tasks.

- Task 1--Project Planning
- Task 2--Community Relations
- Task 3--Field Investigations
- Task 4--Sample Analysis/Validation
- Task 5--Data Evaluation
- Task 6--Risk Assessment
- Task 7--Treatability Studies
- Task 8--RI Report
- Task 9--Remedial Alternatives Development and Screening
- Task 10--Detailed Analysis of Alternatives
- Task 11--FS Report
- Task 12--Proposed Plan
- Task 13--ROD Preparation
- Task 14—Administrative Record

#### Task 1--Project Planning

Premotor and their consultants shall: (1) develop the required project plans to meet the objectives of the RI/FS and (2) initiate subcontractor procurement and coordination with analytical laboratories. The project plans shall include a detailed work plan, a quality assurance project plan ("QAPP") (to include a field sampling plan ("FSP")); and a health and safety plan.

The work plan and corresponding activity plans shall be submitted by Premcor and reviewed and approved by Illinois EPA. Any revisions or additions to any of the project plans shall be submitted to Illinois EPA for review and approval.

#### A. Work Plan Preparation

Premcor shall review existing information (e.g., topographic maps, aerial photographs, data collected as part of any investigation) and conduct a Site visit to become familiar with Site topography, access routes, and the proximity of potential receptors to Site contaminants.

As part of project planning, Premcor and the Illinois EPA shall meet to discuss the proposed scope of the project and the specific investigative and analytical activities that shall be required, preliminary remedial action objectives and general response actions, potential remedial technologies and the need for or usefulness of treatability studies, potential Applicable or Relevant and Appropriate Requirements ("ARARs") associated with the location and contaminants of the Site and the potential response actions being contemplated, interim actions, sequencing of tasks to be completed, and whether a temporary Site office should be set up to support Site work.

Premotor and/or their contractor shall prepare a detailed work plan based on this SOW for the RI/FS. The work plan shall include a project description and an outline of the overall technical approach, complete with corresponding personnel requirements, activity schedules consistent with the SOW timeframes (eg., Document review times), deliverable due dates, and budget estimates for each of the specified tasks.

#### B. Quality Assurance Project Plan

Premcor shall prepare a QAPP to describe all sampling and analyses planned for the Site. The QAPP should address all types of investigations conducted and should include a project description, a project organization chart illustrating the lines of responsibility of the personnel involved in the sampling phase of the project, quality assurance objectives for data such as the required precision and accuracy, completeness of data, representativeness of data, comparability of data, and the intended use of collected data, sample custody procedures during sample collection, in the laboratory, and as part of the final evidence files, the type and frequency of calibration procedures for field and laboratory instruments, internal quality control checks, and quality assurance

performance audits and system audits, preventive maintenance procedures and schedule and corrective action procedures for field and laboratory instruments, specific procedures to assess data precision, representativeness, comparability, accuracy, and completeness of specific measurement parameters, and data documentation and tracking procedures. Standard operating procedures for Quality Assurance/Quality Control ("QA/QC") that has been established by EPA shall be referenced and not duplicated in the QAPP.

#### C. Field Sampling Plan

Premcor shall prepare a field sampling plan ("FSP") that includes an outline of all necessary activities to obtain additional Site data. It shall contain an evaluation explaining what additional data are required to adequately characterize the Site, conduct a baseline risk assessment, and support the evaluation of remedial technologies in the FS. The FSP should clearly state sampling objectives; necessary equipment; sample types, locations, and frequency; analyses of interest a/k/a "The Skinner List"; and a schedule stating when events shall take place and when deliverables shall be submitted. This document should be submitted as part of the OAPP.

#### D. Health and Safety Plan

Premcor shall develop a HSP on the basis of Site conditions to protect personnel involved in Site activities and the surrounding community. The plan shall address all applicable regulatory requirements contained in 20 CFR 1910.120(i)(2)—Occupational Health and Safety Administration, Hazardous Waste Operations and Emergency Response, Interim Rule, December 19, 1986; U.S. EPA Order 1440.2—Health and Safety Requirements for Employees Engaged in Field Activities; U.S. EPA Order 1440.3—Respiratory Protection; U.S. EPA Occupational Health and Safety Manual; and U.S. EPA Interim Standard Operating Procedures (September, 1982).

The plan shall provide a Site background discussion and describe personnel responsibilities, protective equipment, health and safety procedures and protocols, decontamination procedures, personnel training, and type and extent of medical surveillance. The plan shall identify problems or hazards that may be encountered and how these are to be addressed. Procedures for protecting third parties, such as visitors or the surrounding community, shall also be provided. Standard operating procedures for ensuring worker safety shall be referenced and not duplicated in the HSP.

The work plan and corresponding activity plans shall be submitted to Illinois EPA, for review and approval.

#### Task 2--Community Relations

The Illinois EPA shall be primarily responsible for community relations activities at this Site. The community relations program shall be integrated closely with all remedial response activities to ensure community understanding of actions being taken and to

obtain community input on the RI/FS progress.

The Illinois EPA shall prepare a Community Relations Plan ("CRP") on how citizens want to be involved in the process based on interviews with community representatives and leaders by state agency staff. The CRP shall describe the types of information to be provided to the public and outline the opportunities for community comment and input during the RIFS. Deliverables, schedule and staffing shall be included in the plan.

Premcor shall provide appropriate assistance to the Illinois EPA in its development and implementation of the community relations program. Community relations activities for the Site shall include, but may not be limited to, the following:

- Establishment and maintenance of a community information repository(s), one of which shall house a copy of the administrative record.
- Preparation and dissemination of news releases, fact sheets, slide shows, exhibits, and other audio-visual materials designed to apprise the community of current or proposed activities.
- Development and upkeep of a mailing list that includes nearby and interested residents, public interest groups, and elected officials.
- Arrangements of briefings, press conferences, workshops, and public and other informal meetings.
- Analysis of community attitudes toward the proposed actions.
- Assessment of the successes and failures of the community relations program to date.
- Preparation of reports and participation in public meetings, project review meetings, and other meetings as necessary for the normal progress of the work.

Deliverables and the schedule for submittal shall be identified in the community relations plan. The Illinois EPA shall determine any revisions or additions to the CRP.

#### Task 3--Field Investigations

Premcor shall conduct those investigations necessary to characterize the Site and to evaluate the actual or potential risk to human health and the environment posed by the Site. Investigation activities shall focus on problem definition and result in data of adequate technical content to evaluate potential risks and to support the development and evaluation of remedial alternatives during the FS.

Strict chain-of-custody procedures shall be followed and all sample locations shall be identified on a Site map. Premcor shall provide management and QC review of all activities conducted under this task. Activities anticipated for this Site are as follows:

- Surveying and Mapping of the Site. Develop a map of the Site that includes topographic information and physical features on and near the Site. If no detailed topographic map for the Site and surrounding area exists, a survey of the Site shall be conducted. Aerial photographs should be used, when available, along with information gathered during the preliminary Site visit to identify physical features of the area.
- Waste Characterization. Determine the location, type, and quantities as well as the physical or chemical characteristics of any waste remaining at the Site. If hazardous substances are held in containment vessels, the integrity of the containment structure and the characteristics of the contents shall be determined.
- Hydrogeologic Investigation. Determine the presence and potential extent of ground water contamination. Efforts should begin with a survey of previous hydrogeologic studies and other existing data. The survey should address the soil's retention capacity/mechanisms, discharge/recharge areas, and regional flow directions and quality. Local/Site-specific hydrogeologic characteristics including depth to groundwater, hydraulic conductivity, local discharge/recharge areas, groundwater flow direction, and other pertinent aquifer characteristics should also be determined. The need for groundwater modeling to predict groundwater flow conditions should also be evaluated. Results from the sampling program should estimate the horizontal and vertical distribution of contaminants, the contaminants' mobility, and predict the long-term disposition of contaminants.
- Soils and Sediments Investigation. Determine the vertical and horizontal extent of contamination of surface and subsurface soils and sediments and identify any uncertainties with this analysis. Information on local background levels, degree of hazard, location of samples, techniques used, and methods of analysis should be included. If initial efforts indicate that buried waste may be present, the probable locations and quantities of these subsurface wastes should be identified through the use of appropriate geophysical methods.
- <u>Surface Water Investigation</u>. Estimate the extent and fate of any contamination in the nearby surface waters. This effort should include an evaluation of possible future discharges and the degree of contaminant dilution expected.
- Air Investigation. Investigate the extent of atmospheric contamination from those
  contaminants found to be present at the Site. This effort should assess the
  potential of the contaminants to enter the atmosphere, local wind patterns, and
  the anticipated fate of airborne contaminants.

Information from this task shall be summarized and included in the RI Report.

#### Task 4--Sample Analysis/Validation

Premcor shall utilize a data management system including field logs, sample management and tracking procedures, and document control and inventory procedures for both laboratory data and field measurements to ensure that the data collected during the investigation are of adequate quality and quantity to support the risk assessment and the FS. Collected data should be validated at the appropriate field or laboratory QAQC level III to determine whether it is appropriate for its intended use. Premcor and their consultants shall provide task management and quality controls. Premcor shall use a National Environmental Laboratory Accreditation Conference ("NELAC") Standards certified Lab Program for use as appropriate for analysis of field samples. Illinois EPA shall have primary responsibility for ensuring that validation of all data is performed in accordance with the approved QAPP for the Site. Premcor shall incorporate information from this task into the RI Report.

#### Task 5--Data Evaluation

Premcor shall analyze all Site investigation data and present the results of the analyses in an organized and logical manner so that the relationships between Site investigation results for each medium are apparent. Premcor and their consultants shall prepare a summary that describes (1) the quantities and concentrations of specific chemicals at the Site and the ambient levels surrounding the Site; (2) the number, locations, and types of nearby populations and activities and, (3) the potential transport mechanism and the expected fate of the contaminant in the environment. As part of this evaluation, a determination shall be made by Illinois EPA as to whether or not all necessary data has been obtained for the Site.

#### Task 6--Risk Assessment

#### A. Baseline Risk Assessment

Premcor and their consultants shall conduct a baseline risk assessment to assess the potential human health and environmental risks posed by the Site in the absence of any remedial action in accordance with guidance identified herein and databases. This effort shall involve four components:

Contaminant Identification. Premcor and/or their contractor shall review available information on the hazardous substances present at the Site and identify the major contaminants of concern. Contaminants of concern should be selected based on their intrinsic toxicological properties because they are present in large quantities, and/or because they are currently in, or potentially may migrate into critical exposure pathways (e.g., drinking water).

- Exposure Assessment. Premeor and/or their contractor shall identify actual or
  potential exposure pathways, characterize potentially exposed populations, and
  evaluate the actual or potential extent of exposure.
- Toxicity Assessment. Premcor and/or their contractor shall provide a toxicity assessment of those chemicals found to be of concern during Site investigation activities. This shall involve an assessment of the types of adverse health or environmental effects associated with chemical exposures, the relationships between magnitude of exposures and adverse effects, and the related uncertainties for contaminant toxicity, (e.g., weight of evidence for a chemical's carcinogencity).
- Risk Characterization. Premcor and/or their contractor shall integrate information developed during the exposure and toxicity assessments to characterize the current or potential risk to human health and/or the environment posed by the Site. This characterization should identify the potential for adverse health or environmental effects for the chemicals of concern and identify any uncertainties associated with contaminant(s), toxicity, and/or exposure assumptions.

#### B. Ecological Risk Assessment

Premcor and/or their contractor shall conduct an ecological risk assessment to assess the potential environmental risks posed by the Site. This effort shall involve the following components:

- Site Characterization. Premoor and/or their contractor shall describe aquatic and terrestrial habitats and species potentially exposed to contaminants, summarize available information on the source, nature, and extent of Site contamination and potential routes of contaminant migration, and describe any known or suspected effects of Site contaminants to biota.
- Preliminary Screening. Premcor and/or their contractor shall use data from the Site characterization to determine whether Site contaminants pose a threat to ecologic receptors. This step should be used to determine the need for additional studies and to provide direction for those studies, if they are needed.
- <u>Conduct Further Studies.</u> If the Illinois EPA determines that additional studies are needed, Premcor and/or their contractor shall conduct such studies. Further studies shall be based on the particular ecological endpoints selected for the Site.

The risk assessment shall be submitted as part of the RI Report.

#### Task 7--Treatability Studies

#### A. Determination of Need For Treatability Studies

In consultation with Illinois EPA, Premcor and/or their contractor shall examine the need to conduct bench and/or pilot studies to determine the suitability of remedial technologies to Site conditions and problems. Technologies that may be suitable to the Site should be identified as early as possible to determine whether there is a need to conduct treatability studies to better estimate costs and performance capabilities. Should treatability studies be determined by Illinois EPA to be necessary, a separate work plan identifying the types and goals of the studies, the level of effort needed, a schedule for completion, and the data management guidelines should be submitted to the Illinois EPA for review and approval.

#### Task 8--RI Report

Premotor and/or their contractor shall present the results of Tasks 2 through 6 in a RI report. Support data, information, and calculations shall be included in appendices to the report. The Illinois EPA may submit a draft RI report to EPA for review. If comments on the draft RI report are received, the Illinois EPA shall ensure a revised RI report addressing the comments is prepared and may be submitted to EPA for final review.

#### Task 9--Remedial Alternatives Development and Screening

#### A. Development and Screening of Alternatives

Premcor and/or their contractor shall develop a range of distinct, hazardous waste management alternatives that shall remediate or control any contaminated media (soil, surface water, ground water, sediments) remaining at the Site, as deemed necessary in the RI, to provide adequate protection of human health and the environment. The potential alternatives shall encompass, as appropriate, a range of alternatives in which treatment is used to reduce the toxicity, mobility, or volume of wastes but vary in the degree to which long-term management of residuals or untreated waste is required, one or more alternatives involving containment with little or no treatment; and a no-action alternative. Alternatives that involve minimal efforts to reduce potential exposures (e.g., Site fencing, deed restrictions) should be presented as "limited action" alternatives.

The following steps shall be conducted to determine the appropriate range of alternatives for this Site:

#### • Establish Remedial Action Objectives and General Response Actions.

Based on existing information, Site-specific remedial action objectives to protect human health and the environment should be developed. The objectives shall specify the contaminant(s) and media of concern, the exposure route(s) and

receptor(s), and an acceptable contaminant level or range of levels for each exposure route (i.e., preliminary remediation goals).

Preliminary remediation goals should be established based on readily available information (e.g., Rfds) or chemical-specific ARARs (e.g., MCLs). Premcor and/or their contractor shall meet with the Illinois EPA to discuss the remedial action objectives for the Site. As more information is collected during the RI, Premcor and/or their contractor, in consultation with Illinois EPA, shall refine remedial action objectives as appropriate.

General response actions shall be developed for each medium of interest defining contaminant, treatment, excavation, pumping, or other actions, singly or in combination to satisfy remedial action objectives. Volumes or areas of media to which general response actions may apply shall be identified, taking into account requirements for protectiveness as identified in the remedial action objectives and the chemical and physical characteristics of the Site.

#### · Identify and Screen Technologies.

Based on the developed general response actions, hazardous waste treatment technologies shall be identified and screened to ensure that only those technologies applicable to the contaminants present, their physical matrix, and other Site characteristics shall be considered. This screening shall be based primarily on a technology's ability to effectively address the contaminants at the Site, but shall also take into account a technology's implementability and cost.

Premcor and/or their contractor shall select representative process options, as appropriate, to carry forward into alternative development. The Illinois EPA shall identify the need for treatability testing (as described under Task 7) for those technologies that are probable candidates for consideration during the detailed analysis.

#### Configure and Screen Alternatives.

The potential technologies and process options shall be combined into media-specific or Site-wide alternatives. The developed alternatives shall be defined with respect to size and configuration of the representative process options; time for remediation; rates of flow or treatment; spatial requirements; distances for disposal; and required permits, imposed limitations, and other factors necessary to evaluate the alternatives.

If many distinct, viable, options are available and developed, a screening of alternatives shall be conducted to limit the number of alternatives that undergo the detailed analysis and to provide consideration of the most promising process options. The alternatives shall be screened on a general basis with respect to their effectiveness, implementability, and cost. Premcor and/or their contractor shall meet

with Illinois EPA to discuss which alternatives shall be evaluated in the detailed analysis and to facilitate the identification of Applicable or Relevant and Appropriate Requirements.

#### B. Alternatives Array Document

Premcor and/or their contractor shall prepare an alternatives array document based on the results of this meeting. The Illinois EPA may submit the alternative array document to EPA for review and identification of Federal ARARs. Upon receipt of Federal ARARs, the Illinois EPA may meet with EPA to finalize ARARs and alternatives for detailed analysis for the Site.

## Task 10-Detailed Analysis of Alternatives

Upon receipt of the ARAR determination information, Premcor and/or their contractor shall conduct a detailed analysis of alternatives that shall consist of an individual analysis of each alternative against a set of evaluation criteria and a comparative analysis of all options against the evaluation criteria with respect to one another.

The evaluation criteria are as follows:

## Overall Protection of Human Health and the Environment:

Addresses whether or not a remedy provides adequate protection and describes how risks posed through each pathway are eliminated, reduced, or controlled through treatment, engineering controls, or institutional controls.

#### Compliance with ARARs:

Addresses whether or not a remedy shall meet all of the applicable or relevant and appropriate requirements of other Federal and State environmental statutes and/or provide grounds for invoking a waiver.

#### Long-Term Effectiveness and Permanence:

Refers to the ability or a remedy to maintain reliable protection of human health and the environment over time once cleanup goals have been met.

# Reduction of Toxicity, Mobility, or Volume Through Treatment:

Is the anticipated performance of the treatment technologies a remedy may employ.

#### Short-Term Effectiveness:

Addresses the period of time needed to achieve protection and any adverse impacts on human health and the environment that may be posed during the construction and implementation period until cleanup goals are achieved.

#### Implementability:

Is the technical and administrative feasibility of a remedy, including the availability of

materials and services needed to implement a particular remedial option.

#### Cost:

Includes estimated capital and operation and maintenance costs, and net present worth costs.

#### Support Agency Acceptance:

Addresses the technical or administrative issues and concerns the support agency may have regarding each alternative.

#### Community Acceptance:

Addresses the issues and concerns the public may have to each of the alternatives.

The individual analysis shall include: (1) a technical description of each alternative that outlines the waste management strategy involved and identifies the key ARARs associated with each alternative; and (2) a discussion that profiles the performance of that alternative with respect to each of the evaluation criteria. A table summarizing the results of this analysis shall be prepared. Once the individual analysis is complete, the alternatives shall be compared and contrasted to one another with respect to each of the nine evaluation criteria.

#### Task 11--FS Report

The contractor shall present the results of Tasks 8, 9 and 10 in a FS report. Support data, information, and calculations shall be included in appendices to the report. The Illinois EPA may submit a draft FS report to EPA for review. If comments on the draft FS have been received, the Illinois EPA shall ensure a revised FS report addressing the comments is prepared and may be submitted to EPA for final review.

#### Task 12--Proposed Plan

The Illinois EPA shall develop a proposed plan for the Site based on the results of the FS report. The proposed plan shall include the Illinois EPA 's preferred alternative and shall be prepared in accordance with current EPA guidance. The preferred alternative shall be protective of human health and the environment, shall attain ARARs identified for the Site or provide the basis for invoking a waiver, shall be cost effective, and shall utilize treatment technologies and permanent solutions to the maximum extent practicable.

The Illinois EPA may submit a draft proposed plan to EPA for review prior to issuing the document for public comment and may present a briefing on the proposed plan to EPA's management. Upon receipt of EPA's comments on the draft plan, if any, the Illinois EPA shall incorporate the comments into the plan and may provide EPA with the revised proposed plan for final review and approval. If necessary, the Illinois EPA shall meet with EPA to discuss the preferred alternative.

Upon issuance of the proposed plan for public comment, the Illinois EPA shall publish a newspaper notice announcing the availability of the RI/FS and proposed plan in the public repository. The Illinois EPA shall hold a public meeting on the proposed plan and solicit comments from the public. The entire public meeting shall be recorded by a court reporter.

#### Task 13--Record of Decision Preparation

Following receipt of public comments on the proposed plan, the Illinois EPA shall prepare a draft Record of Decision ("ROD") which shall include the responsiveness summary and the index for the administrative record for the Site. The ROD shall be prepared in accordance with current EPA guidance. The Illinois EPA may submit the draft ROD to EPA and other appropriate parties for review and comment. The Illinois EPA shall incorporate comments, if any, and may submit the final ROD for signature to EPA. Once the ROD is finalized, the Illinois EPA shall publish a newspaper notice of the availability of the final ROD and shall make the ROD available to the public and provide a copy of the final ROD to the Site repository.

#### Task 14--Administrative Record

During the RI/FS phase, the Illinois EPA shall establish a Site Administrative Record ("AR") for the selection of the response actions. The AR is a subset of the Site file that contains all the documents that were considered or relied upon in the selection of remedy for response actions, and acts as a vehicle for public participation. The Illinois EPA shall be responsible for establishing the Site AR and ensuring that all documents, whether they support or oppose the selected action, forming the basis for the selection of the response action are available to the public at or near the Site prior to the commencement of the public comment period, at a minimum.

The Illinois EPA shall be responsible for proper compilation and maintenance of the AR file. Judicial review of issues concerning the adequacy of any response action is limited to the information contained in the AR. The Illinois EPA shall compile and maintain the AR in accordance with the Final Guidance on Administrative Records for Selecting CERCLA Response Actions (December 1990). The Illinois EPA may submit a draft AR index to EPA for review and comments.

# STATEMENT OF WORK

FOR

Site Investigation of the Potentially Unimpacted Areas: 1, 2, 6 and 7 The Premcor Refining Group Clark Blue Island Facility

#### I. PURPOSE

The purpose of this Site Investigation (SI) is to investigate the nature and extent of contamination at the Premcor, Clark Blue Island Facility Site, (Areas 1, 2, 6 and 7) and to perform additional investigative studies as required, such as remedial investigation/feasibility study (RI/FS). Premcor shall furnish all necessary personnel, materials, and services needed for, or incidental to, performing the investigation, except as otherwise specified herein. Premcor and their consultants shall conduct the investigation in accordance with the Guidance for Performing Preliminary Assessments Under CERCLA (U.S. EPA, September 1991) and the Guidance for Performing Site Inspections Under CERCLA (U.S. EPA, September 1992), and the guidance referenced therein, as may be amended or modified by EPA.

#### II. SCOPE

The specific SI activities to be conducted at the Premcor, Clark Blue Island Facility Site, Areas 1, 2, 6, & 7 are segregated into 7 separate tasks.

- Task 1--Project Planning
- · Task 2--Community Relations
- Task 3--Field Investigations
- Task 4--Sample Analysis/Validation
- Task 5--Data Evaluation
- Task 6--SI Report
- Task 7--Administrative Record

#### Task 1--Project Planning

Premcor and their consultants shall: (1) develop the required project plans to meet the objectives of the SI and (2) initiate subcontractor procurement and coordination with analytical laboratories. The project plans shall include a detailed work plan, a quality assurance project plan ("QAPP") (to include a field sampling plan ("FSP")); and a health and safety plan.

The work plan and corresponding activity plans shall be submitted by Premcor for review and approval by Illinois EPA. Any revisions or additions to any of the project plans shall

be submitted to Illinois EPA for review and approval.

#### A. Work Plan Preparation

Premcor shall review existing information (e.g., topographic maps, aerial photographs, data collected as part of any investigation) and conduct a Site visit to become familiar with Site topography, access routes, and the proximity of potential receptors to Site contaminants.

As part of project planning, Premcor and the Illinois EPA shall meet to discuss the proposed scope of the project and the specific investigative and analytical activities that shall be required, potential Applicable or Relevant and Appropriate Requirements ("ARARs") associated with the location and contaminants of the Site and the sequencing of tasks to be completed, and whether a temporary Site office should be set up to support Site work.

Premcor and/or their contractor shall prepare a detailed work plan based on this SOW for the SI. The work plan shall include a project description and an outline of the overall technical approach, complete with corresponding personnel requirements, activity schedules consistent with the SOW timeframes (eg., Document review times), deliverable due dates, and budget estimates for each of the specified tasks.

#### B. Quality Assurance Project Plan

Premcor shall prepare a QAPP to describe all sampling and analyses planned for the Site. The QAPP should address all types of investigations conducted and should include a project description, a project organization chart illustrating the lines of responsibility of the personnel involved in the sampling phase of the project, quality assurance objectives for data such as the required precision and accuracy, completeness of data, representativeness of data, comparability of data, and the intended use of collected data, sample custody procedures during sample collection, in the laboratory, and as part of the final evidence files, the type and frequency of calibration procedures for field and laboratory instruments, internal quality control checks, and quality assurance performance audits and system audits, preventive maintenance procedures and schedule and corrective action procedures for field and laboratory instruments, specific procedures to assess data precision, representativeness, comparability, accuracy, and completeness of specific measurement parameters, and data documentation and tracking procedures. Standard operating procedures for Quality Assurance/Quality Control ("QA/QC") that has been established by EPA shall be referenced and not duplicated in the QAPP.

#### C. Field Sampling Plan

Premcor shall prepare a field sampling plan ("FSP") that includes an outline of all necessary activities to obtain additional Site data. It shall contain an evaluation explaining what additional data are required to adequately characterize the Site, and

support the evaluation of remedial technologies. The FSP should clearly state sampling objectives; necessary equipment; sample types, locations, and frequency; analyses of interest; and a schedule stating when events shall take place and when deliverables shall be submitted. This document should be submitted as part of the QAPP.

#### D. Health and Safety Plan

Premcor shall develop a HSP on the basis of Site conditions to protect personnel involved in Site activities and the surrounding community. The plan shall address all applicable regulatory requirements contained in 20 CFR 1910.120(i)(2)—Occupational Health and Safety Administration, Hazardous Waste Operations and Emergency Response, Interim Rule, December 19, 1986; U.S. EPA Order 1440.2—Health and Safety Requirements for Employees Engaged in Field Activities; U.S. EPA Order 1440.3—Respiratory Protection; U.S. EPA Occupational Health and Safety Manual; and U.S. EPA Interim Standard Operating Procedures (September, 1982).

The plan shall provide a Site background discussion and describe personnel responsibilities, protective equipment, health and safety procedures and protocols, decontamination procedures, personnel training, and type and extent of medical surveillance. The plan shall identify problems or hazards that may be encountered and how these are to be addressed. Procedures for protecting third parties, such as visitors or the surrounding community, shall also be provided. Standard operating procedures for ensuring worker safety shall be referenced and not duplicated in the HSP.

The work plan and corresponding activity plans shall be submitted to Illinois EPA, for review and approval.

#### Task 2--Community Relations

The Illinois EPA shall be primarily responsible for community relations activities at this Site. The community relations program shall be integrated closely with all remedial response activities to ensure community understanding of actions being taken and to obtain community input on the RI/FS progress as well as progress on this SI on the potentially unimpacted areas.

The Illinois EPA shall prepare a Community Relations Plan ("CRP") on how citizens want to be involved in the process based on interviews with community representatives and leaders by state agency staff. The CRP shall describe the types of information to be provided to the public and outline the opportunities for community comment and input during the RI/FS. Deliverables, schedule, staffing, and budget requirements shall be included in the plan.

Premcor shall provide appropriate assistance to the Illinois EPA in its development and implementation of the community relations program. Community relations activities for the Site shall include, but may not be limited to, the following:

- Establishment and maintenance of a community information repository(s), one of which shall house a copy of the administrative record.
- Preparation and dissemination of news releases, fact sheets, slide shows, exhibits, and other audio-visual materials designed to apprise the community of current or proposed activities.
- Development and upkeep of a mailing list that includes nearby and interested residents, public interest groups, and elected officials.
- Arrangements of briefings, press conferences, workshops, and public and other informal meetings.
- Analysis of community attitudes toward the proposed actions.
- Assessment of the successes and failures of the community relations program to date.
- Preparation of reports and participation in public meetings, project review meetings, and other meetings as necessary for the normal progress of the work.

Deliverables and the schedule for submittal shall be identified in the community relations plan. The Illinois EPA shall determine any revisions or additions to the CRP.

#### Task 3-Field Investigations

Premoor shall conduct investigations necessary to characterize the Site and to evaluate the actual or potential risk to human health and the environment posed by the Site. Investigation activities shall focus on problem definition and result in data of adequate technical content to evaluate the need for further RI/FS activities.

Strict chain-of-custody procedures shall be followed and all sample locations shall be identified on a Site map. Premcor shall provide management and QC review of all activities conducted under this task. Activities anticipated for this Site are as follows:

- Surveying and Mapping of the Site. Develop a map of the Site that includes topographic information and physical features on and near the Site. If no detailed topographic map for the Site and surrounding area exists, a survey of the Site shall be conducted. Aerial photographs should be used, when available, along with information gathered during the preliminary Site visit to identify physical features of the area.
- Waste Characterization. Determine the location, type, and quantities as well as the physical or chemical characteristics of any waste remaining at the Site. If hazardous substances are held in containment vessels, the integrity of the

containment structure and the characteristics of the contents shall be determined.

- Hydrogeologic Investigation. Determine the presence and potential extent of ground water contamination. Efforts should begin with a survey of previous hydrogeologic studies and other existing data. The survey should address the soil's retention capacity/mechanisms, discharge/recharge areas, and regional flow directions and quality. Local/Site-specific hydrogeologic characteristics including depth to groundwater, hydraulic conductivity, local discharge/recharge areas, groundwater flow direction, and other pertinent aquifer characteristics should also be determined. The need for groundwater modeling to predict groundwater flow conditions should also be evaluated. Results from the sampling program should estimate the horizontal and vertical distribution of contaminants, the contaminants' mobility, and predict the long-term disposition of contaminants.
- Soils and Sediments Investigation. Determine the vertical and horizontal extent of contamination of surface and subsurface soils and sediments and identify any uncertainties with this analysis. Information on local background levels, degree of hazard, location of samples, techniques used, and methods of analysis should be included. If initial efforts indicate that buried waste may be present, the probable locations and quantities of these subsurface wastes should be identified through the use of appropriate geophysical methods.
- Surface Water Investigation. Estimate the extent and fate of any contamination in the nearby surface waters. This effort should include an evaluation of possible future discharges and the degree of contaminant dilution expected.
- Air Investigation. Investigate the extent of atmospheric contamination from those contaminants found to be present at the Site. This effort should assess the potential of the contaminants to enter the atmosphere, local wind patterns, and the anticipated fate of airborne contaminants.

Information from this task shall be summarized and included in the SI Report for the Potentially Unimpacted Areas.

#### Task 4--Sample Analysis/Validation

Premcor shall develop a data management system including field logs, sample management and tracking procedures, and document control and inventory procedures for both laboratory data and field measurements to ensure that the data collected during the investigation are of adequate quality and quantity to support a decision of further studies via an RI/FS or a no further action decision. Collected data should be validated at the appropriate field or laboratory QAQC III level to determine whether it is appropriate for its intended use. Premcor and their consultants shall provide task management and quality controls. Premcor shall use an Illinois National Environmental Laboratory Accreditation Conference ("NELAC") Standards certified Lab Program for use as

appropriate for analysis of field samples. Illinois EPA shall have primary responsibility for ensuring that validation of all data is performed in accordance with the approved QAPP for the Site. Premcor shall incorporate information from this task into the SI Report.

#### Task 5--Data Evaluation

Premcor shall analyze all SI data and present the results of the analyses in an organized and logical manner so that the relationships between Site investigation results for each medium are apparent. Premcor and their consultants shall prepare a summary that describes (1) the quantities and concentrations of specific chemicals at the Site and the ambient levels surrounding the Site; (2) the number, locations, and types of nearby populations and activities and, (3) the potential transport mechanism and the expected fate of the contaminant in the environment. As part of this evaluation, a determination by Illinois EPA shall be made as to whether or not all necessary data has been obtained for the Site.

#### Task 6--SI Report

Premotor and/or their contractor shall present the results of Tasks 2 through 5 in a Site Investigation Report for Areas 1, 2, 6, and 7. Support data, information, and calculations shall be included in appendices to the report. The Illinois EPA may submit a draft to EPA for their review.

#### Task 7--Administrative Record

This task is included in this SOW due to the ongoing RI/FS at the facility and any information gained by the SI activities at the Site may be included in the AR. During the RI/FS phase, the Illinois EPA shall establish a Site Administrative Record ("AR") for the selection of the response actions. The AR is a subset of the Site file that contains all the documents that were considered or relied upon in the selection of remedy for response actions, and acts as a vehicle for public participation. The Illinois EPA shall be responsible for establishing the Site AR and ensuring that all documents, whether they support or oppose the selected action, forming the basis for the selection of the response action are available to the public at or near the Site prior to the commencement of the public comment period, at a minimum.

The Illinois EPA shall be responsible for proper compilation and maintenance of the AR file. Judicial review of issues concerning the adequacy of any response action is limited to the information contained in the AR. The Illinois EPA shall compile and maintain the AR in accordance with the Final Guidance on Administrative Records for Selecting CERCLA Response Actions (December 1990). The Illinois EPA may submit a draft AR index to EPA for review and comments.

I:\MyFiles\MyFiles\EWALLACE\wpdocs\WPDOCS\premcor\SOWdrafts\SISOWFinal011404.wpd

August 11, 2010



Premier People, Products and Services

Premoor Alsip Distribution Center 3600 West 131st Street Alsip, Illinois 60803-1535

Nicole M. Wilson, P.E. Environmental Protection Engineer Illinois EPA MC #24 1021 North Grand Avenue East P.O. Box 19276 Springfield, Illinois 62794-9276

Re: The Premcor Refining Group Inc.

Blue Island, IL Site

Case No. 04CH01571 – Consent Order Monthly Progress Report – July 2010

Remedial Investigation/Feasibility Study (RI/FS) Areas

Dear Ms. Wilson:

Pursuant to section IX, paragraph 24 of the Consent Order, The Premcor Refining Group Inc. (Premcor) is submitting 2 hard copies and 2 CD copies of the July 2010 monthly progress report for the Remedial Investigation/Feasibility Study (RI/FS) areas at the Premcor Blue Island Site. Per the June 26, 2007 IEPA approval of the movement of Areas 1, 2 and 6 into the RI/FS program and the May 6, 2009 IEPA approval of the movement of Area 7 into the RI/FS program, the RI/FS areas include all areas of the site—the Northwest Property (Area 1), the West Property (Area 2), the Northwest Terminal (Area 3), Southwest Terminal (Area 4, which includes the 19-acre Metropolitan Water Reclamation District (MWRD) parcel), the Triangle Area (Area 5, also known as the former refinery area), the Administration Offices area (Area 6), and the Parco Foods Property (Area 7, also known as the Cookie Factory).

If you have any questions regarding this submittal or need additional information, please feel free to contact me at (708) 385-9513.

Sincerely,

Thomas F. Mroz, Jr.

Environmental Manager

The Premcor Refining Group Inc.

Cc: Mr. Howard Chinn - Chief Engineer IAGO

Mr. Patrick Dunne – URS Corporation (via e-mail)

Mr. Adam Falkauff - Liberty International Underwriters (via e-mail)



# Monthly Report Remedial Investigation/Feasibility Study Areas Period: July 2010

The Premcor Refining Group Inc.
Blue Island Facility
Blue Island, IL

Prepared for:

The Premcor Refining Group Inc.

Prepared by:

**URS** Corporation

August 2010

## TABLE OF CONTENTS

Secti	ion_	Page No.	
1.0	Introduction		1
2.0	Activities Completed in July 2010	***************	.3
3.0	Future Plans		2

#### 1.0 Introduction

On March 16, 2004, The Premcor Refining Group Inc. (Premcor) and the State of Illinois entered into the Consent Order for Remedial Investigation/Feasibility Study (RI/FS) and Site Investigation (SI) at the Premcor Blue Island Facility. The Consent Order requires Premcor to provide separate monthly progress reports for the RI/FS areas and SI areas on the 15<sup>th</sup> of each month. The monthly reports are to be submitted to the Illinois Environmental Protection Agency (IEPA) and the Illinois Attorney General (IAG).

This monthly report documents RI/FS activities conducted during this reporting period (July 2010) and provides a chronological summary of RI/FS activities completed to date.

Per the June 26, 2007 IEPA approval of the movement of Areas 1, 2 and 6 into the RI/FS program and the May 6, 2009 IEPA approval of the movement of Area 7 into the RI/FS program, the RI/FS areas include all areas of the site the Northwest Property (Area 1), the West Property (Area 2), the Northwest Terminal (Area 3), Southwest Terminal (Area 4, which includes the 19-acre Metropolitan Water Reclamation District (MWRD) parcel), the Triangle Area (Area 5, also known as the former refinery area), the Administration Offices area (Area 6), and the Parco Foods Property (Area 7, also known as the Cookie Factory).

The first Monthly Report, for March 2004 activities, was submitted to the IEPA and IAG on April 14, 2004. Given that the Consent Order was executed in mid-March 2004 and no field activities were completed from March through July 2004, Premcor submitted one report for the respective monthly activities. Since URS Corporation (URS) began RI/FS field activities in August 2004, Premcor has submitted two separate reports to document RI/FS and SI activities. Subsequent monthly reports were submitted by the 15<sup>th</sup> of each month. The next Monthly Report for August 2010 RI/FS activities will be submitted to the IEPA and IAG by September 15, 2010.

This monthly report documenting RI/FS activities includes the following:

Activities Completed during the Reporting Period (July 2010) are provided in Section 2.0. The Section provides:

- A description of the actions that have been taken to comply with the Consent Order during the reporting month; and
- All results of sampling and tests and all other data (soil borings, field sampling, chains of custody) received by Premcor.

Future Plans (August and September 2010) are provided in Section 3.0. The Section provides:

- A description of work planned for the next two months with schedules relating such work to the overall project schedule for RI/FS and Site Investigation completion; and
- A description of all problems encountered and any anticipated problems, any actual or anticipated delays, and solutions developed and implemented to address any actual or anticipated problems or delays.

# 2.0 Activities Completed in July 2010

#### **Consent Order Required Deliverables**

In accordance with the Consent Order requirements, Premcor prepared and submitted the monthly report for June 2010 activities to the IEPA and IAG. The monthly report was received by the IEPA and IAG by the Consent Order due date.

On July 14, 2010, the IEPA approved URS and Premcor's Request for Reduced Groundwater Level Monitoring Frequency, submitted June 17, 2010. The approval reduced groundwater level collection frequency from quarterly to annually.

On July 12, 2010, URS held a conference call with the IEPA's consultant, TetraTech EMI to discuss the response to IEPA comments on the ecological risk assessment portion of the *RI Report*.

#### Field Activities

The Consent Order was executed in mid-March 2004, and the IEPA approved the six project plans in July 2004. Premcor forwarded the July 21, 2004 letter providing 14-day notification for field work activities. URS began field investigation activities in August 2004 in the Southwest Terminal (Area 4). Field activities for the geoprobe investigation were completed in December 2004.

During February and March 2005, URS installed, developed, and sampled the monitoring wells and piezometers in the Southwest Terminal (Area 4) and Northwest Terminal (Area 3). In April 2005, URS conducted hydraulic conductivity tests on the monitoring wells and piezometers.

In November 2005, URS completed the free-phase hydrocarbon delineation activities in the Northwest and Southwest Terminals (Areas 3 and 4, respectively), as well as sediment and surface water sampling in Wireton and Stony Creeks. Temporary wells in the Triangle Area (Area 5) were installed and sampled in December 2005 and January 2006.

In February 2006, sediment and surface water samples were collected from the Cal Sag Channel.

On March 7, 2006, URS collected water level measurements from the facility monitoring wells.

On April 4, 2006, URS collected water level measurements from the facility monitoring wells. On April 5, 2006, the third quarterly groundwater sampling event commenced. Sampling was completed on April 14, 2005.

On May 2, 2006, URS collected water level measurements from the facility monitoring wells. On May 22, 2006, URS commenced field activities to install and sample the wells proposed in the April Technical Memorandum, in addition to the proposed Triangle Area (Area 5) monitoring wells and site-wide bedrock wells, as approved by the IEPA.

On June 2, 2006, URS collected water level measurements from the facility monitoring wells, including the wells installed in May 2006. URS continued to install the wells proposed in the April Technical Memorandum in June 2006.

On July 5, 2006, URS collected water level measurements from the facility monitoring wells, including the wells installed in June 2006. URS continued to install the wells proposed in the April Technical Memorandum during July 2006. On July 6, 2006, the fourth quarterly groundwater sampling event commenced. Sampling continued through July 19, 2006.

On August 2, 2006, URS collected water level measurements from the facility monitoring wells, including newly installed and developed wells. URS continued to install the wells proposed in the April Technical Memorandum and the Bedrock Rationale during August 2006.

On September 6, 2006, URS collected water level measurements from the facility monitoring wells, including newly installed and developed wells. URS continued to install the wells proposed in the April Technical Memorandum and the Bedrock Rationale during September 2006. Bedrock well installation was completed September 25, 2006.

On October 9, 2006, URS collected water level measurements from the facility monitoring wells, including newly installed and developed wells. On October 10, 2006 the fifth quarterly groundwater sampling event commenced. The approved wells in Areas 1, 2, 3 and 4 were sampled, along with additional approved locations in the Triangle Area (Area 5). Sampling was completed on October 24, 2006.

On November 9-10, 2006, URS collected water level measurements from the facility monitoring wells, including newly installed and developed wells. Also during November, slug testing was performed on wells installed in the previous field mobilization.

On December 5, 2006, URS collected water level measurements from the facility monitoring wells. Slug testing of wells installed during the tech memo mobilization occurred in December 2006.

On January 9, 2007, URS collected water level measurements from the facility monitoring wells. On January 10, the sixth quarterly groundwater sampling event commenced and included the first round of quarterly sampling for select bedrock wells. Sampling was completed on February 2, 2007.

On February 6, 2007, URS collected water level measurements from the facility monitoring wells. The January 2007 quarterly sampling event concluded on February 2, 2007.

On March 6-7, 2007, URS collected water level measurements from the facility monitoring wells.

On April 3, 2007, URS collected water level measurements from the facility monitoring wells. On April 4, 2007 the seventh quarterly groundwater sampling event commenced. Select wells in the Northwest Property (Area 1) and the West Property (Area 2) were sampled and included in the Northwest Terminal (Area 3) sampling plan. The first quarterly sampling of the IEPA-approved bedrock locations also occurred in April 2007.

On May 7, 2007, URS collected monthly water level measurements from the Triangle Area (Area 5) wells and the site-wide bedrock wells; per the request for groundwater level measurement reduction submitted to the IEPA and approved March 9, 2007.

On June 6, 2007, URS collected monthly water level measurements from the Triangle Area (Area 5) wells and the site-wide bedrock wells.

On July 5 and 6, 2007, URS collected monthly water level measurements from the facility monitoring wells. On July 9, the eighth quarterly groundwater sampling event commenced. After IEPA approval, URS implemented the interim sampling program, reducing the number of wells sampled to the list approved by the IEPA.

On August 1, 2007, URS collected monthly water level measurements from the Triangle Area (Area 5) wells and the site-wide bedrock wells. On August 28, 2007, the bedrock step-out activities commenced. Bedrock step-outs and permanent bedrock wells were proposed for the Northwest Property (Area 1), West Property (Area 2), Northwest Terminal (Area 3), and Southwest Terminal (Area 4). The bedrock step-out investigation also includes areas requiring off-site access by Premcor.

On September 10, 2007, URS collected monthly water level measurements from the Triangle Area (Area 5) wells and the site-wide bedrock wells. Bedrock step-out activities continued through the month of September.

On October 4 and 5, 2007, URS collected monthly water level measurements from the facility monitoring wells. On October 8, the ninth quarterly groundwater sampling event commenced. Quarterly groundwater sampling activities were completed October 31, 2007.

Proposed product delineation activities in the Triangle Area (Area 5) and Southwest Terminal (Area 4) commenced October 17, 2007. On October 26, 2007, damaged temporary wells SWTF-33W and SWTF-34W in the Southwest Terminal (Area 4) were abandoned and new temporary

wells were installed (SWTF-33WR and SWTF-34WR). On October 31, 2007, the proposed temporary wells on the NuStar (formerly Valero LP) property were installed.

On November 13, 2007, URS collected monthly water level measurements from the Triangle Area (Area 5) wells and the site-wide bedrock wells. The SWTF (Southwest Terminal (Area 4)) and NWTF (Northwest Terminal (Area 3)) wells installed in October 2007 were developed in November 2007.

On December 12, 2007, URS collected monthly water level measurements from the Triangle Area (Area 5) wells and the site-wide bedrock wells.

On January 7, 2008, URS collected water level measurements from the facility monitoring wells. On January 8, 2008 the tenth quarterly groundwater sampling event commenced. Sampling was completed on January 28, 2008.

On February 5, 2008, URS collected monthly water level measurements from the Triangle Area (Area 5) wells and the site-wide bedrock wells.

On March 4, 2008, URS collected monthly water level measurements from the Triangle Area (Area 5) wells and the site-wide bedrock wells.

On April 8, 2008, URS collected quarterly water level measurements from the facility monitoring wells. On April 9, 2008 the eleventh quarterly groundwater sampling event commenced. Sampling was completed on May 9, 2008.

In May 2008, monthly water level measurements were discontinued due the monitoring frequency being reduced to quarterly in accordance with the IEPA verbal approval on February 8, 2008 of the *Request for Reduced Groundwater Level Monitoring Frequency for Triangle Area and Bedrock Wells* letter submitted on January 18, 2008. On May 28, 2008, URS and Premcor met with Commonwealth Edison (ComEd) and its environmental subcontractor to discuss the proposed ComEd-lead remediation of a transformer release (certified non-PCB containing

mineral oil) located in the Administration Offices Area (Area 6). The spill occurred some time in December of 2007 as a result of vandalism of the transformer. ComEd reported the estimated 6,800-gallon release to the Illinois Office of Emergency Response. The proposed area of remedial excavation is approximately 160' long by 75' to 90' wide by 4' deep. Site temporary monitoring well TA-47W is located within the anticipated remediation area and will be properly abandoned prior to the start of remedial activities. Proposed remediation and well abandonment activities were discussed with the Premcor IEPA RPM in a May 29, 2008, IEPA conference call. IEPA approval to abandon temporary monitoring well TA-47W was received on June 6, 2008. The first phase (excavation and backfilling of the planned excavation) of the ComEd transformer release remediation in the Administration Offices Area (Area 6) was initiated on June 11, 2008 and completed on June 26, 2008.

On May 23, 2008, Premcor submitted a follow-up letter to the Illinois Emergency Management Agency (IEMA) and the IEPA detailing clean-up efforts following an environmental incident (#20080545) releasing approximately 20 gallons of unleaded gasoline occurring on April 23, 2008, at the Vapor Recovery Unit in the Northwest Terminal Facility (Area 3). Remediation measures have been completed and any further response activities will be conducted as part of the ongoing site remediation program.

On June 27, 2008, Premcor and URS met with the IEPA to finalize and submit the Revised Risk Assessment Memoranda Nos. 1, 2, and 3.

On July 8, 2008, URS collected quarterly water level measurements from the facility monitoring wells. On July 9, 2008 the twelfth quarterly groundwater sampling event commenced. Sampling was completed on July 25, 2008.

No field work was conducted in August 2008.

No field work was conducted in September 2008.

No field work was conducted in October 2008.

No field work was conducted in November 2008.

No field work was conducted in December 2008.

On January 20-21, 2009, URS collected sitewide quarterly groundwater levels

On February 24, 2009, separate phase liquid samples were collected from well TA-17RW and AO-7W for determination of physical parameters.

Between March 23, 2009 and May 4, 2009, Weaver Boos Consultants, the consultant for Blue Island Phenol LLC (BIP), sampled soils, groundwater, sediment, and surface water at the Northwest Property (Area 1) in response to an August 24, 2008 fire and chemical release at the BIP facility. Water discharged during fire suppression activities at the facility flowed onto the Premcor Northwest Property and discharged into Wireton Creek. The objective of the BIP investigation was to establish the potential nature and extent of BIP chemicals on the Northwest Property as a result of the chemical release. URS personnel documented investigation activities on the Northwest Property.

On April 21-22, 2009, URS collected site-wide quarterly groundwater levels. On April 22, 2009, the semi-annual sampling event, as proposed in the IEPA-approved *Site-Wide Interim Groundwater Monitoring Program, Revision 01*, commenced. Sampling of 39 wells was completed on April 29, 2009.

No field work was conducted in May 2009.

After securing final access agreements with three adjacent off-site property owners to the west and south of the WDA and NWTF, bedrock step-out boring and groundwater sampling activities were initiated on June 22, 2009 and completed on July 8, 2009. The objective of the bedrock investigation was to establish the extent of benzene in groundwater in two off-site areas where benzene exceedances had not been fully delineated. Fourteen step-out borings were advanced

into the shallow bedrock as part of the investigation. One conventional two-inch monitoring well was proposed (WDA-21BR), and an additional well was constructed at one of the 14 boring locations (WDA-27BR). A groundwater grab sample was collected from the bedrock at each boring location and submitted for chemical analysis of benzene, ethylbenzene, toluene, and xylene (BETX).

On July 22-23, 2009, URS collected site-wide quarterly groundwater levels.

No field work was conducted in August 2009.

No field work was conducted in September 2009.

On October 5, 2009, URS collected site-wide quarterly groundwater levels. The semi-annual groundwater sampling event was initiated on October 7, 2009, and completed on October 20, 2009 Sixty-four ground water monitoring well locations were sampled as part of the field event.

On November 16, 2009, URS installed the proposed additional bedrock wells on the TEPPCO property. Representatives from URS conducted a wetlands determination for the WDA and NWDA from November 18-20, 2009. A representative from TTEMI was present for the wetlands determination.

No field work was conducted in December 2009.

On January 12-13, 2010, URS collected site-wide quarterly groundwater levels.

No field work was conducted in February 2010.

No field work was conducted in March 2010.

On April 6-7, 2010, URS collected site-wide quarterly groundwater levels. The semi-annual groundwater sampling event was initiated on April 7, 2010 and completed on April 15, 2010. Forty-one groundwater monitoring well locations were sampled as part of the field event.

On May 13, 2010, the well abandonment activities proposed in *Monitoring Well Integrity Inspection* – *Rationale for the Abandonment of Damaged Monitoring Wells* commenced. Well abandonment activities are ongoing.

As discussed in the Site-Wide Interim Groundwater Monitoring Program, Revision 01, the validated data for the April semi-annual event are presented in this report. Forty-one wells were sampled between April 7 and 15, 2010. Analytical results were compared to both the TACO Tier 1 Class I groundwater remediation objective (GRO) and the risk-based screening levels established in the Remedial Investigation Report, submitted April 14, 2010. Analyte concentrations were typically within the range of historical values seen at all sampling locations; no substantial increases in concentration were observed. A decrease in the benzene concentration at TA-32W occurred in October 2009 sampling results, and the well was removed from the sampling program, per the approved Site-Wide Interim Groundwater Monitoring Program.

No field work was conducted in June 2010.

## 3.0 Future Plans

Activities planned for August and September 2010 include:

- Submission of the response to IEPA technical review comments for the *Remedial Investigation Report*, submitted April 14, 2010.
- Follow-up communications with the IEPA to discuss IEPA comments on the draft RI report.

Premcor and URS will conduct conference calls as needed with the IEPA and TetraTech EMI to discuss task specific details and schedules. The next conference call is currently not scheduled.

## **Anticipated Problems or Delays**

No anticipated problems or delays have been identified at this time.

STREET DATE OF CONSENT ORDER																		
	ALCUT SONARY STREET					11			0.4									
SABMITTAL	DESCRIPTION OF ITEM SUBMITTED		TYPE OF SUBMITTAL		Mary Mary Mary Mary Mary Mary Mary Mary	Control to the control of			SLEWITALPR	SUBMITIAL PREPARATION & DUE DATE	EDATE	8	The same of the sa	7		T S	ACTICA ACTICA	REMARS
CONTROLLER CONTROLLER SOV-CHANK COUNT CONTROLLER COUNT CONTROLLER SUITER		Q _ < Z < Q Q = < Z − Z Q Ø Q < F <	<b>ひひばれりひしまま</b> <b>ひのれれまりとりとのとりは</b> <b>日日のまする</b> <b>日日のは下さ</b> <b>日日のは下さ</b> <b>日日のは下さ</b> <b>日日のは下さ</b>	E CASA E SACA AS	TOTAL MENDEN DI	THE STATE OF THE S	COMPANY TARKET DAY	ACTUAL DIVIS	TARESTONIE	CUALDARE T	MALA APPROVAL NE PREMETORI A LOS VENETORIS FACTORIS FACTO		TO JEGA A MOLI P. TAPECT ACTUM GATE	TO ERA A LIGH LONE TOPE THE TOPE TOPE THE TOPE TOPE THE TOPE THE TOPE TOPE TOPE TOPE TOPE TOPE TOPE TOP	PRIO GENED	AL CORRECT LA CORRECT		7. F
1	4	e >	- i	E S		ATTENDED IN THE STATE OF	OUT: 4/19/2004	402//507	4/29/2004	8/12/2004	5/4/2004 SV	\$12200	S10/2004 S	S 142504 S	5142004	E/15/2004		- Carrier - Carr
-	leid Sampling Plan for Areas 1,2,8,7	< >		8 8	- 1			L		5/13/2004	_	L				5/15/2004	OAPP cor	DAPP combined for RIFS and Si
T	CAPTION NAME 1,20,7	< >			1	L.				W. 27.2004						5/14/2004	Combined	Combined with MASP for RIFS
CO, P. co.	Spain data salary real for the Street resolution of the CEAA Comments on the Project Plans	c	×	96	1412				Ш					is	11.	812/2004		
CO, p. 20 Revised SI Work Plan	k Plan	×		45	100	6/28/2004 7/2/2004	90% 6/29/2004	DA TREEON	630/2004	7:9/2001	7/1/2004	THEIRDOW	1/2/2004	TIEZYM 7	7.8'2004 J	705V2004		
	Sumpling Plan	×		2	100	8/28/2004 772/2004	COX. 6/29/2004	7/6/2004	6/30/2004	7/8/2004	7/1/2004	7/8/2004	7/2/2004	719/2004	TAYARH T	Trakenos		
	or the SI	×		48		6/20/2004 Trg:2004	000 6/20/2004	104 7/8/2004	630/2004	779/2008	7/1/2004	7/6/2004	7/2/2004	T/7/2004	T/WZDM T	7725/2004	QAPP cor	DAPP comblined for RIFFS and SI
	Payend Hanth and Selety Plan for the St	×		89					6/22/2004	5/23/20Di	6/22/2008 GV	\$22,200a 6	6/24/2004	TITESTA	7.97.004	1/25/2004	Combined	Combined HASP with RVFS
	IEPA Approval of the GAPP, HASP, and SI FSP and WP			96	100									t <sub>c</sub>	7714,2004	8/8/2004	July 14, 2	July 14, 2004 IEPA letter
CO, p 22 Ste Investigation Report	п Нероп		×											-	N.	11	schedule	in the work plan
CO, SECTION	J. 18											+						
CO, p 28 solection of the a	Documents developed during the course of the RVFS upon which adjection of the response action may be based												-	-	TECONOS.		Revisions	submitted on January 28, 2005 approved
Holow Stem Au	ger Haltonalo - Southwest Tormital (Area 4) ger Rationalo - Northwest Terminal (Area 3)	**	××					$\parallel$				#	+	12	2/15/2005	4	Revisions	submitted on March 14, 2005 approved b
OAPP Adderdu	m 01 (Pesticide Decision Tree)	X .	Ŧ			-		-					1		BLV2/05		Ravatons	submitted on March 24, 2006 approved to
RIFS FSP Add	endum 01 (Free Plase Hydrocarbon Defression Plan)		H		0.00										en2005	100000	Ravelons	submitted on October 26, 2005 approved
RUFS FSP Add	endum D2 (Othy Monitoring for Areas 3 and 4)	1	I		Salaki Maran							+	-	is is	6-9-3005 718/3/05		Summary	Reveion automited on August 11, 2005 approved by terra Summary report - No approved repossary
SI Activities - Di	Si Activios - Diosel spill at Tarks 77 and 78	H	< ×		2000						H	$\parallel$		E.	7/16/2005	T Comment	Summary	Summary report - No approval necessary
RIFS FSP Add	RIFS FSP Addendan 03 (Sampling Prioritization)	-	×										+	12	1/30/206		Revisions	Approved by IEPA April 9, 2000 Revision submitted on September 29, 2008 approved by IEPA
RIFS FSP Add	RIFS FSP Addendum Dx (NNTF-EZW Failwale)	×										-		6	8/14/2005	2000	Revisions	Revision submitted on August 25, 2006
FPH Activities Summary Repo			×		ALC: N					Ī	-			2 65	WIS KNOE	10000	Rovelons	Bayeson sucerited May 11, 2008 approved by IEPA
Dovin Data Surr	non													œ	8/16/2006	STATE OF THE PARTY	Revisions	Revision submitted September 21, 2006
Quarterly Groun	Report for January 2006 Event enty Groundwater Martforting Plan	×			1,47	ú							<u></u>		17/2008		Security	TO IET'A NOVOTROBE IV, AUGO
for Bedrock We		×										-			TO COB		nation of	definition to little parallel 1, 2000
Quarterly Groun	Starterly Groundwater Sampling Report for April 2008 Event	×											1	13	127242009	-	Submitted	Submitted to IEPA December 28, 2007
Quarterly Groun	Quarterly Dicountivezor Sampling Report for July 2008 Event	×					-						1	*	1723/2007	のでき	Submitted	Submitted to IEPA January 23, 2007
RIFS FSP Adde	RIJFS FSP Addendum 07 - Bedrock Step-Out Rathrale	×			N.							-	+	2	1/19/2007	de d	Sukmilled	d to IEPA Jerxiory 19, 2007
Letter to Regues	eter to Resusst Qualitity GW Level Callection		*												2,772,007		Submitted March 9, 3	Submitted to IEPA February 7, 2007. IEPA approval receive March 9, 2007.
S. Introduction of E.	Schools about 10 September 12		_											ñ	2372CO7		Submitted	Submitted to IEPA February 27, 2007.
	Bancal for Ontobar 1900 Count	,													3-972007		Submitted	Submitted to IEPA March 9, 2007
	П													8	3734,2007		Submitted	Submitted to IEPA March 28, 2007
and Address of the Ad															47:2008		Submitted	Submitted to IEPA April 6, 2007
TUSA ASSOCIATION	Advantage wellscarped to the control of the control													1	BOOKERA		Submilling	Submilling to IEPA April 13, 2007
Response to 15	Hexpose to IEPA Comments on RVFS FSP Add 07 - Bedroot		×			-								2	6710/20107		Submitted	Submitted to IEPA May 10, 2007
Quarterly Grou	pring			ir.										2	M187007		Submitted	Submitted to IEPA May 16, 2007
Charle		k :	* ' '		1									3	6/19/2007		Submitted	Submitted to IEPA June 19, 2007
Response to IEI	Therm Concentration from International Property of States of Comments on EPA Technical Review Comments or EPA Technical Review Comments or Country and Concentration Report, January 2007	•												-	2000000		Saturdina	Submitted to IED & 144-13 2007
Sampling Even	Sampling Event	-					-	-										1007 100 100 100 100 100 100 100 100 100

STAZON EFFECTIVE DATE OF CONSENT ORDER	Time								PATERIAL STATES
DESCRIPTION OF ITEM SUSMITTED	TYPE OF SUBMIT		TO DEFENDE AND TREMPOR & LIBER	SLOWITH, PPEPARATION & DUE DATE TO PREMION &   PINAL DIGITY TO PREMION &   PINAL AS	S DUE DATE THIRD APPROVAL NEEDED BY	TO EPA & IM (AB APPROPRIATE)		18	250
Co-CORNAIN Co-CORNAIN Co-WORK (Co-CORNAIN CORNAIN CORNAIN CORN	0443-208 045-208 050-209 060-209 060-209 060-209 060-209 043-209	1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	SECTION DISCUSSION OF THE PROPERTY OF THE PROP	NAMES OF THE PARTY		TAPREST ACTIVAL DATE DATE TABLEST TABL	OSINED CSINED	IN CORPORATION OF THE PROPERTY	
Resoonse to IEPA comments on NAX Assessment Technical		E .		a t	-		1278/2007		Submitted to IEPA December 18, 2007
Memorada 1, 2 and 3 (spdated memos submitted as well)  Control of transforme Manipole Report, July 2007 Sampling	×						1/3/2008		Submitted to IEPA January 3, 2008
Lotte to Request Quarterly GW Lovel Colection for Triangle Area	×						1/16/2009		Submitted to IEPA January 18, 2008. IEPA vedbal opproval received February 8, 2008.
and Bedrock Wells Program - Triangle (Area 5) Wells and Proposed Interfer Mells and	×					3/20/2008	GB 3421/2009		Submitted to IEPA March 20, 2008
Strewton Bedrock Wells Quarterly Groundwaler Monitoring Report, October 2007 Sampling	×					3/21/2008	3724/2009		Submitted to IEPA March 21, 2008
Event	×						2/16/2008		Submitted to IEPA March 16, 2008.
Submission of Revised Schedule RIFS PSP Addendum Nb. 08 - Additional Bedrock Step-out	×	0.00		500007-1-5	SYLEYZOOB	6/15/2008 E/14/25/03	50 STIP2008		Submitted to IEPA May 15, 2008
Guaranty Groundwater Monitoring Report, January 2008 Sampling	-	We see		573,2738	9/19/2008	5/15/2008	5000:51.79	金を	Submitted to IEPA May 15, 2008
Gvent	× ×					6027/2008	8022//2/9		Submitted to IEPA June Z7, 2008 - Hard Delibered during Site
Revised Rick Assessment Technical Momorada 1, 2 and 3 Response to IEPA commerts on Revised Rick Assessment Technical	*					8/6/2003	NOS BATTERON		Submitted to IEPA August 6, 2008
Memoranda 1, 2, and 3 Respanse to IEPA technical comments on RWFS FSP Addednum No.	*					6/7/2008	08 avis/2003		Submitted to the IEPA August 7, 2008
09 - Additional Bearcot Sub-Litt Handhale  Quarterly Groundwater Monitoring Report - April 2008 Sampling	. ,					19200	820/3/05		Submitted to FEPA August 19, 2006
Event Proposal to abandson wells damaged during ComEd excavalion and	•					6/202008	03 8/21/2008		Submitted to IEPA August 20, 2006
backs activities	1						11/19/2006		Submitted to IEPA Nevember 19, 2008
Strewide totarion Monitoring Program Quartarly Groundwater Monitoring Report - July 2009 Sampling	×						1/29/2009		Submitted to IEPA January 29, 2009
Event Response to IEPA Technical Review Comments on Ste-Wide	× :						8/15/2008		Submitted to IEPA March 13, 2009.
Aberia Montanag Program Querterby Groundwater Monitoding Report - October 2008 Sampling	*	\ \frac{1}{2}				SV11/2003		teglines from	Submitted to IEPA May 11, 2009.
Event Letter Requesting RI Report Modification (Modifold Table of Contents						EVINERALIZA			Hard copy and electrons copies automitted to ter want over on May 14, 2009.
(beautions)						arearous	971/2009		on August 28, 2009.
Udgalod return and Salvoy Fran						6/28/2009	60 877/2003		Hard capy and ofestions copies summing to the A man over on Agust 26, 2009.
QAUP Addendum No. 00						9002/10/6	Krs 9/1/2009		Hard copy and electronic copies submitted to ter's are the on August 31, 2009.
Technical Mamorandum No. 4 (Risk Assessemm)						(V31/2009	62/2008		Hard copy and electronic copies submitted to IEPA and INC on August 31, 2009.
Technical Memorandum No. 6 (Rick Assessment) Technical Memorandum No. 8 (Additional Bedrack Step-Out						evs urecon			Hard copy and electronic copies submitted to IEPA and IAG on August 31, 2009.
Summary)						NOCERIE			Hard copy and electronic copiest submitted to IEPA and IAG on September 3, 2009.
Updated Project Schodulo Montoring Well lapocition - Railbraule for the Abandonment of						10/12/2009	1014/2009		Hurd copy and electronic copies submitted to IEPA as on October 12, 2009.
Danaged Monitoling Webs Technical Memorandum No. 7 - Hydraulic Conductivity (Stug Testing)						10/19/2003	10/27/2009		Hard copy and electronic copies sent out October 23, 2009.
Results Technical Memorandum No. 8 – Physical Sol Properties for Site						10/21/2008	B002//2/01		Hard copy and electronic copies sent out October 23, 2009.
Characterization Addendum A to Technical Memorandum No. 6 - November 2009						2/2/2010	23/2010		Hard copies sent to IEPA/IAG on February 2, 2010.
Bertrock Step-Cut Activities Summary Technical Memorandum No. 4 - SERA Conceptual Site Model (Rev.						2/62010	01027525		Hard copies sent to IEPA/IAG on Fobruary 4, 2010.
VIJ					,	2/4/2010	2552010		Technical Memorandum No. 4.
Technical Memorandum No. 5 - Contaminaria de Petential Ecological Technical Memorandum No. 5 - Contaminaria et Petential Ecological						2/6/2010	0102/8/2		Hard eqples sent to ISPANAG on February 8, 2010.
Consolin (COPPEUS) (1994, U))						2/15/2010	3/16/2010		Hard copies sent to IEPANAG on March 15, 2010.
Addisortion 1 to the RI Benoti						4/30/2010	010Z/MZ010		Hard copies sent to IEPATAG on April 30, 2010.
Letter Request for Reduced Groundwater Level Montoring Frequency	*					6/17/2010	0102/17/2010		by IEPA on July 147, 2010.
									Company of the Compan

		ı																	
Modaliz	PRINCED ATE OF CONSENT OFFICE ATENTION																		
SLEWITAL	DESCRIPTION OF ITEM SAGINITIES	1	CP SUBMIT		T. MINISTER	ABMEN DRAFT	PREMION AND	ALL HOOMEN	SALV REVIEW &	SLEWITAL PP	SLIBINITAL PREPARATIONS INC. DATE HAL DIGITAL PREPARATIONS	OATE 1. APPROVAL IN	TEGERAL	9,140	C) BEGGREAT (E)		UBMESTAL CR	ACTION ACTION COOK. DATE	REWARG
SOW - STATEMENT OF WORK CONNECTION PAPE Norther		. J < Z Ø 0 C < ½ — ≿ O Ø 1 < - E — E	なればないとは この作品を多かのなりをならま によりの下さ	######################################	DESCRIPTION OF THE PROPERTY OF	Liber et Liber	AGURL DATE	COMPLET ON THE COMPLE	ACTUAL UNITE	TANGET DATE	COMMENT NAME OF THE PROPERTY O	FIERGOS EL	DW DATE	DATE AFTON TOWN WESTERN TOWN WI	W W W W W W W W W W W W W W W W W W W	PECCEPT WHILE PECCEPT WAS PECCEPTED WAS PECC			
-	ą.		E				3		T	†	-		P	*	*	×	1	1	
60,03	Decuments developed during line SI process	1			1.					1				$\dagger$	+			_	
	Adddtloral Adistins Summary Report - fertimest Property (Asea, 1)	×										-		+	+	SANTEGOS		ě	laveton submitted on May 12, 2006 oppowed by IEPA
	stokow Stem Augor Rationaly - Parice Proofs (Aues 7)	×						_		1		+	+	+	+	5002562		Æ	Peverbnaubmitted on June 6, 2005 approved by IRPA
	stoken Stam Auger Balkmaie - Abstraktrouthe Offices (Area 6)	×										1	1	-	+	EVE-2008		Æ	hersion submitted on July 25, 2006 approved by IEPA
	Additional Investigation Activities Survigity - West Property	×													+	1.572006		ã	Revision submitted June 30, 2009 approved by IEPA
	Catter Requesting Movement of Areas 1, 2 and 9 from St to RNFS		*								-			-	+	692807	17. A.	ž	and copy sent to IEPA and IAG on May 3, 2007.
	SEWORE Plan Addendant 01 - Parca Foods Property (Anish 7) Interven Repectat Action Plan (IRAP)	×	×		1000								-	-	+	TOWNS		A.	Sed copy sent to IEPA and IAB on My 23, 2007
	Padosse to IEP A Comments of Proposed Installation of Temporary Wells at Payce Foods Property				W. W. W.								1	+	+	2,21,7cdB		H	and copy to it is IEPA ord IAG on February 20, 2008
	Paroo (KAP Activities Summary Report	y x			(A) (A) (A)										7	SOCIAL PROPERTY.		À	Hard copy 16th to IEPA and IAA on October 24, 2006
	Response to IEPA Technical Review Communits on IRAP Activities. Summary Report - Parcy Foods Property	*													-	22703100		¥8	Hard copy sent to IEPA and IAG on February 27, 2009
	Recipes to more Pages Sports Presents in RMES Program	_	×													3,2,3038		2	recept some to party and including and in processing and including the party.
88.08	Any previous success and communications receipt to selection of the	-	   *													26	0.446		
					2000									+	-	3.1		+	
	CO, BECTRONDOSA		-								+			-	+			<del>-</del>	
00,031	Mouthy Progress Reports for the RVFB	1	×			4/6/2004	4/18/2004	4/7/204	473/2004	4/9/2004	4/12/2004	4/9/2004	4132554	4/10/2004	4714/2004	MISSIN .	ANSTON	ie.	RIFS and Staubmitted in combined monthly report
00, p 34	Monthly Progress Reports for the Si	1	×	1		AISVEON	4413/NDH	407/2004	MCCALIA		WIS SEC	492004	413/2004			1025310	1005.51.9	201	RIFS and St submitted in combined monthly report
100,031	Monthy Progress Reports for the RIVES	+	×	+	1000	55/2004	┸	6772004		\$12,200				1		5,14/2004	ENERGO	Blo	U.S. and Stutbritted in combined monthly report
00, p 33	Monthly Progress Reports for the St	+	×	#		1002/5/9	SHUZION	5/7/2004		E/B/2004				$\perp$		1.	Kriegook	Side .	RIPS and SI subpatived in combined monthly report
00,931	Monthly Progress Reports for the RIPES	+	×	+		6/4/2004	┸				$\perp$	١	L			-	o I		THE SAME OF STREET SOUNDINGS INVOICED IN SECURITY (1920)
00, p 31	Monthly Program Reports for the Si		×			644/2004	1	ļ		E19/2004			$\perp$		1	-	SOCIAL S		To be a supplement of solutions in solutions
00,031	Monthly Progress Reports for the RIFS	+	×	†		7/17/2004	- 1			MEZON	$\perp$	. 1 .	Д,	7/12/2004	P002/21/2	714-308		A PIE	HITE and SI supplied it combined model to record
90,p34	Monthly Progress Reports for the Si	+	× :	+		7777200		7/8/2004	WEST/	TENEROR.	Parament .	III DOWN	Principle of	L		and work	a) entrempe	150	RIFS and Standilled in combined months record
80,09	Morating Progress, Reports for the RUFS	ł	× :	+	100	903.600	and and	Ι	1			<u>ļ.</u>	_	100000000000000000000000000000000000000	<u> </u>	NOC. E. A.	a) A CONTRACTOR	58	Fifth and St industried in contribut months forced
8 1	Mortaly Progress Reports for the Si	-	< >	+		ADM/SOCI	ł		PODDS10	1		1_	_				7007.51.4	PIN BIN	FILES monthly report for August 2004
100			,	F		200000	ł	l			Ш	٠	L				1002/51-8	ī	Si moithly report for August 2004
100	Monthly Program Beneric for the RMS.		· ×	F		002/200	1		L			ļ					1018/2004	HI.	FIFS morehy report for September 2004
8 8	Monthy Process Reports for the Si	L	*			1012/2001	Щ	10/11/2004	1								1011572006	S	Si monthly import for September 2004
00, p.31	Morality Progress Reports for the RVFS		×			11/4/2004	11/10/2004	11/10/2004	11/10/2004	11/11/2004.	וויויוענאייוייו	11/12/2004	11/11/2004	11/12/2004	1 1/18/2009	11/15/2004	HOUSEAL	PLIS	RIFS marthy twork for October 2004
00, p.31	Mosthy Progress Reports for the Si		×		0.547416	11/8/2004	11/10/2004	11/10/2004	11/10/2004	11/11/2004		14/12/2004	11/1/2024	11/12/2004	11/3/2504	11/19/2004	STEEDOOR	isi	Si monthy report for Detaber 2004
00,03	Monthly Progress Reports for the RIFS		×		Sept.	12/7/2004			12/10/2004		12/10/2004	12/10/2004	18/10/2004	12/13/2004	1211/2304	18/15/2004	10/3/2004	Sid.	RLFS marthly report for November 2004
00,p31	Monthly Propess Reports for the Bi		×			12772004		12/BIZXX		1292004	12/10/2004	1210/2004	15/10/2004	12/13/2004	ISTANDOM 1	12/13/2004	18/18/2004	8	morehy report for November 2004
8,03	Monthy Propress Reports for the RVFS	_	×			1772005	17/2005	1/10/2005	1710/2005	1/11/2005	1,11,2036	1/12/2006	1/1/2005	1/13/2005	219200	113/3005	1/16/2006	Alf	Intis manthly report for December 2004
50, p 34	Mornièr Progress Reports for the Si		×			177/2005	17/2005	1/10/2005	1/10/XXDS	1/11/2003	11112036	1/12/2005	£/11/2003	Utayans	1715/2005	1/17/2003	VIEwor	Sir	Si monthly toport for December 2004
00, p 31	Monthly Progress Reports for the Plut's	_	×			2002/2005	2711/2029	2/10/2005	2/11/2005	2/14/2005	27:47:3005	2014/2005	2015/25005	2/14/2005	274-2005	2/15/2005	\$000.51.A	HIN	RIFS mornity report for Journal 2005
00.03	Monthly Progress Reports for the Si	_	×			Societa	20000	2/10/2005	ST4230E	2/14/2005	274/2005	21472005	214/2005	2/14/25/05	3147305	20,25,51,6	215.2008	īs	Si morthly report for January 2005
90,p3f	Monthly Progress Reports for the RVFS		×			392005				37472005	ŀ	3/14/2005	34172005	3/14/ZXG5	\$14,7500	3,52,3065	aridand	in di	RIFS marthy report for Existency 2006
50, 131	Monthly Programs Reports for the Si		×			39/200	36/2005	3/10/2005	3150/2003	3/14/2005	3/10/2005	3/14/2006	3/14/2003	3/14/200E	\$1402000	3/15/205	2.1E/2005	8	St monthly report for February 2005
100,031	Monthly Progress Reports for the RVFS		×			418/2006	4/11/2005	4/12/200E	4/13/2005	4/14/2005	419,0006	4/14/2005	4/13/2006	4/14/2005	41472005	4,15/2.05	41E200E	Bild	RIFE monthly report for March 2006
CO, p.35	Morthly Progress Reports for the Si	-	×			4/B/2(C)B	6,11/203	4/12/2005	444,4005	4/14/2008	4713,2008	414/2005	413/20019	4/14/2005	Ø14/2003	4/15/2005	William Co.	8	St monthly teport for Mayorh 2005
00,P31	Mouthly Piggiese Reports for the RUFS		×			5/7/2005	505/5005	6/10/2009	5/9/2008	5/0/2005	5,0,500	6/10/2005	SPANOS	5/13/2005	571.200	A reason	EVIE 2000	HE HE	RIFS morthly report for April 2005
1		-					L		L			L				1.	- M		

		- Northead	DEPOSITIONED IN	WOLLDWING TO BE A THE STATE OF	JOIN DRINGHT.	COMBINATION	₫						İ				_
4.16	A PERSON DATE OF CONSERVORED AND AND AND AND AND AND AND AND AND AN	5 I	TOTO TOTO							ı							
SERVICE	CHARLES OF THE PROPERTY OF THE	TYPE	CERTAIN					5	UBINETTAL PPEPA	SUBMETAL PREPABATIONAL DAE DATE	1	H			242	ACTOR	FEMARS
NOTIFICATION OF THE PROPERTY O	Discreting of the seat to	2 < - < 0 s	な ひかまままが O × C で × C と	CMAD CON	OGEOGRAPIO CONSERVATION PROGRAMMENT THAT EACH TO PROGRAMMENT TO PR	AGINAL DATE	A WEST ON THE WAY	TO NEW DAY TO SECURITE THE SECURITE THE SECURITE THE SECURITE SECU	AL DELAY OF THE STATE OF THE ST	MALCONE TANGE	procyal, Heins Brooj a Linetr Charle Activity	E S	TO EXPAND A PROPERTY OF THE CONTROL	MARKINE FESSION WAY UND RECEIVED	I I I I I I I I I I I I I I I I I I I		
	i	-	- F	E -	E C	,	1	6	-		*	>	è			a 	
. 8	Manual by Deserves Deserves for the BMS		×	140 PM	6v6/2006	618:2005	6.9/2005	6002500	6/6/2005	81-5200E 6VII	eviorace pro-	013/200		1	-10		Rives monthly report for May, 2000
6 TO	Manual Frigues dispose on the property of the Standard Laborators Decode for the St		×		900/2005	6,62008	602/200	8/6/2005	6/9/2005	GUNTAN GLI	G102005 - 6-8/2026	2022 813/2005	9027752				St monthly report his May 2005
7 i	of the state of th		*		SUX SUZ	3002/diz.	2177,2005	7/5/2335	778/2005	778,2005	7772005 mb/s	DEFELY SOUZAN	27,112,000	1715/2005			Richs morally report for June 2005
E 60	Monthly Progress regards for the range		×		1/8/2005	778/2005	747/2005	7/6/2005	778/2005	71672036	7772066 756.2	1.			-		S) monthly report for June 2005
	0310		×		975/2005	85209	8402005	503000	91672025	0.572005 BII	BIBIZOGS SWIT	DATA BY12/200		612:208	DOC N		Historian Industrial Const
16 m	Addition and the state of the state of		×		802203		8/0/2005	Brs/200H	0/5/2005	NUNE BE	Wa2005 8/15/	\$12/2005 BV12/2005	2002 N112005	5 612/2005			Si monthey raport for July 2005
S :	outed to the pass of the pass		×	8868	S00Z/9/8		977,3006	Q-772005	8002848	97/2005	9/3/2005 8/3/2	\$15000 BY 12/2005	5002/51/15	514/206	9 12/2006	+	RIFES shortshy report for August 2005
00,03	meeting and less appears for the party		,		6060500	SOURCE	9772006	50081714	9.9-2003	97,2005	9/2/2005	9005 9/12/2005	902 613/2008	S S/4/2005	N SANGE	_	
0,03	Monthly Progress Reports for the St		,	-	10,872,000		50/10/2005	10/30/2006		L		5002/61/03 60/02	2005/21/2015	30142005	10/15/2005		RIFS morely report for Seydember 2005
8 8	Marthy Program Reports for the RIPS		-		SOCONO	L	SOCIOLAR	1079/205			10/4/2005 10/10/2005	EDGS 16/19/2008	005 10/372005	5077/1/05	10/14/200		SI morahly report (or Signamber 2005)
80,831	Monthly Progress Reports for the St		<		100000	1	11,00,000	<u></u>			11/1/2005 11/1/2005	2005 11/11/2005	11/11/2005	CITACOUS	11/15/2004		RIPS morthly report for Delaber 2005
62, 831	Monthy Progress Reports for the RIFFS	   	×		S THE STATE OF THE	A Laboratory	1	L						17/14/2005	11/16/1006		SI mendily report for October 2015
00,03	Monthly Programs Reports for the St.	 	×		Thresau.	1	and and		1					5254423			FUES martily repart for November 2005
00, p.31	Mouthly Progress Reports for the RUFS	1	×		12/5/2005	1	1277/2005	12/6/2018	1	Ц.		j_	ı	1		Ĺ	Si marabiy rapori for November 2008
CO, p 31	Monthy Program Reports for the St		×		12/6/2005	12AWXIDS	1277/3006	12/8/2005		┸	1		上	ļ	100		BUFS morthly report for December 2005
CO, p 31	Monthly Program Reports for the BUFS		×		1/5/2008		17/2008	1/12/2006		_				1	ं		Simurably resort for December 2005
DO, p.31	Monthy Progress Reports for the Si		×		116/2006	SECONAL I	1772008	1710/2001	1/8/2008	┸			1	1	1		OLES words cared for bound 2006
00° p 31	Monthly Progress Reports for the RUFS		×		2/2/2/26	231,2006	2/10/2008	i	_	1				1	10	L	Ci merchi secont for dament 2005
00, p.31	Mortity Progress Reposit for the Si		×		2/8/2006		2/10/2008	_1_		ì	1	1	Ш.	6141000	+-		RAFS monthly report for February 2008
CO, p 31	Morelly Progress Reports for the RIFS		×		377,2006		3/3/2006	27972031		1	$\perp$	3,0,505	Trebanco Ann		٠.		Si menthy report for February 2006
CD, p 31	Mortity Propress Reports for the Si	1	*		3/1/2006		37/2008		1		STREET SECTION	ļ	l				RVFS (nomb) raped for March 2005
CO, p.31	Monthly Progress Reports for the RIFFS		×	The street	4772006	1	48,200	4.10/2006	- University	1000000	L	1_			Ľ		St mornity report for Menth 2009
CO, p. 31	Monthly Progress Reports for the Si		×	100	477206		- IVA COM	<u> </u>	1	1		ļ	L				RIFS monthly report for April 2006
CD, p 31	Morthly Pregress Reports for the RUPS	 	×		86/200	P.N.SO.	and and	_	Ь.	<u> </u>	L		L				SI meetity report for April 2008
CO, p.31	Markiby Progress Reports for the Si		×		Distant		90%,000		L.	1			008 613/2002	5 614/2009			RIPS monthly report for May 2000
CO, p 31	Martin, Progress Reports for the RIPES		,		opposite of	1	500,500	99/2006	903/509	Ц.				- 1	#16/2006		91 monthly repont for May 2006
GO, p 31	Marthy Progress Reports for the Si				aralem a	Ľ	2787.0000	71137338	1			21X20	9002/81/4.	7/14/2000	77 (diame		RIFS monthly report for Aure 2005
CO, P.31	Martily Progress Reports for the NITS		< >		2.milection	l	770,2008			7/12/2/36	2713/2006 713/2009	9008/61/12 9008	7/13/2005	7714/2006	7715/2006		SI morthly report for June 2006
CO, p.31	Morthy Progress Reports for the Si	-	4 >		PODE/UF/B	l	8/1/2008				BYSTROS INTURBE	2006 8/14/2006	3002/21/2	SE BYAZONA	#15/20@		RIA'S morphy report for July 2008
CO, p 31	Monthly Progress Reports for the RVPS		4 ,		SATURDUS	t	9,11,200				B/13/2006 &10/20:31	2031 B/14/2000	37:22:32	E 114/306	8/15/2008	9.	SI meanify report for July 2008
CD, p 31	Martilly Progress Reports for the Si		4 2		anomoria	L	Sinchitia				9112038	2008 9714/2006	956200	S Bristade	P/15/2005		RIFS monthly report for August 2008
CO, p.31	Martity Pregress Reports for the RIPFS		× ;		olaniemo		30,11,000				912/2006 911/2033	2033 8/14/2006	9002791,8	B15/200	W15/2008		S) monthly report for August 2009
CO, P 31	Martity Propress Reports for the Si		× 1	100	acceptant a	TALL COLOR	10711/2000		<u> </u>		10/12/2006 10/10/2006	2006 10/12/2006	300	10717/2006	10/15/2006	1	RMS monthly report for September 2006
00, p 31	Morthly Progress Reports for the HPFS		4 7		acceptance	JUNIOR	10711700		<u> </u>	_			10:22:06	1015/200	10.19/2008	-	Sí monitiy ropon ler September 2008
CO, p 31	Morthly Progress Reports (or the Si		,	10000	STEED STATE	1	11/1/2006		_		11/13/2006 11/13/2/05	2003	900 1473/2008	1614/202	11/15/2009		RUES morthly report for Opiober 2006
50,83	Morthly Propress Reports for the HPFS		1		and the second	1	11/11/2020	1	_		11/19/2006 11/19/2006	11/14/200	11/13/2009	14/14/2003	11/15/2006		St monthly report for Cloticher, 2009
CO P 31	Monthly Progress Reports for the Si		× ;		TURKM	PARTICION -	90.676161			١	l		12/19/200	12'14'300	12/15/2000		Rues mouthy report for Navambar, 2006
8	Monthly Progress Reports for the RIVES		×	00000	an and an		ANIONAL PROPERTY.			1			L.		12/16/2006		Si marihiy report for November 2006
CQ, p 31	Monthly Progress Reports for the Si		×i :	1000	THE PERSON		Transfer of the	1	1	_					ا.بــــــــــــــــــــــــــــــــــــ		RAFS mostitity report for December 2008
CQ, p 31	Monthly Progress Reports for the Rufe		×		Mozenz	1	TOWN THE PERSON NAMED IN		$\perp$	_	1				Totality		St morthly report for December 2008
00° p 31	Monthly Progress Reports for the St		× :		) integral	A INCHAS	Contractor of	1		L_	L.,		7007/61/2	7 21:4/2007	1/15/20C?		RIFS monthly report to January 2007
00, p.31	Monthy Progress Reports for the RIFE		×		a tareau		O ID ONL	<u> </u>	1_	┺-	_	ļ			W1678007		St morably report for January 2007
00, 9.31	Monthly Progress Reports for the Si		×		2002/01/2	23/2007	210/2007	STATEO?	W18/2007	o locasia		1	1				

0.02.0010

and and	SPINARON HETEGTINE DATE OF CONSENT OPIDER																
REPERTISE.	DESCRIPTION OF THEM SUBMITTED	TWEAT SUBMIT	TOK.					ins.	SLUMITIAL PREPARATION & DUE DATE	CH & DUE DATE	DUE DATE					ACTION DATE	REMARS
OF CHARACTORY CONTRACTORY CONT		EWBORFO  OCEUDO-JUM  NOTUDO-JUM  NOTUDO-JU	O W R T T T T T T T T T T T T T T T T T T	activities of the control of the con	TANKETONE TANKET	N, DAIE TW	ELTENTE ACT	SAN, SING HI	WHEN SHOP	ANE TARGET	THE SECOND OF TH	RAC .	TO LEAR A LALL (A ADPRIODANTE)  THE ACTUAL CAST  THE ACTU	PERCENTAGE  OBJECT  OB	A Total Market M	,	,
	beauth December Description (1975)	# 3	*		349/2002	C CHARGE	0 200000 3	120,000	3/12/2007 3/13/2007	7002/01/2	2007: 3,19,2007	3/13/2007	705 SV 13V 8307	335005	Secretary 200		Pirit's monthly report for February 2007
3 2	Monthly Francis Reports for the Si	c ×			L	<u> </u>	1_								2.1	- 6	SI mouldy report for February 2007
	Month's Progress Reports for the RUES									$\perp$	Ŀ						PLIFE marking report for Manch 2007
_	Monthly Progress Reports for the St	*		Name of		49-10/2002	4/12/207	V11/2007 41	4122007 410200	2007 412/2007	/00Z01/F //00Z	67 412/2007	VI 4/12/2007	4/13/2007	TOTAL STREET		St arenthly report for March 2007
_	Monthly Promoss Reports for the RVFS	×		A.,	5/8/2003	548/2007	5/8/3007	5015/3102	5/10/2007	\$11172937 S/11/2007	2007 \$112037	5711/2007	X07 S11/2007	7 6'16'3307	9/15/200		FILES monthly report for April 2007
Ī	About Proceeds Reports for the St	*			5/3/2007				6/10/2007 5/11/2009	2007 5/1/2007	2007 15112007	07. 5/11/200	0117200	T Sychology	71 S/15/300	·E	St morthly report for April 2017
	Monthly Progress Reports for the RVRS	*			61878007	l		11000071100	\$10/2007 S11/2005	2002/11/90/2002	2007 6/12/2007	07 6/13/2007	X27 ST32207	614/2007	2000,000	·	FlifeS storebly report for May 2007
Г	Month's Program Backets for the 64	-			644/2007	L			_						or articoper	. 6	St monthly report for May 2007
T	Month's Promes Bearts for the RUFS	-	-					L.	L.					11:3:200		. 15	RIPS morthly report for June 2007
Т	Modelin December December for the Ri		L			1	l	L	١.	!		<u>L</u>				. 6	Si monthly report for June 2007
1	Householder Bearers Bearers for the DIFE			1000000	<u> </u>	L.			Į			┖			470	. 10	PIPES employly caport for July 2007
T-	DIRECT PERSONS INCOME TO LINE TO THE TO	< :				L	1		1_	_		ļ	1			-	St monthly remort for July 2007
	Monthly Progress Reports for the St	× ,	-		$\perp$	# IQ2007 6	6 4005004	_	B11/2007 B13/2007	Contraction of the Contraction	SOUTH WINESOM	CONCRETE SALES	OC CITACONIA	1.	1		FIFE month regarifor August 2007
T	Montry Progress reposite for the Puris	,				1	ı		THE PARTY OF THE P	↓.	_				1		St monthly remail forblooms 2007
Т	Monthly Progress Reports for the Si	× ;			a location	S INChes		B I IVANIA			1	<u>.</u>	L	Ι.			BITS monthly export for Sectember 2003
Τ	MONTH PROPERTY PROCESS TO USE THE PA	× 3	-	A 545 Garden		1			L	₩.		L.	1_	L.	<u> </u>		Streenby reveal for Section and 2007
	Mouthly Progress Reports for the Si	× .					'		TOTAL MARKET	٠.	1	L.		$\perp$	3 15		BIGES monthly servent for Cutobur 2007
-	Monthly Progress Reports for the HUFS	× 1	-		┸	ACCEPTANT S	1 1/Mezekur	-	┺.	1.		ــــــــــــــــــــــــــــــــــــــ	L				SI manthy recognitor Ostober 2007
Т	Monthly Programs Hepotis Ital De Si					L	┸	1	١.	_		<u>L</u>	L	Ц.			O'C monthly second for Newscarker 2010
T	Monthly Progress Reports for the RVFB	× ;	+			Ш.	┸		120 1/20 1/20 1/20 1/20 1/20 1/20 1/20 1	TOTAL STREET	SOUP LATERAN	TOWN TOWN	$\perp$		1		Signature for Newschild St
1	Monthly Programs Reports Inch Line of	× 3	F		≟.	_	171 1700		to literate to leave	<del>.</del>	1.	Ш.	į.		11		GUES entitle report for Describer 200
8 8	Modify Progress Reports for the RFS	× >	-		1/4/2/00	DI BILLIANDI		THE PERSON IN		ļ							ST monthly report for December 2007
Т	and the Comment Description for the Children			100	auco/arc		┖	1	<u> </u>	ļ.,		1	<u>L</u>		mě	94	FILTES expectably report for James 2008
E 5	Monthly Program reports for the St	< ×			200,000	1	L	_	_		1	l	L	L			SI monthly report for Japany 2009
	Months Present Reports for the HICE	*			307/208			1_		<u> </u>			Ц				RIFS monthly report for February 2008
Г	Josephy Browness Barrels for the Si	*			501/2/2			1	<u>L.</u>	<u>L</u>		L					St mouthly report for February 2008
Т	Manual I toggings replace to the City				-[10/tmpp]			1_				L			EDGESTON IN		HIRFS monthly report for March 2008
100	Significant regions region for the state of		-		0000000		ļ	{			1_	L			10		St monthly rapid for March 2008
T	Office and property for the Children				E/co/ocon		L	1	ļ				_	<u> </u>	100		RIFFS marking report for April 2008
Т	MONTH OF THE CONTRACT OF THE CO.		_		Service S	1			<u> </u>		_			1			St monthly record for the Battle
T	Monthly Prograss Reports for the Si	*	+		POSMI A			1		٠.							and the same of th
Т	Morthly Progress Reports for the RUFS	×	-	100	£10/2008			L				┵	1	L			HIRED INDIXING REPORT IOF MAY KNUE
	Morthly Progress Reports for the Si	×	-		6/10/2008		1	┸	1			┸	ı	$\perp$			SI monthly report to May 2008
CO, p.31 Mo	Marthy Progress Reports for the RVPS	×	1		7/5/2008	2792/2009	779/2000	1/4 (50.5%)	41.17.0008 72.HV	7/12/2001 7/13/2008	2008 2/10/20XIB	7/14/2008	KIS 77.14/2009	3 7/15/2008	DOZ-5117		RIGES expectably report for June 2008
CO, p.31	Korthy Progress Reports for the Si	×			7/5/2008	779/2008	779/2008	778/2004 7/1	7/11/2008	7,0200 7/13/2006	2008 7/10/2008	CB 7/14/2008	7/14/2008	7/15/2006	DOESN'I S		SI monthy report for June 2008
CO p 31	Morthly Progress Reports for the RVES	*		The second second	6/1/2008	program	8/8/2000	800.750	BV15/2008 (VE	WEXXXX 6/13/2008	2008 8/10/2008	CO E/14/2008	0.145.000	8/15/2008	B. Braham	1	PURS marably report for July 2008
	Mortific Progress Reports for the Si	×		37	8/7/2008	STR/2006	8/8/2008	5/8/2/29 Bit	8/11/2008 8/5	895558 B137300	2000 8/10/2008	CE 8/14/2008	6914(2009)	8/15/200B	H LINESOCK	_	SI monthly report for July 2008
1	forchir Propess Besorts for the RVFS				B-77/2008			L.,					90:1200	9/13/2008	MY57200	· =	PUES monthly report for August 2008
Т				240.00pg				İ.	L.	1_			944 7100	074577048	***************************************	,	ACC the lead not become objection in
	donling Progress Heports for the Si	× ;	F					Ļ	L.		$\perp$	1_	П	L		_	Rinks mouthly ramped for Sectionities 2013
Ì	donlay Pregress Reports for the AUPS	×	-			1					1	1		1	L.		and and an incident farmers of the
00, p.31 Mo	detably Progress Reports for the SI	×	1		1077/2008	10/0/2000	10/2/2000	10,3/2009 10/0	10/6/2008 10/6	10.02.00 (0.02.00)	93025,51L 9002		1				Si manify topon for September 2008
CO, p.31 Mo	Mortility Progress Reports for the RVPS	>				_										,	HIRS monthly range for Original 2008
Ī			-		17772008	IOCUTA SAUR	11/3/2008	11/10/2005	11/10/2009 11/1/2/20	327 11/1208	13/4/2008	171372008	14/2/2002	11/13/2008	10/25/200		THE Glevining investige Western

Part   Part		C-MC	JIFY DEFICIENCIES: U = Crown	1000000	THE PERSON	JUNE 151						Ì			
Column   C	WINDOW BATECTIVE DATE OF CONSENT ORDER														
	SABATOL SABATOL		TAYE OF SUBMITME				200000000000000000000000000000000000000	SLBMTPAL PREF	APATICINE DE DE	ADE ADDRESSAL NESTER	Ш			SO ACT	
Note   Colored	-		ない月日のリー日の この内内にあかり引り日光の近 月日から月下午 らら内下下午 - ロペイモル さんぱかしまる さんぱかしまる	topy (in the control of the control	eren court to produce to the court of c	AND PRESCRIPTION OF THE PART T	ACTIVITY DATE OF THE CONTROL OF THE	WASSIGNED FOR	THE DATE THE	ET DATE ACTUAL	200	A ACTUAL DATE OF THE PARTY OF T	100	Approx 2	
Part   Part	9	o u	4 5. I T U B 1 .		c		ш	- 			L	1		access:	BJFG modific const for November 2008
Column   C			×					12/10/2000				Ь.	BOX CLO	1 2	Si marithy leport for November 2008
No.   Column   Colu			×		1			12/10/2008				L	OWN, PARTY	2000	Riffs northly report forDecamber 2008
Manual Agriculture   Manual			×			Ι.		1/12/2000	<u>.</u>		┸	<u> </u>	1/14/2000	2000	Sl monthly report for Decombor 2008
Part   Part	T	-	×	1 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2	1		1	00000000	上	1_			2/13/2008	Proof.	RUFS monthly report for Japany 2009
A	T		×			١	1	announ of	1				2/13/2009	No.	SI morkiby report for January 2009
A	П	+	*				1_	donair 2	E		L		3/13/2009	5,500	TUFS morthly report for Fibruary 2009
A	T		×					ALIES COLOR		1	L		00000000	8,300.8	Si maraby report for February 2009
March   Teach   Face	Ī		×	1		1		3/11/2000		1			SOCOURT .	chance	RVFS monthly report for March 2009
Part   Part	1		×		1							L	BUCALL	9000	G) Ingmily report for Murch 2009
Column   C	1		×		ı			4/13/2000		1		L.	000017	Comp	BUES monthly reason for April 2009
Column   C		-	×		- 1	-		9711/2008	-		上		000		Di mondello second for Arell 2009
March Table Brottle on 1973  March Table Brot	_		×				-1	6/11/2009		Ŀ	1		614/200	No.	Rules mounty report for May 2009. No (uriter 5) repor
				(14) (14) (14)							_		616/2009	\$200k	request of the RAFS Program.
	Т		< >	0000000		-		2710/2000		. !		_	B002/VILL	NA.	RIFS mouthy report lay Auto 2009.
	T	-	×	200000				812/2009			- 1	_ 1	0/16/2000	Strick	RAFS monthly report for JAY 2009.
March Transmission to the rest	Т		×					8/11/09		- 1			5414/2008	2000	RIPS monthly report for August 2009.
	1		×	Balance Control				10/12/2009		- 1		_	10/15/2020	2000	RMFS monthly report for September 2009.
	Т		×					11/11/2009			_	- (	11/15/2009	2000	RIFS monthly report for Digities 2009.
	Π		*	0.000	1	-	1	12/11/2009			1	٦	1214/200		Dicto mouths second for Downfor 2020.
No.			×	7.00				1/13/2010			$\perp$		MSZDIO	2	Auro and report to the particular states of the states of
			×					2/11/2010		- }			216/2010	ordera	Amagaza de 1520 to 1720 de 172
	Т		>		_			0/11/2010	1		[	_	346,2010	03.02.6	copies submitted 3/12/2010.
			3		1			4/13/2010					0102/91/7	0.00	Hirs monthy report for March 2010, Hard copies with 4/s4/2010. Electronic opples submitted 4/16/2019.
March Propres   Percent								10000					514/2010	520(0	RIFS monthly report for April 2010. Hard copies warm? SYSENTO. Electronic copies submitted \$714/2010.
Control   Program   Prog			*										01007417		RUES monthly report for May 2010. Hard capies submit 67:42010. Eleganic capies submitted 5/14/2019.
Control   Cont			×		1		1	n i i i i i i i i i i i i i i i i i i i				_	201		Pures monthly report for June 2010. Hard replets luthral Journance Electronic cooles, submitted 6/14/2010.
Control   Cont			×		1	L		7/13/2010				_	The Court		DIES monthy record for July 2010. Hard cooley submit
Control Cont			×		Į			6/11/2010					py3/2010	01,02.6	Uf 12010. Electronic copies nichmines (V122010
Date Residue of Secretiva, Tests, Modeling						1	$\perp$	POGE STO		1_	L	L,	POLC STA	- COOCUS	Budging of the language to a second second of the second o
Column   C	1	×				1	1	PULLETS 1/US			1_		10/15/2004	2000	Submitted in the September 2004 morthly progress reports
Care   Part   Care	_	× ,		100 E				11/11/2004					11/15/2004	you.	Submitted in the Gerober 2004 monthly propiess reports
Data Residue Sisterical Transitutioning	Т	< :			1	L	_	12/a/2004					1215/2094	Posta	Submitted in the Abrember 2004 monthly progress reports
The Figure of Section   The Figure   The F		×			_			1/11/200S	<del></del>			L.,	1/13/2605	E-2004	Submitted in the Departmen 2004 monthly progress reports
Dat   Feeth of Sentrology   Text   Medical   Text   Medical   Text   Medical   Text	T	×				ļ	1	PITAZONS	l		_		215200	V2006	Submitted in the January 2005 morehy progress reports
Columbia of Secretary   A   Columbia   Col	Т	× ,			1				1				31373035	E/MOS	Submitted in the February 2005 monthly progress report
Part   Part		× ×		22.000				4/14/2005					4/15/2005	No.	Submitted in the March 2005 rearthly progress reports.
Date   Bear of Surging   Feet   Surging   Feet   Surging   Feet   Surging   Feet   F	Τ̈́	× 3			L			692005					512.203	NEO0	Schooling in the April monthy progress toports.
THE PERSON THE SECOND THE PERSON	7	× ×			ł					1	L		#15/200	90,000	Submitted in the May mentify progress reports.  Submitted in the Jane mentify progress reports. Chaire
89700 89700		×						-	- 1				71127301E	\$2006	Curredy included in report, but no rain data received fro
	Т	. >											6412/2005	500075	Schemifted in the July morthly progress reports.

Column   C	STREET BEFECTIVE DATE OF CONSPIT ORDER																	
			ž	200 E		T. MINISTER			SUBMITTAL PROP	SATION & OLE DA	J.E.				in wife		100	EWHS
	Figure 1		D 心氏性 E M M M M M M M M M M M M M M M M M M	Expension of the control of the cont	NATIONAL PROPERTY OF THE PROPE	TOTAL DATE	APACTEMENT OF THE PROPERTY OF	1 31/2 1971 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	WEET DATE: FO	E BACE THA	THE CONTRACT	EAT. S	TO THE WORLD	ASPERTMENTS	SE STORE			
Note of the control		6 0	4	E	d of	0	4	9	- Landers		1	L	L	1		Coope	Submitted in the August and	thy goards reports.
No. 10.00   No.	T	×	+		846/2003	NATE EDING	COOP MAN	STATE OF THE STATE	Ł		J.	L	L	١.			Colombias in Service in	allocations and all
	T	×	† 		16/6/2005	5005/201	10/10/2005	5075701/03	$\perp$			_		<u> </u>			THE PARTITION OF THE PA	and the second second
Decided a control of the control o	7	× ,			15/7/2005	11/6/2025	11/6/2005	11/6/3016	丄		. l				1	900	Subplified in November 200	S monthly progress report
Name of states   The control of th	Т			できない。	SACIONIA	BALEUD'S	e de la constante	1710/2/06	1	<u> </u>	L.		_		100	900	Submitted in Supamber 200	S monthly progress resol
Part   Part   Control	-	× ×			SAN SEED	9/8/3/9/4	2/10/2008	200263			١	L				EDCS.	Schoolfed in January 2006	monthly progress; lepoils
National Promisity (March Control Co	_				377/3005	TWENTE	3/2/2006	99000	9002/6/6	1						9000	Submitted in February 2006	nomité; progrést tepin
National stands   National State   Nat	1				47/206	4/16/2009	4/9/2006	90200	L.	_						2006	Submitted in March 2006 to	omby progress reports
Note   Decision   Control   Contro					RAZONS	2000	FIGURE	SCOOLS	<u>.</u>		1	<u> </u>			1	20(32)	Schmitted in April 2009 may	thy progress reports
Decided a company and whether a company an		c >		100	SUNCTURE.	6.8.900	encone.	PARCONIE	١.		L.	L		1	14	3000	Sufanified in May 2008 mox	spods starbord Aug
	_	.,		2000	NOT THE	2	The state of the s	20000	2000	<u>.                                    </u>		L				2000	Submitted in June 2006 mo	sher progress reports
A	Т					1	No.	20000000	1	<u>.                                    </u>	_	L	L				Sampled in John 2009 men	We continue month
Declarate of states   1	Т	× ;			90,500	8/8/200	BY 11/2/16	(819/2008)	1	ţ	J	_	L	į_		900	5 Schreiffed in August 2008	chiply statutes reports
House of starty (int. bedry   X   X   X   X   X   X   X   X   X	Т	k )			N TATAON	on Dallon	A I I I I I I I I I I I I I I I I I I I	S HICKORY	L.		٠.,	<u></u>	L				Schoolhed in Sextember 20	S martify progress se
December 2   1975   1					DO INCOME	A SECOND	IN S INCOME	1	_	1		<u></u>	L	<u>ļ</u>	4.		Spring of Delivery	another states a reco
December of Serging, Term, Northern   X   December of Serging   1972-000	T	×		100	1010000	STOCKES.	11/11/208		┸		٠.	L.	L					
Declarate of Secretary, Third Models		×			12008	12/WELLS	12/13/2008		_	_				L	1	8	and recommend in section 2015	a moistey progress repo
Column   C	_	×			(10/2007	1/10/2007	1/10/2007	1/10/2007	$\perp$	┸	Ţ			1		<i>100</i>	Submitted in December 233	6 moviny popioss fac
Date   Particle   Company   Compan	T	×	1		2/10/2007	500000	2/10/2007					Т		$\perp$		200	Substituted in January 2007	northly progress report
Columbiate a surgive,   Columbiate   Colum	Т	×	- -		347.8007	346/2037	3/12/2007			$\perp$	_1_	Т			1		Submitted in Fabruary 2007	monthly progress repo
Data   Barbard   Secretary   Control   Contr	Ī	×	-		467,2007	4710/2007	4/12/2007	U11,200)	i		J	_1_	1	İ	1 6	000	Subplied in March 2007 m	onthy progress reports
Data   Particular   Secretary   The Authority   Secretary   Data   Dat	Т	×			\$18/2007	549,9007	5/9/2007	STREET	$\perp$		_1_	1				200	Submitted in April 2007 mo	thy progress reports
Data   Particle   Secretary   This based   Particle	ī	×	-		648/2007	S/CADO	6/9/2007	P/11/2017	1	_			1			1001	Submitted to May 2007 Inde	Progress reports
Deciding a service;   Deciding    7	×			5W2007	\$1000H	6/10/2007		- 1		$\perp$	J	1			3000	Submitted to July 2007 RIP	S morthly progress rep	
Date   Date	٦	×	-		970/2007	510/2007	910/2007	- [			1		ŀ	1			Statuting in August 2017 in	ers monthly progress
Data   According   Control   Contr	T	×			1071012007	\$128/2007	10/10/2007	10:172007	.1	-1	1	1		1	M.L.	, soot	Submitted in September 20 Submitted in October 2007	7 RIFS morthly programmer AVFS and SI morethly p
Date   Part   Control	T	×		100 E 30 C 100 C 1	11/6/2007	11/3/2007	1,1922017				_	L	┸	$\perp$	1.	5002	Submitted in Navember 20	17 RVFS arts 51 month)
Day   Day	Т	×		9.00	12/10/2007	12/10/2007	12/11/2007	12711/2023	.1				1	1	1	li de la constantina della con	Submitted in Decarities 20	O' FILES and 31 morning
Data   Particol   Pa	1	×			1/2/2008	1/7/3028	10/10/2008	1/19/20DE	$\perp$	.1.	_1		$\perp$		4	900	Submitted in January 2008	APPS and St monthly pa
Columbrated Securing Term, Modeling		×		1	2/8/2008	энств	2/11/2008	0.727.500	_	- 1	_1	- 1		_	1	3000	Sommer 2003	RUFE TOTAL BIDDINGS
Column   C		×			3/1/2008	972.ZD019	3/10/2008	Flacting	2/11/2008			- 1	Ц			2000	STOCKS STOCKS SOUR	AS and A modification
Columbric of Secretary Treat, Notable   X   X   X   X   X   X   X   X   X		ж			4/10/200B	492008	4/10/2008	45-2008	410/2008	_	_				7	2006	Feboria	
Columbritat descriptor   Free Colu	Г	×			6/10/2008	SWZUIB	5/10/2008	Sve/2008	5/9/2008						11	B	Submitted in April 2005 har	S rand St treatally progre
Company   Comp	Г	-	_		6/10/2008	STEVED B	W 10/2008	GWZCON	8/2/2008							98	Substrated in May 2000 Hur reports	S and 51 monthly progre
Column   C		<u></u>			7/0/2009	7.02.200B	ZANZOOB	2/8/2008	2717/2008	L	1_	l	L	L		8	SULPRING IN Julie 2008 HUI	S and Simonthly progr
The control of the	П				WIT STEP	NTV2008	NW ZIOS	MICCOLANA	ar11/2008		_					900	Submitted in July 2008 RIP	Sand Simonthly progre
Delta   Properties   Commission   Commissi	ì		-  -  -		- Dipper	- Dimension	LOCAL NO.	OU.N. A.Y	BULGATABLE	_	<u> </u>	ļ	L	<u> </u>	.5.		Submitting in August 2008	AI/PS and St monthly pre
Columbia Control, Teach Andreas	Т	×	<u>+</u>	2000	W. P. Chan	NACONO.	BORONO	AND THE REAL PROPERTY.	۰	_	Ļ		1	L			Submitted in October 2008	RUFS and SI monthy pr
Column   Principal   Princip		×		4 0 40 4	11/7/2008	10/20/2008	16762008	1100.57.00	┸	4	$\perp$	1	1		43		Submitted in November 20	to RVFS and 31 monthly
Concept   Conc	-	×		40.4	129203	12/0/2009	1Z3/2008	ENGEDIA		_					1	9009	(aports	
Data Reside d'employ fatta Modelle XX	T	×			BANZOOB	678/2008	GNIZDO	600,000			_	J	ł		1	BOOK.	Submitted in May 2009 RI	Psmonthy programs rep
Para Bauth of Commission Tests - Buddelon   Virginia   Buddelon   Virginia   Buddelon	×			7/9/2009	2/0/2009	2/10/2008	77:07.00	_		- 1	[		L	7	98	Submitted in June 2009. RI	FSmorthy progress re	
	Ī																	

9/9/2010	REVIEWER ACTION CODES:	A - APPRC	WAL WHOLE OF	A * APPROVAL WHOLE O'R PART; B * APPROVE WITH SPECIFIED CONDITIONS D * MICHEL OFFICIENCIES: D = DISAPPROVE WHOLE OFF PART; E = COMBINATION	WITH SPECIFIE	D CONDITION	NO.										
Activity	A INDION PETELSTINE DATE OF CONSENT OF DEBEN														ļ		
SCHARTAL	CATSCONDITCH OF ITEM SUBMITTED		TYPE OF SYBUILDING					10	SUBSTAINT PREPARAMETRY & DUC DATE	ARCHIE DUE DATA	S. C. C. C. C. C. C. C. C. C. C. C. C. C.	Ц				ACTION ACTION	PEWPG
CO-CANDENSE CO-CAN		L √ <z 0<br="">□ # &lt; } = Z 0 0 Q &lt; &gt; &lt;</z>	O O T M O Z - M O O T M O D T M O D T M O D T M O D D M Z O M D M O D M D M O D M D M O	MACANIE ON STATE OF S	A KANGET OATH	HERECOS AND PERFORMANCE ON THE METICAL DATE:	TATALOG I TO TO TO TO TO TO TO TO TO TO TO TO TO	TOTAL DATE IN	THE ACTUAL THE PROPERTY OF THE	LOATE WEEK	NORTH DATE TO THE COME TO THE TOTAL OF THE T	TO POST DURACTIVA DATE	THE A LALL CASE OF THE CASE OF	CAST RECEIVED	T COUNTY OF THE	1	
•	a a	9 0	-   -  -  -		£		Н.	┸	1	μ,	CI COLORES	0.444.00150	Ol COMPANY	tri6/2010	4197000	_	Submitted in December 2009 RuFS monthly progress report
90° P 35	Data, Results of Sourcing, Tests, Medoling	×		1000	1/11/2010	1									4		Submitted in January 2010 RUFS morthly progress report
86	Deta, Basuta di Samping, Tests, Modeling	×		1.13	2/10/2017		1	1			1_				010031-0		Submitted in April 2010 RVFS monthly progress report
8,0		×			5/11/2010	011/2010	6/15/2010	50102010	5/13/2010 W	1 1 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2 1 2	6/14/2010 5/14/2010			615/2010	CHEZOTO		Submitted in May 2010 RUFS monthly progress report
20.83	pang, Tests, Modeling	×			6/13/2010	ĺ	L		_			_					11. Partie La Little Commenter plates   borne on Alens
	OO, SECTION X.26	-			T/OC/10/2	arpolegy v	7721/2004	7,22/2004	7/22/2004 7/	772 NO. 2021	122/2004 122/2004	4 7723/2004	TIPARIDA	NZXZV	Traffibook		2004 (blue salvates (stoke) the salvates (stoke) the salvates of the salvates (stoke) the salvates of the salvates (stoke) the salvates of the
Se 4,00	Witten net Keatlen 14 days pilot to conducting agrifficant field everts.	+	* .	2	Sweets				L.				1/19/2/02	5/19/200E	17119/2000		August 11, 2004 August 11, 2004 August 11, 2004 August 11, 2004
86 d '00	Written neithberfor 14 days pilot to conducting sharifloan field everts	+	×	2	TIAND.		1	┖			1			\$49,200	20028/3		22 2005
20° p 30	Written neitheation 14 days, pilot to conducting algoritouri field avenue	+	×	•	emoverne emoverne	١.	1				1	١		618,3305	\$257206		Hurs 1020 activities (leaning angle) in many cages of
CO, p 32	Written ratification 14 days prior to conducting algullated flood everta-	+	×	•	Basens			Zongara.									NineS lad advices (ropos sient adjet jumes) Legal September 21, 2005
CD, p 22	Welten notification 14 days pilor to conducting significant field everify	+	×	3	9/1/2005	L						Ľ	ľ		10/1/2005		Riffes live admires (product destrains y ungain o door in 2006)
35 a CO	Withen notification 14 days prior to conducting significant field events	+	×	7	3020S8	1_		1		١.	1	_	_	1221/2006	12/2 (13006		Rich in the property of the control
50, p 32	Written neidbeation 14 days prior to constacting significant field everte	ļ	×	2	27/6/200	l		<u>Ļ</u> ,	ـــ			L.,		3217330	2722.2000		HIFE LOND AZARION (Unite quantity temporal overla) angul April 6, 2005
26 g.O.D	Waten neil/seaton is days prior to conducting significant field events	†	×	•	3716/2006		1	SCATION	<u></u>	1_	L.	<u> </u>		<u>L</u> .	2.1		RIPES to it admitted (Final Book Interpretation) Degree may 22, 2008.
20° p 32	Waten neithbasion 14 days prigr to conducting shpillicant find overta		×	3	6/6/2009	L	1		_	١	L	Ľ			125,200		Rkk Assesment Sile Visk (June 9, 2008)
3E 6 00	Written multipation 14 days prior to conducting against a finite mysts	+	×	\$	2,547,000			1	<u>L</u>	l	<u>i</u>			620/8:06	W21/2006		Asy 2005 Quarterly GW Sampling (July 5, 2009)
20° b 35	Waten nationalen 14 days prior to conducting significant limb events	-	×		8/19/200		1	上	L	1	_	_		470,006	0.20/2000		October 2006 Quarterly GW Sampling (October 9, 2008)
æ4'∞	Waten rotication 14 days prior to comboting significant field emorts	+	×		9/17/2008			ļ.,	Ľ		_	L	Ľ	12/19/2006	12/19/2006		(LDGZ 'S Meruer) Budwes AS Aleumo LOG Amere
20° 18 28	Written net Replan 14 days prior to considering a gnillean. Reid events		×	-	12/17/200	1		1	L,		١	1			THE		April 2007 Osarterly GW Sampling (April 3, 2007)
80,03	Witten setkation 14 days price to conducting significant liaid oversis	+	×	2	2012/200	_	)DOI: NO	ALIGNAPH .	Contraction of	STATE OF THE PARTY			ļ		Interport		My 2007 Quarterly GW Sampling (July 9, 2007)
8	Whiten notification 14 days prior to ceretering significant field events	-	× ,	,	CDOCCOOL	200000		<u> </u>		J				9V12/2007	Brt fragor	-	October 2007 Quartetly GW Sampling (October 1, 2007)
20° 8.36	Watten netification 16 days poten to conducting significant libit design	+	4 3		DR/300			_			BI10/2007 EVA/2007	17 8/19/2007	7 Bet22007	6.7.CO3	W13/8007	-	(LDOZ 18
20,03	Witten antibodies 14 68ys palot to controlling agricultural	F	. >	7.00	12/19/2007	=	-	12/13/2007	12/21/2007	12122000 1282	12/21/2007 13/18/200	12/21/2007	TUSECUL	12/12/209	1wak-mort	1	Junary 2008 Quarterly GW Serping (December 12, 2007)
80,03	Writing controller is the true for controller or and but local and the true for the true for the controller is the foreign to controller to the foreign to t	F	. *	,	3/13/3008		3/14/2008	9747309	E 8002/171/2	37:420(6) 3/2	\$12475000 S1147E636	975/5200	8/14/2003	3747.208	325/2008		April 2008 Quantary GW Sampling (April 0, 2008) Additional HAP metyties at Area ? the Parco Foods Ptoposty
3	terrain production of their solve to move in their plant from First Section		×	2	177	<u></u>	4/12/2008	475:3009	4/12/2008	4/1/2008	4/12/2000 4/12/2018	4/15/2000	479-2309	410/2008	WIS-2008		(April 29, 2008)
3 8	Attaches and benefits to down solve in second relies in minutesize field desires		×	7	77.5			87147209	6/19/2008 B	BY HEXON	6720/2006 BTTK-2000	6/23/2008	87.77.73E	\$177,3016	NCT-CON		July 2006 Quartenty GW Surpling (July 7, 2008)
	see and tention of a few relation to contraction about the country		×		9/22/2008		802/278	9182008	9/22/2006 84	MIN'S, UB	9722/2006 2119/2018	9,19/2006	WIN SCOR	(420,008)	9002/72/8	+	October 2000 Quartury GW Samplys (October B, 2009)
* 1	there are thought to the same price to constitute about 500 feet about		×		4/8/2009	90	47/2039	40200	4/8/2009	4:9200	4/9/2009 4/8/200	4/3/200	449209	40,200	4/9/2009	1	Ant 2009 Semi-Agoud GW Sumpling (April 9, 2009)
5	Spece (self-transfords or interpretations of reliable state of resident states of reliable states of reliabl		×	# F	8/5/2008	De CAVEXE	608/2009	ANE POOR	6/B/2CO3	WIDZXCII 671	6/10/2009 EVRUZODIA	9002/00/0	8 649'200E	-	C. SOLEDOG		2009 Andelonal Bedrack Step-out Investigation (Busha)
* 6	Marketon mentionalize 14 days odny in contracting biolicus (Biolicus)		×	## W	90051717	0002/51/12	7772000	7/15/2009	7772000	77 2002/01/2	7772009 7119,2009	10,200		ļ		1	July 2009 Disartonly GW Lavyde October 2009 Sooth Armail Sarryday, Event (week of October
	Management of the management of the contract o		×	*	9/16/2009	87 16/2009	9/17/2009	67.14.2009	9/18/2009 St	9/15/2009 BF1	STINZOGS STIEGGES	BC02781/6	97.772.00	97.872	172172000	+	5, 2009) November 2009 Bedrook dalmeston and Wellson
2	Minor bell tracking white house of which are the second se		×	*	11/3/2009		11/4/2009	11/1/3008	11/4/2009 1:	1542008 154	1144/2009 114/2009	11/4/2009	1 UNIVERSE	174/2009	11/0200	1	dejemminalish actifities (week of November 19, 2009) January 2010 quartority groundwater tool measuroments (Ja
200	Annual State of the Company of the State of	F		3	12/22/2009	_	"	1275/2004	1,0723/2009	10191001	12/22/2009 12/16/2009	12/20/2009	12/21/2/6	1221 255	13/29/20C	+	19-13, 2010) And 2010 serie partial proundwater sempling evers (April 5,
50 E	We have been been as the principle of the principle of the second		×	-	3/12/2010			9/13/25/0	9/18/2010	VI20010 ST	312/2010 9/12/2019	3712/2010	3/12/2010	315/2010	DVBC/CZX	1	20109
7 S	College Colleg	<u> </u>	*	() ()	3/12/2010	3422310	3/12/3010	8/12/20 JCS	W. 010ZE116	VIEWNIO BY	312/2010 512/2010	3492010	0193910	217,572010	0.785.50	_	Wel Abundonment Activities! (May 2010)
20, p.2	Volume no location of the party plant to an except and the party of								-	-					7. C. C. C. C. C. C. C. C. C. C. C. C. C.	_	
	DO, SECTION K.30	+			y'			$\dagger$	+	1		- Contractive	and the same	MAN STATES	ACRESIONA	_	Memo to 189A about this sent of the property
00,035	Obtain site accours agreements from the present Owner(s)	+	×	8	3/28/2004	2	3/3004	+	4/6/2004	1	17/2009	4	1			_	
		+						+	-	<u> </u>						_	
	ро, ѕестон хи.эг	+			-	1		+	+	<u> </u>		1000		Particular o	WOOD OF THE		
CO, p 37	IEPA and Premoer designate their own project manager	-	×	=	3/20/2004	2	3/21/2004	+	3723/2004	K	9/24/27/UK	ACT COM	A CONTRACTOR			_	
		_						-	-	-	$\frac{1}{1}$						

0102,000

9/8/2010	REVIEWER ACTION CODES	3: A = APPROVAL WHOLE OR PART; B = APPROVE WITH SPECIFIED CONDITIONS	T; B = APPROVE W	THI SPECIFIED C	ONDITIONS											
		C = MODIFY DEFICIENCIES; D =	DISAPPROVE WHI	J.E OR PART; E.	COMBINATION											
218/204	SHIROTHE DATE OF CONSENT ORDER	EWI														
SEBATAL	DESCHPTICN OF ITEM BLEMITTED	TYPE OF BURNATIAL					SLBMYDL	SLEMITOL PREPARATIONS DIE DATE	EDATE					ACTION ACTION		REMARG
CO-COREEN CONFEMBIL SOW STATEMBIL CORE FOR		0 4 4 3 − 2 0 0 0 4 − 4 0 0 0 4 − 4 0 0 0 0 0 0 0 0	AND THE STATE OF STAT	THE PROPERTY OF THE PROPERTY O	CTUAL DATE: THE	COMMENT OOPELER DET DATE ACTUAL	EW F PAAL DAVE	E ACTIAL DATE	MARKET DATE AG	ESPECIAL PART TO THE TOTAL DATE OF THE TOTAL DAT	TARGET AGIN	TO ERRA & LACE LACE TO ERROR TO ERROR TO THE TOTAL CATE TO THE TOT	Western Accessed to the control of t		30	
и	d agricon Yuli sa		-	c	0	4			-	2		*	1	2	4	
29 d'00	Subrill is check to the IEPA (copy to IMS) for all past response costs insured by State	×	2	3/21/2004	.05	3/22/2004	324200	*	3/25/2004		3/26/2006	325/2004	EK . POCESZ/6	32/J2004		
	CO SECTION XXX 60															
	Periodic bill for costs incurred by tark and rives from July 2003 through December 2009. Bell of the periodic state on and affer July 1. Bethinsopport of seconds and oversible costs on and affer July 1.					-				-	1	8 3	Section.			
201	2003 Helmbursement of response and oversight costs on and after July 1,		8		+					-	+		S. IEZON	623/2004		
00,p @	2004 Periodic bit for costs incurred by IEPA and IAG from January 2004 Periodic bit for costs incurred by IEPA and IAG from January 2004	×	R		+	_							107720M			
	Rembusement of response and oversight costs incurred and paid	,	100 mg/s			_						9	No.	11/9/2006		
200	Periodic bill for costs incurred by IEPA and IAG from July 2004 finough Soplember 2004									H			150	100		
8	Remoursement of response and oversight costs incurred and paid from his 20th the sub-Sections 20th	эн	ş						300000			31	W- MOSA2/2	1/8/2005		
	Periodic bill for costs froumed by IEPA from October 2004 through December 2004											°	3/11/2005			
00° p 23	Removement of response and oversight costs incurred and paid from October 2004 through December 2004	×	8			-	100000			-	1 0		30000	4/10/2005		
	Reimbussement of response and eversign costs incured and paid from January 2005 through March 2005												2005422	in.		
	Permissioners of response and oversity costs focused and paid from January 2007 through June 2007								-			34	10.25.2007			
	CO, SECTION XXIII.72								-							
CO, p 61	Provide a book, fetter of credit, or ether similar instrument or assurance to the IEPA	×	15	3/21/2004		3/22/2004	3242004	7	3/25/2004		3/26/2004	3/29/2004	330,2004	3731/2004		
	100000000000000000000000000000000000000	7							+	+	-					
	CO, SECTION XXILTS								+	-	1			,,,,,,		
co, p ca	Provide certificate of insurance and insurance policy to IEPA	×	0	8/2/2004	62/2024	82/2004 P.Z.	P22004 B/2004	W-22004	8/2/2004	9/3/2004	82/2004	93250H	842004 BT	811/2004	Prior to commencement of	Prior to commencement of any work under titls order
89 d'00	Certify insurance has been obtained by Contractor		7	8/2/2004	8273004	8/2/2004 8/2/	812/2/04 812/2/04	W 0.2/200s	8/2/2004	WEEKE	8372034	erazan	Section art	8-11/2004		
30,p8	Provide certilizate of insurance and insurance policy to IEPA.	×	100	3/1/2005		3/8/2005	3/10/2006	90	3/11/2005		3/12/2005	3/11/2006	5/1/2005	3/16/2005	Annualy on the effective date of this order	ue of this order
CO, p.63	Provide certificate of insurance and insurance policy to IEPA	×	3963	377/200X		3/8/200X	3/10/200X	×	3/11/200X	1	3/12/200X	6717208	5/1/2005	3/16/2006	Arrualy on the effective date of this order	the of this order
	Provide conflicate of Insurance and Insurance policy to IEPA	×	H	3/7/200X		3/8/200X	3/10/2003	×	3/11/200X		3/12/200X	5775507	\$11,7007 art	3/10/2007	Amusty on the effective date of this order	tte of this order
1. 9	Provide certificate of Insurance and Insurance policy to IEPA	×	3965	37720000		3/8/200X	3/10/200)	×	3/11/200X		3/12/200X	S11/2008	5717002	3/16/2008	Annually on the effective date of this order	te of this order
	Provide certificate of insurance and insurance policy to IEPA	×	98	377200X		3/9/200X	3/10/200%	×	3/11/2000	a	3/12/200X	6/1/2069	571,200a - 311	3/15/2006	Annally on the effective date of this order	de of this order
80,00	Provide certificate of Insurance and Insurance policy to IEPA.	×	R	3/7/200X		SYSZOOX	3/10/2003	×	3/11/200X		3/12/200X	6/1/2010	Sri 20105/178	3/19/2009	Annually on the effective date of this order	tte of this order
	CO, SECTION XXV.78												TANCE.			
50,00	Request for Certification of Completion for Si	×														
														55 T		
	CO, SECTION XXV.00				1	1										
20, p 8	Certitication by Premon for Certification of Completion for RIFS	×				-			10			-	<b>花花</b>			

Determination: Cleanup?

## PA/VSI Or RFA FILE REVIEW CHECKLIST

Facility Name: Premcor Refining Group\_\_\_\_\_

EPA	ID: IL	D 005 1	109 822 City: _Blue Island State: IL		
Nam	e of Re	viewer	: Maureen McHugh Date of Review: 7/31/08		
1	Yes	No	Is this a one folder site?		
2	Yes	No	Are there Superfund files for this site?		
3	Yes	No	Did you Read the Executive Summary?		
		60 (5 (5 (1 16) (5 (5))	There are:22 SWMUs and2 AOCs at this site.		
4	Yes	No	Did you review the regulatory history?		
5	Yes	No	Does the facility have interim status or a permit?		
		ar (sect)	This facility is a: SQG,X LQG, or Less than 90 day.		
6	Yes	No	Was the Facility closed per RCRA? RCRAInfo 380 (1994)		
			If Yes, was the closure: _X CC, or CIP.		
7	Yes	No	Are there documented (historical) releases? Briefly describe on Page 2.		
8	Yes	No	Were there releases identified during the inspection? Briefly describe on Page 2.		
9 Yes No Do you agree with the Conclusions and Recommendations?					
		255 2008	If No, briefly describe on Page 2.		
		entore and common Notice 125 exten			
Asa	a result	of your	review of the PA/VSI or RFA file, please classify this site as:		
			corrective action recommended or warranted: These are sites that closed the regulated units		
			IUs or AOCs at the site did not warrant any further corrective action (no historic releases or s observed during the Visual Site Inspection).		
X	Fu	rther Ac	tion Required: Soil or sediment sampling or groundwater sampling or monitoring or any type		
	nvestiga	ation tha	t was recommended in the report in response to a documented or observed release at any		
			d where such investigation, whether being addressed during the inspection or after, does not documentation in the facility record files.		
	Mo	ore Infor	mation Needed: There is no RFA, PA/VSI or RCRA closure information available.		

## PA/VSI Or RFA FILE REVIEW CHECKLIST

### Notes

AOC2- 2 4000gal metal bulk USTs used for leaded and unleaded gasoline. Installed in the 1970s and no secondary containment.

Briefly describe any documented (historical) releases for any SWMU or AOC recorded in the report. For each release, please identify the SWMU or AOC and a one or two line description of release.

50gal of retained oil was released into the Calumet Sag Channel in 1973. The oil was entrapped and skimmed from the water surface.

Benzene was observed coming out of the ground in 1987.

A 6mi long oil sheen was observed on the Calumet Sag Channel originating from the facility. The discharge was boomed off.

Leakage of product oil contaminated the soil in 1989. The spill was pumped into the wastewater treatment system and the contaminated soil was removed and disposed of.

Gas oil was spilled in 1990 and the contaminated soil was removed and disposed of. Some gas oil was also released into the storm sewer and Mosquito Creek.

Asphalt was spilled onto the ground and hardened. Sand was used to absorb the asphalt's oily nature and 200yd<sup>3</sup>. of contaminated soil was removed and disposed of.

Briefly describe any releases observed during the inspection for any SWMU or AOC recorded in the report. For each release, please identify the SWMU or AOC and a one or two line description of release.

Sulfur powder product was observed on the onsite soil.

A condensate knockoff tank was observed releasing steam and mist onto the cement flooring which then flowed into a wastewater drain.

AOC1- An oily substance was ponding around the base of and asphalt product tank.

Extensive staining at the storage treatment tanks (SWMU8)

Sludge spattering and an unknown deposit on the ground at the water treatment plant for boilers (SWMU22)

### PA/VSI Recommendations

Soil sampling at SWMU8 (storage treatment tanks)- there was extensive staining, soil & groundwater sampling at SWMU19 (wastewater treatment plant), test deposit for caustic contamination (SWMU22), soil and groundwater sampling at AOC1 and AOC2.

Sampling was done in 1997, and several contaminants were above the regulatory limits.

RELE	Marie and
DATE	4-27-01
RIN #	00745-01
INITIA	LS_M

() Corrective Measures Implementation (CMI) begun or completed

RELEA	SEL	D)
DATE	1/6	00
RIN #	055	7-00
CINITELALO	1-	- Contraction of the last of t

INITIALS	M	I IZATIONI OLIFCTIONINI	DATE 160 RIN # 0591
CORRECTI	VE ACTION STABIL	LIZATION QUESTIONN	AIRE INITIALS to
	ciechowski		O
Date: March 19,	1992		
			CATALAGA SONEY
Background Facility Informa	tion	si sa	CONFIDENTIAL
Facility Name:	Clark Oil and Refin	ery Corporation	
EPA Identification No.:	ILD 005 109 822		REGEIVED
Location (City, State):	Blue Island, Illinois		WMD RECORD CENTE
Facility Priority Rank:	Low		— OCT 13 1935
₹: ⊕	4: •		UU.
	•		
1. Is this checklist being consolid waste management u	(A), (a)	() Interim Measur	res begun or completed
several SWMUs, or the en		3. If corrective action	activities have been
Explain.		initiated, are they	
Entire facility - 22 SWMUs a	nd 2 Areas of	and a point of	wir vin or voilloite or dor!
Concern		() Operating pern	nit
		() Post-closure pe	ermit
		() Enforcement or	der
		(X) Other (Explain	1)
-		A 4 manager a com Francisco de Company	
		All past actions have a	ippeared to be
		voluntary.	
Status of Corrective Action A	ctivities at the		
Facility	icultures at the	4. Have interim meas	ures if required or
1	»	completed [see Que	
2. What is the current status	of HSWA	successful in preve	
corrective action activitie	s at the		nation at the facility?
facility?		0 <del>-</del>	PERSON PERSON SAMES SAMESANCE SECRETARIES
		() Yes	
() No corrective action a	activities	() No	
initiated (Go to 5)	II .	(X) Uncertain; still	underway
(X) RCRA Facility Assess	sment (RFA) or	() Not required	
equivalent completed	(D.EX)	4 1 177	
() RCRA Facility Invest	igation (RFI)	Additional explana	itory notes:
underway () RFI completed		Further investigation i	a pandad to data!
() Corrective Measures S	Study (CMS)	the nature and extent	
completed	Judy (CIVIS)	the facility	or contamination at

## Facility Releases and Exposure Concerns 5. To what media have contaminant releases from the facility occurred or been suspected of occurring? (X) Ground water (X) Surface water ( ) Air (X) Soils 6. Are contaminant releases migrating offsite? () Yes; Indicate media, contaminant concentrations, and level of certainty. Groundwater: Surface water: Air: Soils: ( ) No (X) Uncertain 7a. Are humans currently being exposed to contaminants released from the facility? () Yes (Go to 8a) ( ) No (X) Uncertain Additional explanatory notes: Further investigation is needed to determine the nature and extent of contamination at the facility. 7b. Is there a potential for human exposure

to the contaminants released from the facility over the next 5 to 10 years?

() Yes () No

(X) Uncertain

Additional explanatory notes: Further investigation is needed to determine the nature and extent of contamination at the facility. 8a. Are environmental receptors currently being exposed to contaminants released from the facility? () Yes (Go to 9) () No (X) Uncertain Additional explanatory notes: Further investigation is needed to determine the nature and extent of contamination at the facility. 8b. Is there a potential that environmental receptors could be exposed to the contaminants released from the facility over the next 5 to 10 years? () Yes () No (X) Uncertain Additional explanatory notes: Further investigation is needed to determine

the nature and extent of contamination at

the facility.

## **Anticipated Final Corrective Measures**

<ol> <li>If already identified or planned, would final corrective measures be able to be</li> </ol>	Further investigation is needed to determine the nature and extent of contamination at		
implemented in time to adequately	the facility.		
address any existing or short-term threat to human health and the environment?			
to numan hearth and the chynomical:			
() Yes	Technical Ability to Implement Stabilization		
() No	Activities		
(X) Uncertain			
	12. In what phase does the contaminant exist		
Additional explanatory notes:	under ambient site conditions? Check all		
•	that apply.		
Further investigation is needed to determine	1		
the nature and extent of contamination at	(X) Solid		
the facility.	(X) Light non-aqueous phase liquids		
	(LNAPLs)		
•	() Dense non-aqueous phase liquids		
10. Could a stabilization initiative at this	(DNAPLs)		
facility reduce the present or near-term	(X) Dissolved in ground water or surface		
(e.g., less than two years) risks to human	water		
health and the environment?	() Gaseous		
	( ) Other		
() Yes			
() No	13. Which of the following major chemical		
() Uncertain	groupings are of concern at the facility?		
Additional avalances, actor	(V) V 1 · '1 · ' · · · · · · · · · · · · · ·		
Additional explanatory notes:	(X) Volatile organic compounds (VOCs)		
Further investigation is needed to determine	and/or semi-volatiles		
the nature and extent of contamination at	() Polynuclear aromatics (PAHs)		
the facility.	() Pesticides		
the facility.	() Polychlorinated biphenyls (PCBs)		
	and/or dioxins		
	() Other organics		
11. If a stabilization activity were not begun,	(X) Inorganics and metals		
would the threat to human health and the	() Explosives		
	( ) Other		
environment significantly increase before final corrective measures could be			
implemented?			
implemented (			
() Yes			
() No			
(X) Uncertain			
	I and the second		

Additional explanatory notes:

14. Are appropriate stabilization technologies available to prevent the further spread of contamination, based on contaminant	Timing and Other Procedural Issues Associated with Stabilization
characteristics and the facility's environmental setting? [See Attachment A for a listing of potential stabilization technologies.]	16. Can stabilization activities be implemented more quickly than the final corrective measures?
() Yes; Indicate possible course of action.	() Yes () No () Uncertain
•	Additional explanatory notes:
(X) No; Indicate why stabilization technologies are not appropriate; then	
go to Question 18.	
The standard and a standard and a standard as a standard a	17. Can stabilization activities be
Further investigation is needed to determine the nature and extent of contamination at the facility.	incorporated into the final corrective measures at some point in the future?
	() Yes
15. Has the RFI, or another environmental investigation, provided the site	() No () Uncertain
characterization and waste release data needed to design and implement a stabilization activity?	Additional explanatory notes:
() Yes	
() No	
· ·	
If No, can these data be obtained faster than the data needed to implement the final corrective measures?	
() Yes () No	

## Conclusion

18. Is this facility an appropriate candidate for stabilization activities?
() Yes () No, not feasible
() No, not required
(X) Further investigation necessary
Explain final decision, using additional sheets if necessary.
There have been 3 documented releases of petroleum based materials to surface water in the
past. They occurred in 1983, 1987, and 1990. The source of all 3 releases was corrected.
Remediation was performed on the surface water body in 1983 and 1987.
There have been 7 documented releases of petroleum-based materials to on-site soils. These
occurred in 1987, 1989, 1990, and 1991. Four of the 7 releases occurred in 1991. There is no record
of remediation for the 1987 release. Soil sampling was reported to have occurred, but no further
information is available. The 1989 releases were remediated (via removal and disposal of
contaminated soil), but there is no evidence that sampling took place to confirm adequacy of
remediation. The remaining 3 releases were observed during a VSI conducted in 1991. No further
information is available on these releases.
There are 2 fuel product USTs that have never been leaked tested. Soil and ground water have
not been sampled in the vicinity of the USTs.
At this time there is not enough information regarding the nature and extent of contamination
at the facility to determine the need for stabilization activities.

### **CLARK OIL & REFINING CORPORATION**



131ST AND KEDZIE AVENUE POST OFFICE BOX 297 BLUE ISLAND, ILLINOIS 60406-0297 OFFICE: (708) 385-5000 FAX: (708) 385-0781

July 20, 1992



JUL 2 2 1992

OFFICE OF RCRA
Waste Management Division
U.S. EPA, REGION V

Mr. Kevin M. Pierard, Chief United States Environmental Protection Agency Minnesota/Ohio Technical Enforcement Section RCRA Enforcement Branch 77 West Jackson Boulevard Chicago, IL 60604-3590

Subject: Clark Oil & Refining Corporation

Blue Island Refinery ILD 005 109 822

Preliminary Assessment/Visual Site Inspection

Dear Mr. Pierard:

Clark Oil & Refining Corporation (Clark) appreciates your letter and the attached copy of the Preliminary Assessment/Visual Inspection report. The Preliminary Assessment/Visual Site Inspection was performed at Clark's Blue Island Refinery, by Scott Tajak and Cynthia Tarka of Resources Application, Inc.

In the interest of accuracy Clark would like to correct certain areas of the report, that appear to be inconsistent with Clark's normal operations:

- 1. Page 11, 1st paragraph, line 7; ...Clark receives its potable water supply from Lake Michigan through the towns of Alsip and Blue Island. Clark receives it process water from the Cal Sag Channel....
- Page 12, 1st paragraph, lines 10-22; ...The oil is pumped water is gravity fed to one of two in-ground API oil water separators. The oil wastewater is settled allowing for oil to float on top and the sludge to collect on the bottom. The oil is then pumped to the

> and the API oil water separator are gravity fed or pumped into the DAF unit which saturates the wastewater with air bubbles causing the oil to float on the top of the unit. The oil is skimmed off and pumped back to #60s tank 63 or 65, Storage Treatment Tanks (SWMU 8). The water is drained into the Metropolitan Water Reclamation District Sewer System. The sludge (K051) material is vacuum pumped to Tank #66 the overhead sludge tank (SWMU 8). Overflow pit sludge bottoms are also pumped to <del>Tank #66</del> the overhead sludge tank. Tank #66 is a 5,000-barrel Sludge Tank (Clark, 1990). Tanks #63 and #65 (SWMU 8) are oil water separator tanks that operate like Tank 59. Solids settle at the bottom with water lying directly above. The oils are piped back to the Refinery Process Area for reuse. The water is sent back to the overflow pit. The sludge is pumped to Tank #66 pumped directly into tank trucks and sent for disposal at approved TSD Facilities.

- 3. Page 12, 2nd paragraph, line 2; ...This waste is pumped out of the unit and pumped into Tank #66 Tank #63 or #65 (SWMU 8) where it settles with other types of sludge wastes....
- 4. Page 14, 1st paragraph, lines 1-3; The API separator units generate hazardous sludge (K051) that is also pumped to Tank #66 overhead sludge tank, then pumped to

- Tank #63 or #65 (SWMU 8) where it settles with other types of sludge. The sludge is pumped to Tank #66 tank #63 or #65, or disposed of when the sludge inhibits the performance of the unit....
- 5. Page 14, 2nd paragraph, lines 2-4; ... This waste is pumped to Tank #66 (SWMU 8) for storage. This waste stream has been generated in varying quantities since 1968. Tank #66 (SWMU 8) stores DAF float (K048), API separator sludge (K051), and the slop oil emulsion solid (K049)....
- 6. Page 14, 4th paragraph, line 1; Cooling tower basin sludges are generated from the cleaning of the  $\frac{2}{4}$  cooling tower basins (SWMU 3)....
- 7. Page 14, 5th paragraph, lines 1-6; Cooling tower basin sludge is also generated from the cleaning of cooling tower used for cooling the facility's boiler water. Calumet Sag Channel water is pumped into the Water Treatment System (SWMU 22). This water is then treated with water softeners, heated to create steam by the boilers and utilized in heat exchangers and pipe tracing within the refinery. The process cooling water is used once-through as cooling waters in the refinery. The water is then pumped into the one of the four cooling tower units. Cooling tower basin sludge is generated. This waste is pumped into a Wastewater

Treatment System (SWMU 19) sewer. The wastewater is drained into the Metropolitan Water Reclamation District Sewer System.

- 8. Page 16, 6th paragraph, lines 3-8; ... The storm water flows is pumped into API oil water separators the waste water treatment system before discharged into the Metropolitan Water Reclamation District Sewer System.

  If heavy rains occur, the storm water may intermix with the wastewater in Tank #59. Clark is attempting to get intends to apply for a NPDES permit for storm water drainage into the Calumet Sag Channel. Clark has cutoffs within its storm water pipeline that will allow the storm water to flow into the Channel during heavy downpours. after the NPDES permit is approved.
- 9. Page 20, 1st paragraph, line 1; Clark also has 22 air permit and for its 2 Van Air Dryer units at 42 2 different on-site locations....
- 10. Page 20, 4th paragraph, line 2-11; ... Three quarters of a mile downstream upstream from the site, Stoney Creek merges with the Calumet Sag Channel. Two miles furtherdownstream upstream, the Calumet Sag Channel merges with the Little Calumet River. Eight miles further downstream upstream, the Little Calumet River merges with the outlet from Lake Calumet to form the Calumet River, which in turn empties into Lake Michigan

6 miles beyond this junction....

- 11. Page 23, 4th paragraph, lines 5-6; ... The facility is bordered on the east by light industry and residences; on the west by heavy industry; on the north west by FSC Paper Company, ....
- Page 30, 8th paragraph, lines 1-11; This unit consists 12. of 6 gravel-covered dike fields with six 5,100-barrel tanks (Photos 7 and 8). These tanks, #61 through #66, #63, #65, #66, are part of the Wastewater Treatment Plant (SWMU 19) Refinery's oil to rerun system. skimmed oil and oily sludge are pumped to the #60s tanks tank #63 or #65 from the API separators, Tank 59, and the DAF unit for further treatment and/or storage preparation to be rerun in the process in which the material was generated. Tank #66 is a sludge tank (Clark, 1990) rerun storage tank for tansmix (pipeline interface returned from terminal operations. Tanks #63 and #65 (SWMU 8) are oil water separator tanks. Since each type of oil has a different specific gravity many different layers of oil are formed. solids settle at the bottom with water lying directly above. The oils are piped back to the Refinery Process Area for reuse. The water is sent back to the overflow pit and the cycle restarts. The sludge is pumped to Tank #66....
- 13. Page 31, 4th paragraph, lines 1-2; ... A dike surrounds

each the #60s Tanks....

- 14. Page 31, 6th paragraph, lines 1-4; ... The soil was stained extensively at the pipeline connection from Tank #66 #65. This connection is used to vacuum pump sludge from Tank #66 #65 into tanker trucks....
- Page 38, 2nd paragraph, lines 15-; ... The eil water is 15. pumped gravity fed to one of two in-ground API oil water separators. The oil wastewater is settled allowing for oil to float on top and the sludge to collect on the bottom. The oil is then pumped to the #60s Storage Treatment Tanks Tank #63 or #65 (SWMU 8) for further processing. The water from both Tank #59 and the API oil water separator (Photos 21 and 22) are is gravity fed or pumped into the DAF unit (Photo 23) which saturates the wastewater with air bubbles causing the oil to float on the top of the unit. The oil is skimmed off and pumped back to #60s Storage Treatment tank 63 or 65 (SWMU 8)....
- 8). The water is drained into the Metropolitan Water Reclamation District Sewer System. A discharge flow meter exists at this point (Photo 24). The sludge (K051) material is vacuum pumped to Tank #66 (SWMU 8) the overhead sludge tank. Overflow pit sludge bottoms are also pumped to Tank #66 the overhead sludge tank.

  Tank #66 is a 5,000-barrel Sludge Tank (Clark, 1990).

Tanks #63 and #65 (SWMU 8) are oil water separator tanks that operate like Tank 59. Since each type of oil has a different specific gravity, many different layer of oil are formed. Solids settle at the bottom with water lying directly above. The oils are piped back to the Refinery Process Area for reuse. The water is sent back to the overflow pit. The sludge went to Tank #66 pumped directly into tank trucks and sent for disposal at approved TSD Facilities....

- 16. Page 39, 5th paragraph, line 1:...Tank #59 has a earthen coated steel floor....
- 17. Page 41, 1st & 2nd paragraphs;

### SWMU 22 Water Treatment Plant for Boilers

This unit consists of a water treatment system, a <u>5</u> boilers and a <u>4</u> cooling towers. The cooling towers is are 300-foot by 100-foot and is are used to cool heated beiler (the cooling towers do not cool boiler waters) process water (Photo 25). All three ten of these units are located near the north property boundary in the Refinery Process Area. Calumet Sag Channel water is pumped into the unit. The process cooling water is used ence-through as cooling waters in the refinery. The water is then pumped into the one of the four cooling tower units. Cooling tower basin sludge is generated from this process. This sludge is pumped

into a Wastewater Treatment System (SWMU 19) sewer.

The once-through boiler blow down and process cooling water blow down is are pumped into the Metropolitan Water Reclamation District Sewer System.

18. Page 42, 2nd paragraph; This unit consists of two 4,000-gallon underground metal bulk storage tanks (UST) for dispensing regular (leaded) and unleaded gasoline to company vehicles (Clark, 1990). These UST's are located in the Southwest Crude Tank Field. According to facility representatives, these UST's were installed in the early 1970's 1980's. Since the UST's are approximately 20 10 years old and there is no secondary containment, leakage of the product may be occurring. This area is an AOC because the aged UST's may be releasing gasoline product to the soil.

The above stated corrections are the most conspicuous inconsistences noted by Clark. Please do not consider this letter as a comprehensive comment on the Preliminary Assessment. Clark requests a copy of the corrected preliminary assessment so that additional corrections and comments can be submitted.

Thank you allowing Clark to response and for your time in reviewing this letter. If you have any questions, please do not hesitate to contact myself or Stafford Jacques.

Sincerely,

CLARK OIL & REFINING CORPORATION

Ronald Snook

Environmental Specialist

## JUN 8 0 1992

Mr. Ronald D. Snook Environmental Specialist Clark Oil & Refining Corporation 131st and Kedzie Avenue P.O. Box 297 Blue Island, Illinois 60406-0297

Re: Clark Oil & Refining Corporation

ILD 005 109 822

Dear Mr. Snook:

Per your request of October 7, 1991, enclosed please find a copy of the Preliminary Assessment/Visual Site Inspection for the referenced facility.

The executive summary and conclusions and recommendations section have been withheld as enforcement confidential.

If you have any questions, please contact me at (312) 886-4448.

Sincerely yours,

ORIGINAL SIGNED BY KEVIN M. PIERARD

Kevin M. Pierard, Chief Minnesota/Ohio Technical Enforcement Section RCRA Enforcement Branch

Enclosure

HRE-8J:FHARRIS:6-2884:6/29/92:MASTER.RES/LIST2

## OFFICIAL FILE COPY

CONCUR	RENCE RE	QUESTED F	ROM REB
OTHER	REB	REB	REB
STAFF	STAFF	SECTION	BRANCH
		CHIEF	CHIEF
	1/20/100	8A JA (130/92	ù

DATE 3-27-01 RIN # 009/12/01 INITIALS 11 PRC Environmental Management, Inc. 233 North Michigan Avenue Suite 1621 Chicago, IL 60601 312-856-8700 Fax 312-938-0118



## PRELIMINARY ASSESSMENT/ VISUAL SITE INSPECTION

CLARK OIL & REFINING CORPORATION BLUE ISLAND, IL ILD 005 109 822

FINAL REPORT

### Prepared for

## U.S. ENVIRONMENTAL PROTECTION AGENCY Office of Waste Programs Enforcement Washington, DC 20460

Work Assignment No. : R05032

EPA Region : 5

 Site No.
 :
 ILD 005 109 822

 Date Prepared
 :
 June 8, 1992

 Contract No.
 :
 68-W9-0006

 PRC No.
 :
 109-R05032-IL02

Prepared by : Resource Applications, Inc.

Principal Investigator : Scott R. Tajak
Telephone : (312) 332-2230
Contractor Project Manager : Shin Ahn
Telephone No. : (312) 856-8700
EPA Work Assignment Manager : Kevin Pierard


Telephone No. : (312) 886-4448

## TABLE OF CONTENTS

<u>Page</u>
EXECUTIVE SUMMARY ES-1
1.0 INTRODUCTION
2.0 FACILITY DESCRIPTION 4
2.1 FACILITY LOCATION       4         2.2 FACILITY OPERATIONS       4         2.3 WASTE GENERATING PROCESSES       12         2.4 RELEASE HISTORY       17         2.5 REGULATORY HISTORY       18         2.6 ENVIRONMENTAL SETTING       20         2.6.1 Climate       20         2.6.2 Flood Plain and Surface Water       20         2.6.3 Geology and Soils       21         2.6.4 Ground Water       22
2.7 RECEPTORS
3.0 SOLID WASTE MANAGEMENT UNITS
4.0 AREAS OF CONCERN 42
5.0 CONCLUSIONS AND RECOMMENDATIONS
REFERENCES 64
Attachment
A - VISUAL SITE INSPECTION FIELD NOTES
B - VISUAL SITE INSPECTION SUMMARY AND PHOTOGRAPHS

## LIST OF TABLES

<u>Table</u> <u>Page</u>		
1 - SOLID WASTE MANAGEMENT UNITS (SWMU)		
2 - SOLID WASTES		
3 - SWMU AND AOC SUMMARY 44		
LIST OF FIGURES		
<u>Figure</u> Page		
1 - FACILITY LOCATION		
2 - FACILITY LAYOUT 1/REFINERY PROCESS AREA		
3 - FACILITY LAYOUT 2/SOUTHWEST TANK FIELD		
4 - FACILITY LAYOUT 3/NORTHWEST TANK FIELD		



Resource Applications, Inc. (RAI) performed a preliminary assessment and visual site inspection (PA/VSI) to identify and assess the existence and likelihood of releases from solid waste management units (SWMU) and other areas of concern (AOC) at the Clark Oil & Refining Corporation (Clark) facility in Blue Island, IL. This report summarizes the results of the PA/VSI and evaluates the potential for releases of hazardous wastes or hazardous constituents from SWMUs and AOCs identified.

Clark receives sweet crude oil via pipeline, refines it, and produces many petroleum-related products such as gasoline, liquefied petroleum gas (LPG), fuel oil #2, fuel oil #6, asphalt, propane, and butane. The facility covers 160 acres and has been in operation since the 1920s. In 1943 Emery Clark bought the refinery. Emery Clark sold the property to Apex Corporation in 1981. In 1988 Apex attempted to avoid bankruptcy by selling the refinery to the Horsham Corporation. Both Apex and Horsham Corporation maintained the "Clark" name for the Blue Island facility. Clark is regulated as a generator and treatment/storage/disposal interim status facility, but is working toward removing all its hazardous waste within 90 days of generation.

The facility consists of three parcels of land: 1) the Refinery Process Area; 2) the Southwest Crude Oil Tank Field and Barge Loading Area; and, 3) the Northwest Crude Oil Tank Field. In 1985, Clark sold its chemical plant to BTL Industries. Clark still owns a very small parcel of land within this BTL Industries property. Between the Northwest Tank Field and BTL Industries is a parcel of land owned by a different division of Clark. The property is referred to as the Clark Blue Island Terminal. This property used to be part of the refinery. All property previously owned by Clark was included in this PA/VSI.

The primary wastes generated at Clark are dissolved air floatation (DAF) float, slop oil emulsion solids, heat exchanger cleaning sludge, American Petroleum Institute (API) separator sludge, catalyst fines, cooling tower basin sludges, and scrap sulfur and wastewater. The facility is surrounded by a 6-foot chain link fence topped with barbed wire. All entrances to the facility are locked or guarded at all times. The nearest residences are within a mile in all directions from the facility. The nearest school is approximately a 1/2 mile to the northeast of the facility. The Calumet Sag Channel of the Little Calumet River forms the south boundary of the Southwest Crude Tank Field. A forest preserve used primarily for recreation is located less than two miles to the southeast of the facility. There are no wetlands, no habitats of endangered species, and no other sensitive environments within 2 miles of the site.

The PA/VSI identified the following 22 SWMUs and 2 AOCs at the facility:

## Solid Waste Management Units

- 1. Outdoor Drum Storage Area
- 2. Sampled Product Waste Accumulation Areas
- 3. Cooling Tower Units
- 4. Bundle Cleaning Pad
- 5. Former Satellite Accumulation Storage Area
- 6. Former Storage Area
- 7. Satellite Accumulation Area
- 8. Storage Treatment Tanks
- 9. Former Container Storage Treatment Area
- 10. Former Container Storage Treatment Area
- 11. Former Container Storage Treatment Area
- 12. Former Storage Treatment Tank
- 13. Former Drum and Waste Storage Area
- 14. Former Container Storage Area
- 15. Former Container Storage Area
- 16. Former Waste Pile Area
- 17. Former Waste Piles and Impoundment Area
- 18. Former Impoundment Area
- 19. Wastewater Treatment System
- 20. Asbestos Satellite Accumulation Areas
- 21. Spent Catalyst Satellite Accumulation Areas
- 22. Water Treatment Systems for Boilers

### Areas of Concern

- 1. Asphalt Tank
- 2. Underground Fuel Product Storage Tanks

At the Clark facility, there has been a release of an unknown type of petroleum product from Crude Tank #51 (AOC 1) onto the soil. Since no vertical secondary containment exists at this tank, ground water could possibly be contaminated also. A pipeline connection at the Storage Treatment Tanks (SWMU 8) shows evidence of past release to the soil via soil staining. This tank field also has no vertical secondary containment. Thus there is a moderate chance for ground water contamination also. Tank #51 (AOC 1), the Storage Treatment Tanks (SWMU 8), and Tank #59 (SWMU 19) all have no vertical secondary containment and are over 20 years old. RAI recommends that the soil and ground water be sampled for petroleum product contamination for all three areas.

RELEASED DATE 10-9-94 RIN # 0289-96



Clark also has 2 underground fuel product storage tanks (AOC 2) built in the early 1970s. Due to the age of these units, there is a moderate chance of soil and/or ground water contamination. RAI recommends that both the soil and ground water be tested for petroleum contamination. The tanks should also be tested for integrity. Lastly, an unknown chemical deposit was spotted next to the cooling tower used by the Water Treatment System for Boilers (SWMU 22). This release, according to the facility representatives, is from the cooling tower unit. RAI recommends that this deposit be tested for caustic constituents. The potential for release to surface water is low since the facility has many diked areas that serve, as lateral secondary containment. The potential for a release to air is minimal except during a fire or explosion.

The potential for release to surface water is low since the facility has all tank farm areas diked. The process areas have wastewater and stormwater chains that could contain any lateral movement of release. Both types of drains lead into an on-site Wastewater Treatment System (SWMU 19).

The potential for a release to air is low if the units are kept closed or covered. The potential for volatility increases when the units are opened. The overflow pit and oil water separator units (SWMU 19) are exposed to air. These areas have high potential of release to air.

# 1.0 INTRODUCTION

PRC Environmental Management, Inc. (PRC) received Work Assignment No. C05087 from the U.S. Environmental Protection Agency (EPA) under Contract No. 68-W9-0006 (TES 9) to conduct preliminary assessments (PA) and visual site inspections (VSI) of hazardous waste treatment and storage facilities in Region 5. Resource Applications, Inc. (RAI), TES 9 Team member, provided the necessary assistance to complete the PA/VSI activities for Clark Oil and Refining Corporation (Clark).

As part of the EPA Region 5 Environmental Priorities Initiative, the RCRA and CERCLA programs are working together to identify and address RCRA facilities that have a high priority for corrective action using applicable RCRA and CERCLA authorities. The PA/VSI is the first step in the process of prioritizing facilities for corrective action. Through the PA/VSI process, enough information is obtained to characterize a facility's actual or potential releases to the environment from solid waste management units (SWMU) and areas of concern (AOC).

A SWMU is defined as any discernible unit at a RCRA facility in which solid wastes have been placed and from which hazardous constituents might migrate, regardless of whether the unit was intended to manage solid or hazardous waste.

The SWMU definition includes the following:

- RCRA-regulated units, such as container storage areas, tanks, surface impoundments, waste piles, land treatment units, landfills, incinerators, and underground injection wells
- Closed and abandoned units
- Recycling units, wastewater treatment units, and other units that EPA has generally exempted from standards applicable to hazardous waste management units
- Areas contaminated by routine and systematic releases of wastes or hazardous constituents. Such areas might include a wood preservative drippage area, a loading-unloading area, or an area where solvent used to wash large parts has continually dripped onto soils.

An AOC is defined as any area where a release to the environment of hazardous waste or constituents has occurred or is suspected to have occurred on a non-routine and nonsystematic basis. This includes any area where such a release in the future is judged to be a strong possibility.

The purpose of the PA is as follows:

- Identify SWMUs and AOCs at the facility.
- Obtain information on the operational history of the facility.
- Obtain information on releases from any units at the facility.
- Identify data gaps and other informational needs to be filled during the VSI.

The PA generally includes review of all relevant documents and files located at state offices and at the EPA Region 5 office in Chicago.

The purpose of the VSI is as follows:

- Identify SWMUs and AOCs not discovered during the PA.
- Identify releases not discovered during the PA.
- Provide a specific description of the environmental setting.
- Provide information on release pathways and the potential for releases to each medium.
- Confirm information obtained during the PA regarding operations, SWMUs, AOCs, and releases.

The VSI includes interviewing appropriate facility staff, inspecting the entire facility to identify all SWMUs and AOCs, photographing all SWMUs, identifying evidence of releases, initially identifying potential sampling locations, and obtaining all information necessary to complete the PA/VSI report.

This report documents the results of a PA/VSI of the Clark facility in Blue Island, IL.

The PA was completed on August 20, 1991. RAI gathered and reviewed information from the Illinois Environmental Protection Agency (IEPA) and from EPA Region 5 RCRA files. RAI also reviewed relevant publications from the United States Department of Agriculture (USDA), the United States Department of Commerce (USDC), the Federal Emergency Management Agency (FEMA), and the Illinois State Geological Survey (ISGS).

The VSI was conducted on August 21, 1991. It included interviews with Clark facility representatives and a walk-through inspection of the facility. Twenty-two SWMUs and 2 AOCs were identified at the facility. Field notes from the VSI are included in Attachment A. The VSI is summarized and 27 inspection photographs are included in Attachment B.

# 2.0 FACILITY DESCRIPTION

This section describes the facility's location, past and present operations (including waste management practices), waste generating processes, release history, regulatory history, environmental setting, and receptors.

#### 2.1 FACILITY LOCATION

The Clark facility is located at 131st and Kedzie Avenue in Blue Island, Illinois (Figure 1). The facility consists of three main parcels of land: 1) the Refinery Process Area to the northeast; 2) the Crude Oil Tank Field to the northwest; and, 3) a Crude Oil Tank Field and Barge Loading Area to the southwest. Clark previously owned a chemical plant situated next to the Northwest Crude Oil Tank Field. Clark sold this plant to BTL Industries in 1985. Clark also owns the land between the northwest Crude Tank Field and BTL Industries. Currently, it is owned by another division of Clark. This plot of land is referred to as the Clark's Blue Island Terminal. The facility covers 160 acres in three jurisdictions: Alsip, Blue Island, and unincorporated Cook County. The facility is approximately 22 miles southwest of downtown Chicago, at latitude 41° 39' 19" north and longitude 87° 42' 07" west (Clark, 1980b). The facility is situated within a mixed industrial and residential area.

# 2.2 FACILITY OPERATIONS

Great Lakes Refinery began operations in the mid-1920s. In 1943 it was sold to Emery Clark. In 1981 Emery Clark sold the refinery to Apex Corporation. Apex Corporation sold the refinery to Horsham Corporation in order to forestall bankruptcy in 1988 (Clark, 1991f). Both the Apex Corporation and Horsham Corporation maintained the "Clark" name. Clark employs three shifts of workers totalling about 280 people. The facility operates 24 hours a day, 7 days a week, 365 days a year.

Clark receives sweet crude oil via underground pipelines. The oil is diverted to several process areas where it is refined into different petroleum products such as gasoline, liquefied petroleum gas (LPG), fuel oil #2, fuel oil #6, asphalt, propane, and butane. Clark's Interim Status Hazardous Waste Part A Permit allows storage of hazardous waste for greater than 90 days (Clark, 1980b). However, current company policy allows only for less than 90-day storage of hazardous waste. All other wastes are stored on-site until there are sufficient quantities to make transport and disposal economical. The rate of generation for each waste depends on the quantity and type of product being produced. Facility SWMUs are listed in Table 1 and in Figures 2, 3, and 4. Facility AOCs are listed in Figure 3.

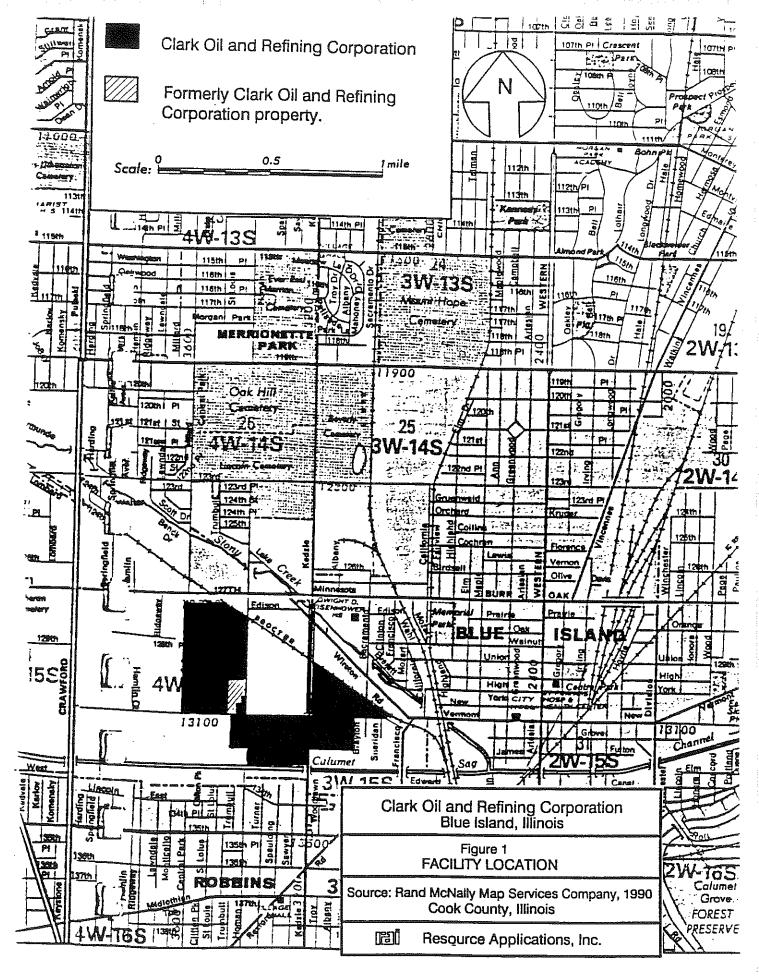


TABLE 1
SOLID WASTE MANAGEMENT UNITS (SWMU)

SWMU Number	SWMU Name	RCRA Hazardous Waste <u>Management Unit*</u>	<u>Status</u>
1	Outdoor Drum Storage Area	No	Active
2	Sampled Product Waste Accumulation Areas	No	Active
3	Cooling Tower Units	No	Active
4	Bundle Cleaning Pad	No	Active
5	Former Satellite Accumulation Area	Yes	Inactive
6	Former Storage Area	Yes	Inactive
7	Satellite Accumulation Area	No	Inactive
8	Storage Treatment Tanks	No	Active
9	Former Container Storage Treatment Area	No	Inactive
10	Former Container Storage Treatment Area	No	Inactive
11	Former Container Storage Treatment Area	No	Inactive
12	Former Storage Treatment Tank	No	Inactive
13	Former Drum and Waste Storage Area	No	Inactive
14	Former Container Storage Area	No	Inactive
Note:	_ ~		

Note:

<sup>\*</sup> A RCRA hazardous waste management unit is one that currently requires, or formerly required a RCRA Part A or Part B permit.


# TABLE 1 (continued)

# SOLID WASTE MANAGEMENT UNITS (SWMU)


SWMU Number	SWMU Name	RCRA Hazardous Waste  Management Unit*	<u>Status</u>
15	Former Container Storage Area	No	Inactive
16	Former Waste Pile Area	No	Inactive
17	Former Waste Piles and Impoundment Area	No	Inactive
18	Former Impoundment Area	No	Inactive
19	Wastewater Treatment System	No	Active
20	Asbestos Satellite Accumulation Areas	No	Inactive
21	Spent Catalyst Satellite Accumulation Areas	No	Active
22	Water Treatment Plant for Boilers	No	Active
	<del></del>		


Note:

<sup>\*</sup> A RCRA hazardous waste management unit is one that currently requires, or formerly required a RCRA Part A or Part B permit.

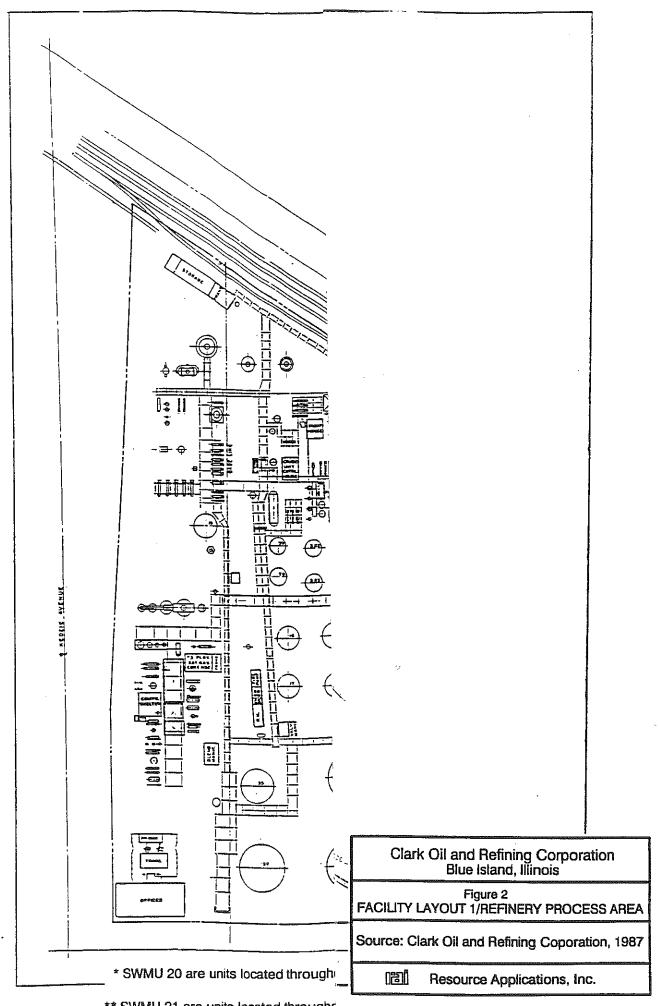

\*\* SWMU 21 are units located througho

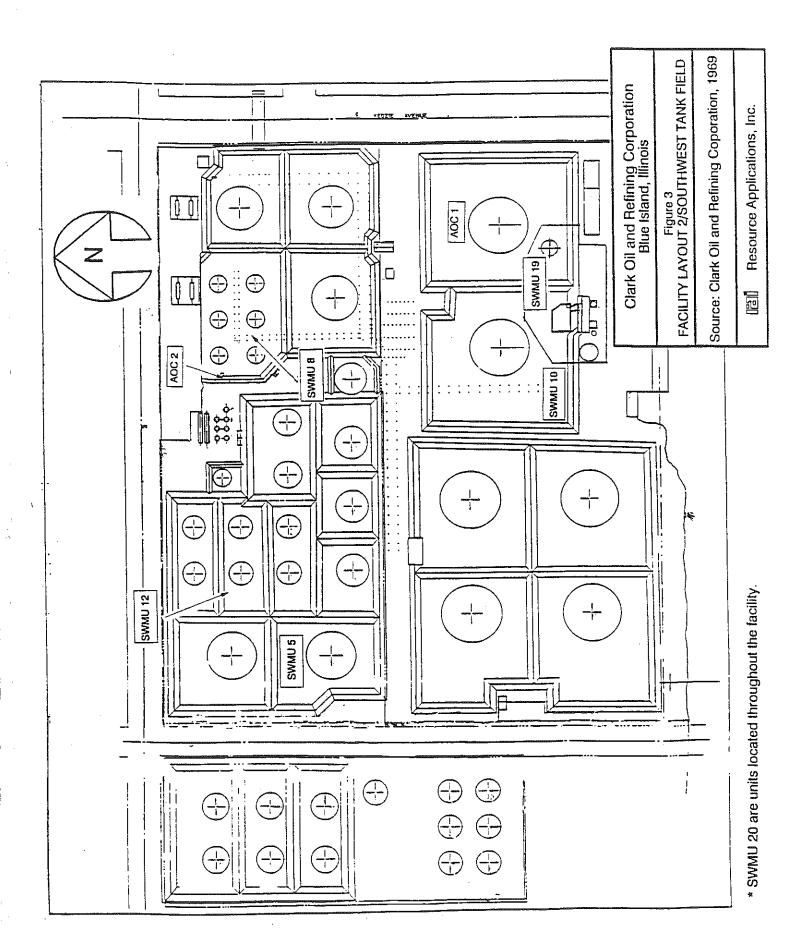

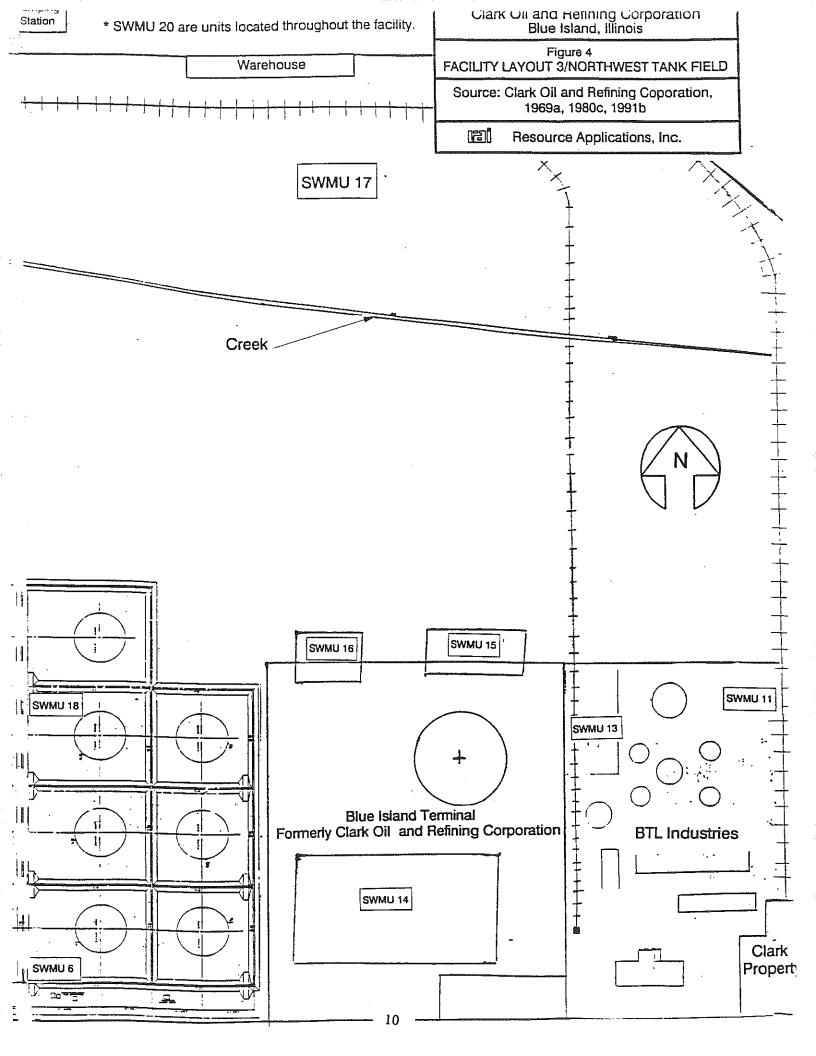

Wastewater is generated in very large volumes at the Clark facility. The wastewater is treated in Clark's Wastewater Treatment System (SWMU 19). This system recovers most of the oily residue from the wastewater. The oily residues are re-entered into the Refinery Process. This Wastewater Treatment System (SWMU 19) has generated dissolved air flotation (DAF) float (K048), American Petroleum Institute (API) separator sludge (K051), and slop oil emulsion solids (K049) since 1968. These waste streams are used for off-site fuel blending. All specific source waste streams at Clark are RCRA-listed hazardous wastes due to the possibility of high levels of cadmium and lead. The Clark facility receives its water supply from Lake Michigan through the towns of Alsip and Blue Island. The Clark facility also has a Water Treatment System for Boilers (SWMU 22). This unit generates non-hazardous sludge and wastewater.

Clark generates bundle cleaning sludge (K050) from heat exchanger cleaning on the Bundle Cleaning Pad (SWMU 4) and basin sludge from the Cooling Tower Units (SWMU 3). The sludges produced from cleaning are power-washed into the Wastewater Treatment System (SWMU 19). Scrap sulfur is also generated during the maintenance and servicing of the desulfurization unit within the Refining Process Area and stored in a Satellite Accumulation Area (SWMU 7). PCB-contaminated oil is generated in small quantities during transformer servicing and is stored in the Outdoor Drum Storage Area (SWMU 1). Spent 1,1,1-trichloroethane (TCA) is generated from the part cleaning dip tank. This waste is also stored in the Outdoor Drum Storage Area (SWMU 1). Safety-Kleen removes the TCA for reprocessing. Asbestos waste is engendered when pipe insulation is removed. This waste is placed in roll-off boxes at the locations (SWMU 20) of the asbestos abatement. Sulfur catalyst, sand, clay, and oily wastes are generated from the cleanup of spilled petroleum product.

Various spent catalysts are generated during the production of gasoline. The waste is placed in drums at various locations (SWMU 21) within the Refinery Process Area. When enough of this waste is collected, it is taken to an outside firm. This firm reprocesses it and gives it back to Clark.

In Clark's Interim Status Hazardous Waste Part A Permit Application, a facility map was provided showing various SWMUs. Most of these SWMUs are currently unidentifiable. The facility representatives claimed that these units did not exist. The representatives also stated no records existed "that they knew of" (Clark, 1991b).

# 23

Most of the wastes generated at the Clark facility are from the Wastewater Treatment System (SWMU 19) (Table 2). All of the refining processes release wastewater. This wastewater enters the Wastewater Treatment System (SWMU 19) through a vast pipeline system. Steel drains connect to the system throughout the whole facility. Eleven electric sump pumps pump the wastewater to the Wastewater Treatment Area in the Southwest Crude Tank Field (Clark, 1990). Some of this wastewater is treated in an alkylation neutralization pit before being pumped to the Wastewater Treatment Area. After it reaches the Wastewater Treatment Area, it is pumped into the aboveground steel 5,100-barrel Tank #59. If the quantity of wastewater is greater than the volume that Tank #59 can hold, the wastewater overflows into a 72,000-gallon pit (Clark, 1991d). This pit is made of concrete and is pitched to one side. As the wastewater settles in Tank #59, the oil floats to the top. The oil is pumped to one of two in-ground API oil water separators. The oil wastewater is settled allowing for oil to float on top and the sludge to collect on the bottom. The oil is then pumped to the #60s Storage Treatment Tanks (SWMU 8) for further processing. The water from both Tank #59 and the API oil water separator are pumped into the DAF unit which saturates the wastewater with air bubbles causing the oil to float to the top of the unit. The oil is skimmed off and pumped back to #60s Storage Treatment Tanks (SWMU 8). The water is drained into the Metropolitan Water Reclamation District Sewer System. The sludge (K051) material is vacuum pumped to Tank #66 (SWMU 8). Overflow pit sludge bottoms are also vacuum pumped to Tank #66. Tank #66 is a 5,100-barrel Sludge Tank (Clark, 1990). Tanks #63 and #65 (SWMU 8) are oil water separator tanks that operate like Tank #59. Since each type of oil has a different specific gravity many different layers of oil are formed. Solids settle at the bottom with water lying directly above. The oils are piped back to the Refinery Process Area for reuse. The water is sent back to the overflow pit. The sludge is pumped to Tank #66. All wastewater treatment sludges are RCRA listed wastes because of possible high levels of chromium and lead constituents. These sludges are removed off-site and used for fuel blending.

The Wastewater Treatment System (SWMU 19) generates several types of hazardous sludge waste. The DAF unit generates float (K048). This waste is pumped out of the unit and pumped into Tank #66 (SWMU 8) where it settles with other types of sludge waste. This waste stream has been produced since 1968 and is generated in varying quantities depending upon the level of production in a given year.

# TABLE 2

# SOLID WASTES

Waste/EPA Waste Code	Source	Primary Management Unit
Dissolved Air Flotation Float/ K048	Wastewater Treatment System	SWMU 19, 8
API Separator Sludge/K051	Wastewater Treatment System	SWMU 19, 8
Slop Oil Emulsion Solids/K049	Wastewater Treatment System	SWMU 19, 8
Heat Exchanger Bundle Cleaning Sludge/K050	Heat Exchanger Bundle Cleaning	SWMU 4, 19
Cooling Tower Basin Sludges	Cooling Tower Basin Cleaning	SWMU 3, 19, 22
Scrap Sulfur	Sulfur Pit and Vessel Cleaning	SWMU 7
Leaded Tank Bottoms/K052	Storage Tank Cleaning	SWMU 5, 6
Spent 1,1,1-trichloroethane/ F001	Parts Cleaning Process	SWMU 1
Oil Product Drippage	Product Sampling Process	SWMU 2
Asbestos	Pipe Insulation Removal	SWMU 20
Scrap Resin	Chemical Plant	SWMU 13
PCB-contaminated Oil	Transformer Servicing	SWMU 1
Spent Catalysts	Gasoline Production	SWMU 21

The API separator units generate hazardous sludge (K051) that is also pumped to Tank #66 (SWMU 8) where it settles with other types of sludge. The sludge is pumped to Tank #66 when the sludge inhibits the performance of the unit. Before 1989, this sludge was pumped directly into tanker trucks and shipped off-site for fuel blending.

Slop oil emulsion solids (K049) are generated from the oil interface from Tanks #63 and #65 (SWMU 8). This waste is pumped to Tank #66 (SWMU 8) for storage. This waste stream has been generated in varying quantities since 1968. Tank #66 (SWMU 8) stores DAF float (K048), API separator sludge (K051), and the slop oil emulsion solids (K049). In 1990, approximately 324,240 gallons of these three sludges were generated at the facility. This combined sludge waste is pumped into tanker trucks provided by American Waste Haulers of Maywood, Illinois and taken to Environmental Waste Resources of Coal City, Illinois for fuel blending (Clark, 1991a) within 90 days of generation.

Heat exchanger bundle cleaning sludge (K050) is generated during the cleaning of heat exchangers. Heat exchangers are a series of bundled metal tubes that have water flowing through them. Half of these tubes have heated water in them and half have cool water in them. The hot tubes warm the cool tubes so that certain refinery processes could recycle the heat displaced in the water. Sometimes dirt, debris, and sludge clog the tubes. When this occurs, the refinery disassembles the heat exchangers and places them on the Bundle Cleaning Pad (SWMU 4). Then the sludge in the tubes is drilled or power sprayed out. The sludge and wastewater are drained into a trench beneath the pad. This trench leads into the Wastewater Treatment System (SWMU 19). This cleaning process has occurred once every three or four years since the mid-1970s.

Cooling tower basin sludges are generated from the cleaning of the 2 process cooling tower basins (SWMU 3). These units are used to cool heated process water. Before 1988 the towers had to be shut down in order for the units to be cleaned. The sludges were pumped into tanker trucks and sent to a landfill for disposal. Since 1988 the basin sludges are power washed into the drains that lead into the Wastewater Treatment System (SWMU 19).

Cooling tower basin sludge is also generated from the cleaning of the cooling tower used for cooling the facility's boiler water. Calumet Sag Channel water is pumped into the Water Treatment System (SWMU 22). This water is then treated with water softeners. The water is used as once-through cooling water. The water is pumped into the cooling tower unit. Cooling tower basin sludge is generated. This waste is pumped into a Wastewater Treatment System (SWMU 19) sewer. The wastewater is drained into the Metropolitan Water Reclamation District Sewer System.

Scrap sulfur has been generated from the cleaning of the Sulfur Pits and Vessels (SWMU 7) since 1976 when the desulfurization process area was built. When a sulfur pit or vessel is shut down for cleaning or maintenance, the molten sulfur is pumped directly into tanker trucks and sold as product. The unpumpable sulfur is allowed to cool. Jackhammers are used to crack the hardened sulfur. The sulfur rock is removed and placed into 55-gallon steel drums. This waste is then shipped off-site by flatbed truck to a landfill for disposal. This waste is generated only once every four or five years or when the unit is shut down for maintenance.

Leaded tank bottoms (K052) were occasionally removed in the past during tank cleaning. This waste was generated during the storage of leaded gasoline. These leaded tank bottoms were pumped or shoveled into plastic lined roll-off boxes. Currently, Clark no longer produces leaded gasoline. In 1981, 20 cubic yards of leaded tank bottoms were removed from Crude Tank #46 (Clark, 1981). This waste was shoveled into a lined roll-off box within the diked area (SWMU 5) outside Tank #46. This roll-off boy unit was moved to the Northwest Tank Field in the diked area (SWMU 6) surrounding Crude Tank #801. This waste was transported by General Drainage of Gary, Indiana to Waste Management of Illinois' CID landfill in Calumet City, Illinois (Clark, 1981). In 1988, Clark generated 12,120 gallons of leaded tank bottoms (Clark, 1989). The last shipments of this waste were transported in 1988 by Independent Waste of Gary, Indiana to CID Landfill for land disposal (Clark, 1989).

Spent 1,1,1-trichloroethane (TCA) (F001) is generated from the part cleaning dip tank. Before 1990 this degreaser never became a waste. It was used for cleaning pipes and pumps throughout the facility. Most of the spent TCA evaporated into the air during this cleaning. Since, 1990 year or so spent TCA is no longer used for cleaning pumps and pipes. Hence the spent TCA is vacuum pumped into steel 55-gallon drums and placed on plastic pallets in the Outdoor Drum Storage Area (SWMU 1). Clark generated 855 gallons of spent TCA in 1990 (Clark, 1991a, 1991b). This waste was picked up by Safety-Kleen for incineration/reprocessing.

Occasionally sampling of product is performed to test for quality. The samples are tested on-site. The samples cannot be considered waste after testing, since the samples are deposited directly into the Crude Unit for reuse. The Crude Unit is the location where incoming crude oil is diverted to all refining processes. However, 30-gallon barrels stored in SWMU 2 are used below the sampling spigots in case drippage or overflows occur during sample can filling. This overflow material is waste. The barrels are emptied into the one of the Wastewater Treatment System's sumps, which pump wastewater to the oil water separators (SWMU 19).

Asbestos is generated infrequently when pipe insulation is replaced. This removal process occurs throughout the facility. Each location of asbestos removal and accumulation is a SWMU. These numerous locations will be referred to as Asbestos Satellite Accumulation Areas (SWMU 20). When there is asbestos waste, it is wrapped in plastic and placed into a roll-off box. This waste is then sent to a landfill for disposal.

Scrap resin was generated before 1985 at Clark's Chemical Plant now owned by BTL Industries. This scrap resin was placed into 55-gallon steel drums and stored in a Drum and Waste Storage Area (SWMU 13), also currently located in BTL Industries. This waste was transported by BFI to ESL of Joliet for landfilling (Clark, 1991d).

Polychlorinated Biphenyl (PCB) contaminated oil is generated in small quantities. Every other year Clark hires an outside contractor to service its transformers. Sometimes servicing requires the removal of the dielectric which may contain PCB oil. This waste is removed by the contractor to an unknown location (Clark, 1991c).

Sulfur catalyst, sand, clay, and oil wastes are generated from the cleanup of spilled asphalt, oil, etc. This waste stream is generated only when a spill occurs. The rate of generation for this waste stream depends upon the size and type of spill. This waste is stored near the spill site in a roll-off boxes when needed. This nonhazardous waste is shipped to a landfill when economically feasible.

Various spent catalysts are generated during the production of gasoline. The rate of generation depends upon the rate of gasoline production. These catalyst fines are placed into 55-gallon steel drums at several Spent Catalyst Satellite Accumulation Areas (SWMU 21) throughout the Refinery Process Area. This material is shipped off-site when economically feasible for recycling and/or recovery of the catalyst. The recovered catalyst is sent back to Clark for reuse.

Storm water drains are present throughout the Clark facility. These drains lead into a pipeline separate from the wastewater pipeline. The storm water pipeline system flows to the Wastewater Treatment Area in the southwest crude tank field (SWMU 19). The storm water flows into the API oil water separators before discharging into the Metropolitan Water Reclamation District Sewer System. If heavy rains occur, the storm water may intermix with the wastewater in Tank #59. Clark is attempting to get a NPDES permit for storm water drainage into the Calumet Sag Channel. Clark has cutoffs within its storm water pipeline that will allow the storm water to flow into the Channel during heavy downpours after the NPDES permit is approved.

#### 2.4 RELEASE HISTORY

On January 18, 1973 an unexpected flash rainstorm of high intensity caused water in a 6-foot diameter waste and storm water sewer to overflow an oil retention baffle and discharge an estimated maximum of 50 gallons of retained oil into the Calumet Sag Channel (Clark, 1991b). Retention booms were used to entrap the oil after which it was skimmed from the water surface. To prevent a reoccurrence, Clark installed a permanent surface skimmer, complete with a pump, that enables the operator to readily accomplish removal of surface oil from behind the baffle during periods of higher than normal flows (Clark, 1990).

At a 1987 IEPA site inspection, benzene was observed coming out of the ground at BTL Industries (IEPA, 1988). Clark sold BTL Industries its Chemical Plant in 1985. Soil samples were taken but RAI was unable to obtain copies of the analytical results. Also in June of 1987, a 6 mile long oil sheen was observed by a Metropolitan Water Reclamation (MWRD) District helicopter on the Calumet Sag Channel originating from Clark (IEPA, 1987a, 1987b). Clark boomed the discharge off. The discharge was from a pipe that should not have had a connection with crude pipelines. No further information was made available to RAI about this incident.

In 1989 leakage of oil product from Tank #52 contaminated the soil. The spill was pumped into the wastewater system. The contaminated soil was removed to CID Landfill for land disposal. Clark also cleaned and/or replaced all contaminated sewer drains (Clark, 1991c). In 1989 a fire occurred on a gas tank flange. Clark's own fire team put out the fire (Clark, 1991c).

On May 14, 1990 a 6-inch flange gasket on Tank #804 (a 119,300-barrel tank) in the Northwest Crude Tank Field broke spilling "gas-oil" into the Tank #804 dike (Clark, 1990). This material normally would be contained in the dike. Each dike within the #800 and terminal tank farms has a drain and a control valve which is left closed. The valves are manually opened to drain rainwater. Rainwater is drained to the Alsip storm sewer located on the west side of the #800 tank farm. The Alsip sewer flows north and discharges into Mosquito Creek. Mosquito Creek in the past flowed east, but currently it flows west. The problem arose when the control valve on the Tank #804 dike did not function properly. On or about May 14, 1990 the 6-inch flange was repaired. During this time it was not known that the #804 dike control valve was malfunctioning. The contaminated soil was removed on or about May 17, 1990 and properly disposed (Clark, 1990). On May 23, 1990, the malfunctioning control valve was found and recorded. It was repaired on May 25, 1990. Gas-oil has a very high viscosity, once it drains it sets up as a solid. On June 8, 1990 after a period of rain, the #800 tank farm discharged its collected rainwater and

the warm temperature was enough to liquefy the gas-oil. The gas-oil then flowed into the Alsip storm sewer and subsequently in to Mosquito Creek. To prevent reoccurrences, Clark checks all control valves on a routine basis to assure proper operation and control valves are checked after any uncontrolled spill (Clark, 1990).

On May 5, 1991, Tank #38 overflowed. Asphalt poured onto the ground and hardened. Sand was placed on the spill to absorb some of the asphalt's oily nature. Clark remediated the ground by removing 200 cubic yards of contaminated soil. This waste was placed in a plastic lined roll-off box and taken to CID Landfill for disposal (Clark, 1991c).

During the VSI on August 21, 1991, three releases to the environment were noted. First, in the Desulfurization Plant Area (Refining Process Area), sulfur powder product was observed on the on-site soil. In the HF Alkylation Plant Area, a condensate knockoff tank was observed releasing steam and mist onto the cement flooring. This water then flowed into a wastewater drain within 5 feet of the unit. This release is not a normal event. A pump normally pushes the condensate into the Wastewater Treatment Plant (SWMU 19). This pump failed, thus triggering the manually controlled release. Also noted was ponding of an oily substance around the base of Tank #51. This tank stores asphalt product.

# 2.5 REGULATORY HISTORY

Clark filed its Permit Application for Treatment Works and Wastewater Sources on October 24, 1972 (Clark, 1972). Clark applied for a renewal of its operating permit in 1974. IEPA notified Clark on October 31, 1974 that Clark's renewal application was an incomplete submission. IEPA requested Clark to add specific information about its cyanide concentrations in its wastewater effluent (Clark, 1974). Clark filed a Notification of Hazardous Waste Activity designating the facility status as a generator and treatment/storage/disposal firm (Clark, 1980a). Their Part A permit application was filed on November 17, 1980 stating that 700 tons of K048 waste; 2,600 tons of K049 waste; 1 ton of K050 waste; 1,200 tons of K051 waste; 200 tons of K052 waste; 30 tons of D001 waste; 74 tons of D002 waste, and 791 tons of D003 waste were generated per year (S01, S02, T01, T02, T04) (Clark, 1980b). EPA verified Clark's Hazardous Waste activity on September 28, 1981 (EPA, 1981).

Included with Clark's Part A permit application were facility drawings indicating six container storage units, waste pile and surface impoundment units, and tank storage and treatment units. During the VSI, Clark claimed that these units never existed, as they had originally been identified by Clark on their Part Application and never removed in subsequent Part A applications. RAI considered them

SWMUs and proceeded to investigate the location these units were to have occupied. Very little information was available regarding these units.

On August 2, 1983 Clark requested EPA for permission to modify its Part A application (Clark, 1983). Clark wanted to change its Interim Status to generator only. Clark claimed that it had never stored, treated, or disposed of hazardous wastes for greater than 90 days. EPA responded to this request on January 24, 1984. EPA notified Clark that its request to modify its Interim Status was not signed and certified by an authorized person. Also EPA reminded Clark that if a treatment/storage/disposal (TSD) unit was used for hazardous waste, that it must go through closure before the modification to status is approved (EPA, 1984a). Clark failed to reply to this response. On December 18, 1984 EPA requested that Clark review current regulations before requesting withdrawal of Part A - Interim status (EPA, 1984b). On January 10, 1985, Clark once again requested a withdrawal of its Part A Permit (Clark, 1985a). EPA responded to this second request for withdrawal on June 12, 1985. EPA again informed Clark that its request was not signed and certified by an authorized person. EPA reminded Clark that if any unit was previously used to treat/store/dispose any hazardous waste, the unit would have to go through closure (EPA, 1985b). For a third time Clark requested EPA for permission to modify its permit on July 24, 1985 (Clark, 1985b). Clark reemphasized its request on October 8, 1985. Clark restated that it only generates waste. Clark mentioned that a roll-off box of leaded tank bottoms (K052) was inadvertently stored on-site for longer than 90 days while awaiting disposal permit issuance from IEPA (Clark, 1985c). In a followup letter, Clark explained this issue further. Clark informed EPA that it had waited 64 days for a disposal permit to be issued by IEPA. Although the leaded tank bottoms are a listed (K048) waste, characteristic category testing found the waste nonhazardous. During conversations with facility representatives for this VSI, as of August 21, 1991 Clark is still a generator and TSD facility (Clark, 1991c).

Over the past nine years, IEPA has conducted several inspections of Clark's waste management practices. On March 24, 1982, an IEPA Interim Status Standards inspection was performed at the facility (IEPA, 1982). This inspection report is illegible. RAI was unable to obtain a good copy. On August 12, 1987 a RCRA inspection was performed to determine the Interim Status of this facility. No specific conclusions were drawn from the visit. No violations were cited, although a fuel tank was found leaking oil into a diked containment area (IEPA, 1987a). A RCRA Land Disposal Restriction Inspection was performed on November 16, 1989 (IEPA, 1989). Clark was found to be operating in compliance with Land Disposal Restriction regulations. On May 6, 1991 IEPA notified Clark that operator certification records indicated that Clark's Wastewater Treatment System was not being operated by a properly certified operator. IEPA requested Clark to respond within 30 days of its plan to alleviate this noncompliance (IEPA, 1991a).

Clark also has 22 air permits for its Van Air Dryer units at 42 different on-site locations (Clark, 1991g, IEPA, 1991b). These units dry fuel gas lines before emitting steam to the air. These units do not generate waste.

All of Clark's wastewater discharge and surface waater runoff is directed to the Metropolitan Water Reclamation District Sewer System. Clark has no NPDES permit.

# 2.6 ENVIRONMENTAL SETTING

This section describes the climate, flood plain and surface water, geology and soils, and ground water in the vicinity of the Clark facility.

#### 2.6.1 Climate

The Clark site is located at 131st and Kedzie Avenue in Blue Island, Illinois, a suburb southwest of Chicago. It is approximately 11 miles southeast of Midway Airport, the location of the nearest U.S. National Weather Service Office. With no significant topographical barriers to airmass flow, the climate in the area is typically continental with cold winters, warm summers, and frequent short-period fluctuations in temperature, humidity, cloudiness, and wind direction (Ruffner, 1985). The average annual daily temperature is 50.6°F, while the lowest average minimum temperature is 17.6°F occurs in January and the highest average monthly maximum temperature of 81.8°F occurs in July. The prevailing wind direction is from the west-southwest, and the average wind speed is 10 miles per hour. Average annual precipitation, as a water equivalent is 34.33 inches. Average annual net precipitation is 4.44 inches (USDC, 1968). In winter, about one-half of the precipitation (10 percent of the annual total) falls as snow. During the fall, winter, and spring, the pattern of precipitation tends to be more uniform both over time and distance, whereas in summer, rainfall is often locally heavy and variable. The 1-year, 24-hour maximum rainfall recorded in the area over a 34-year period is 6.24 inches (Ruffner and Bair, 1985).

#### 2.6.2 Flood Plain and Surface Water

The facility is at an approximate elevation of 600 feet above mean sea level. The Calumet Sag Channel forms the south boundary of the Southwest Crude Tank Field. Three quarters of a mile downstream from the site, Stony Creek merges with the Calumet Sag Channel. Two miles further downstream, the Calumet Sag Channel merges with the Little Calumet River. Eight miles further downstream, the Little Calumet River merges with the outlet from Lake Calumet to form the Calumet

River, which in turn empties into Lake Michigan 6 miles beyond this junction. From the Calumet Sag Channel to the Little Calumet River's junction with the Calumet River, the riverbanks run a course of almost constant elevation. Beyond this junction the riverbanks run at an almost constant elevation but are bordered, up to one-half mile from either bank, by swamps, marshes, and poorly drained land (USGS, 1977). The site locale is classified as a Zone C flood plain area, that is, an area of minimal flooding outside the 500-year flood plain limit (FEMA, 1983).

# 2.6.3 Geology and Soils

Surface features in the Chicago area are largely the result of glaciation and almost completely cover the underlying bedrock surface (Willman, 1971). The facility is underlain by a soil complex known as the Urban land-Selma-Oakville. Urban land comprises 50 percent of this soil complex and consists of soils that have been cut, graded, and filled and that are obscured by buildings and pavements. The Selma soil series, comprising 20 percent of the soil complex, is characterized by deep, poorly drained moderately permeable soils on outwash and lake plains. They are formed in loamy, calcareous glacial outwash and have slopes ranging from 0 to 2 percent. Oakville soils make up 20 percent of the complex and consist of deep, well-drained, very rapidly permeable soils on sand ridges. These soils formed in lake-deposited beach ridges, and have slopes ranging from 2 to 7 percent. The remaining soils in this complex have a common quality of being drained (USDA, 1979).

Soils in the Chicago area have developed over the past 13,500 years through weathering of the immediately underlying glacial deposits left behind, for the most part, by retreating Wisconsin-age glaciers. In the vicinity of the site, these glacial deposits consist largely of silt and clay, with occasional lenses of sand and gravel reworked glacial deposits. Commingled with these deposits in the Lake Calumet region are areas of made-land -- former lake-bottom land reclaimed using rubbish as landfill material.

Approximately 45 feet of glacial deposits/made-land overlie the uppermost bedrock unit of Silurian age. In the Chicago area, Silurian age formations are almost entirely dolomite, whose composition ranges from extremely argillaceous, silty, and cherty to exceptionally pure. In the site vicinity, it is about 450 feet thick. Beneath the Silurian dolomite are successively older rocks of Ordovician and Cambrian age. Within each of these two systems are distinctive sandstone formations which serve as major aquifer systems in the Chicago area. The base of the Cambrian is in contact with the crystalline pre-Cambrian basement at an inferred depth of 4,500 feet (Willman, 1971).

#### 2.6.4 Ground Water

In northeastern Illinois, ground water is obtained from four major aquifer systems: the glacial drift system, the shallow bedrock system, and two deep bedrock systems. They are distinguished by their hydrologic properties and recharge source areas (Hughes, et al., 1966). In central Cook County, the glacial drift is thin, and sand and gravel deposits are correspondingly thin or absent. Here shallow deposits are mainly fine-grained or silty, and virtually all drilled wells penetrate solid bedrock for ground water supplies (Bergstrom, et al., 1955). The shallow bedrock aquifer system in the vicinity of site underlies the glacial drift system and comprises the Silurian dolomite formations and underlying late Ordovician shales. The upper boundary of this system is the top of the bedrock, and the lower boundary is the top of a sequence of formations of middle Ordovician age called the Galena-Platteville Dolomite. Water from this aquifer is obtained from fractures and solution openings in the Silurian dolomite beds. As a result, individual well yields vary widely, depending upon the water volume present in the drilled openings. Recharge is attained by percolation of local precipitation through the overlying glacial drift and/or permeable materials within the drift sequence itself (Hughes, et al., 1966). The shallow bedrock system can serve as a source for domestic, industrial, and municipal water supplies. Domestic wells usually obtain water from the upper 15 feet to 75 feet of the dolomite, while wells serving municipalities and industries generally penetrate 50 feet to 250 feet into the dolomite (Bergstrom, et al., 1955).

The deep bedrock aquifer systems include the Cambrian-Ordovician aquifer system and the Mt. Simon aquifer system. The former comprises the Glenwood and St. Peter Formations of the middle Ordovician series and the Ironton and Galesville Sandstone Formations of the late Cambrian. The top of the Cambrian-Ordovician aquifer is at the top of or within the Galena-Platteville Dolomite, which serves as the lower boundary for the shallow bedrock aquifer system. In the site locale, the contact between the Galena-Platteville Formations and the Glenwood Formation occurs at a depth of about 800 feet below the ground surface. The bottom of the Cambrian-Ordovician aquifer system is located in the impermeable shales and dolomites of the upper and middle parts of the Cambrian Eau Claire Formation, at a depth of about 1,400 feet below the ground surface. Thus, this aquifer system spans a thickness of 600 feet (Hughes, et al., 1966).

Within the Cambrian-Ordovician aquifer system, the Glenwood-St. Peter Sandstone unit is widely utilized as an aquifer where water requirements are less than 200 gallons per minute (gpm). This unit has a permeability of approximately 15 gallons per day per square foot (gpd/sq.ft). The Ironton-Galesville Sandstone unit is the major producing unit in the Cambrian-Ordovician aquifer because it has the most

consistent permeability (35gpd/sq.ft) and thickness (200 ft.) of the aquifers in northeastern Illinois (Hughes, et al., 1966).

Recharge to the Cambrian-Ordovician aquifer system is mostly from western McHenry, Kane and Kendall Counties where the rocks crop out at the surface or lie immediately below the glacial drift. Additional recharge occurs directly from leakage of precipitation downward through the shallow bedrock aquifer system.

The second deep bedrock aquifer system - the Mt. Simon aquifer - is situated on top by the relatively impermeable shales and dolomites of the upper and middle parts of the Eau Claire Formation. These units function as an aquitard and water in the Mt. Simon aquifer is about 1,750 feet beneath the ground surface. Although the Mt. Simon Sandstone is nearly 2,000 feet thick, only the uppermost 275 feet of sandstone yield potable water because, below that depth, the water is too highly mineralized for most purposes (Hughes, et al., 1966). The average permeability of the Mt. Simon aquifer system is approximately 16 gpd/sq. ft (Hughes, et al., 1966) and recharge is largely from the outcrop region of Cambrian rocks in central southern Wisconsin (Willman, 1971).

# 2.7 RECEPTORS

The Clark facility is located at the intersection of 131st and Kedzie Avenue is in a mixed industrial and residential area approximately 22 miles southwest of downtown Chicago, Illinois (Figure 1). This facility lies in three jurisdictions: Alsip, Blue Island, and unincorporated Cook County. The population of Alsip is 17,134 (Rand McNally, 1991). The population of Blue Island is 22,700 (McNally, 1991). The population of neighboring Chicago is approximately 2.8 million. The facility is bordered on the east by light industry and residences; on the west by heavy industry; on the north by FSC Paper Company, Century Oil Company, and a florist; and, on the south by the Calumet Sag Channel. The land on the southside of the Channel is owned by the Metropolitan Water Reclamation District. The proposed Robbins incinerator is suppose to be built there in the near future. BTL Industries, Clark Blue Island Terminal, and Martin Oil are situated between the Refinery Processing Area and the Northwest Crude Tank Field. Residential areas are a within a mile in all directions from the facility. The nearest school is a half-mile to the northeast of the facility.

The facility is surrounded by a 6-foot chain link fence topped with barbed wire. All entrances to the facility are locked or guarded at all times. The gates that are guarded, are so, 24 hours a day, 7 days a week.

Drinking water is supplied to the facility by the Towns of Alsip and Blue Island from Lake Michigan. There are no potable ground water wells within a two mile radius of the site (Clark, 1991f). The facility lies next to the Calumet Sag Channel. Mosquito Creek runs through the Northwest Crude Tank Field. Midway Airport is approximately 11 miles southwest of the facility. The Clark facility discharges all storm water and pretreated wastewater into the Metropolitan Water Reclamation District Sewer System.

A forest preserve used primarily for recreation is located within two miles to the southeast of the facility. There are no wetlands, no habitats of endangered species, and no other sensitive environments within two miles of the site.

# 3.0 SOLID WASTE MANAGEMENT UNITS

This section describes the 22 SWMUs identified during the PA/VSI. The following information is presented for each SWMU: description of the unit, dates of operation, wastes managed, release controls, history of release, and RAI observations.

SWMU 1

Outdoor Drum Storage Area

Unit Description:

This 6-foot by 18-foot storage area is used to store hazardous and special waste, as well as asphalt product in 55-gallon steel drums (Photo 1). The hazardous waste is stored for less than 90 days per current company policy. The unit is located within the Refinery Process Area.

Date of Startup:

1990.

Date of Closure:

This unit is currently active.

Wastes Managed:

1,1,1-trichloroethane (TCA)/F001, PCB-contaminated oil/special waste.

Release Controls:

This unit is located outdoors. The drummed wastes are on plastic 3-foot

by 4-foot pailets on cement pavement.

History of Release:

No releases have been documented at this unit.

Observations:

Three drums of spent TCA (F001) and 1 drum of PCB-contaminated oil (special) was observed on a plastic pallet. Seven drums of asphalt product were also observed within the unit. The drums were sealed, labeled, and dated. There are some stains on the cement surface of the storage area. The drums appeared to be in sound condition.

SWMU 2

Sampled Product Waste Accumulation Areas

Unit Description:

These 3-foot by 3-foot areas are used to collect drippage and overflow product sampling fluids in 30-gailon steel drums (Photo 2). The waste is accumulated until the drums are full and/or within 90 days of generation

as per current company policy. Then the waste is poured into one of the Wastewater Treatment System sumps which pump it with other wastewater to the oil water separator Tank #59.

Date of Startup:

Before 1964.

Date of Closure:

These units are currently active.

Wastes Managed:

Various liquid petroleum based products.

Release Controls:

The drums rests on 3-foot by 3-foot circular metal pallets on cement

flooring. These units are located outdoors.

History of Release:

No releases have been documented at these units.

Observations:

The concrete flooring has minor cracking. The barrels observed appeared to be in sound condition and were covered with lids. No evidence of release was noted.

SWMU 3

Cooling Tower Units

Unit Description:

These 300-foot by 100-foot units are used to cool heated process water. They are located near the north property boundary in the Refinery Process Area. Water is allowed to fall 100 feet into a basin. This cools the heated water. Sometimes this water has particulate matter that falls and settles within the cooling tower basin. The sludge material that collects in the basin is currently power-washed into drains that lead into the Wastewater Treatment System (SWMU 19). Before 1988 the towers had to be shut down to remove sludge. The sludge was pumped into tanker trucks and sent to a landfill for disposal.

Date of Startup:

Before 1964.

Date of Closure:

These units are currently active.

Wastes Managed:

Cooling tower sludge, wastewater.

Release Controls:

These units are located outdoors. The cooling tower basins have a single unit concrete floor and berm. The berm is 1-foot high and 6-inches wide. These units have several wastewater drains.

History of Release:

No releases have been documented at these units.

Observations:

Two operating cooling towers were observed. Both seemed to be in sound condition. No evidence of release is noted.

SWMU 4

**Bundle Cleaning Pad** 

Unit Description:

This 25-foot by 50-foot unit is used during heat exchanger bundle cleaning (Photo 3). Heat exchangers are a series of bundled metal tubes that have water flowing through them. Half of these tubes have heated water in them and half have cool water in them. The hot tubes warm the cool tubes so that certain refinery processes could recycle the heat displaced in the water. Sometimes dirt, debris and sludge clog the tubes. When this occurs, the refinery disassembles the heat exchanger and place the tubes on the Bundle Cleaning Pad. Then the sludge in the tubes is drilled or power-sprayed out. The sludge and wastewater are drained into a trench beneath the pad. This trench leads into the Wastewater Treatment System (SWMU 19). This unit is located in the Refinery Process Area, south of the cooling tower units.

Date of Startup:

Mid-1970s.

Date of Closure:

This unit is currently active.

Wastes Managed:

Heat exchanger bundle cleaning sludge/K050, wastewater.

Release Controls:

The unit has a concrete pad. The pad is pitched toward a wastewater sewer. The unit is bermed on three sides. The berm is 4 inches high and 3 inches wide.

History of Release:

No releases have been documented at this unit.

Observations:

The unit was observed to be in sound condition. One side of the concrete pad has no berm. Although this pad is pitched toward the wastewater sewer, a release of wastewater may have occurred along the side of the pad with no berm.

SWMU 5

Former Satellite Accumulation Area

Unit Description:

This former 10-foot by 40-foot unit was used for the accumulation and storage of hazardous tank bottom waste from Crude Tank #46 (Photo 4). Crude #46 Tank held leaded gasoline product. Clark no longer produces leaded gasoline. The waste was shoveled and pumped into a plastic lined roll-off box. This former unit was located in the Southwest Crude Tank Field.

Date of Startup:

1981.

Date of Closure:

This unit is inactive. The tank was moved to SWMU 6 in 1981. The waste was stored in both SWMU areas combined for greater than 90 days. Clark claims that both of these units do not need closure since IEPA was tardy in approving a disposal permit for the waste. EPA has not made a decision on this issue.

Wastes Managed:

Leaded tank bottoms/K052.

Release Controls:

This former unit was outdoors. The unit has a earthen floor. A dike surrounds Tank #46 and the former unit area. The gravel covered earthen dike is 5 feet high and has a secondary containment capacity of 75,200 barrels (Clark, 1990).

History of Release:

No releases have been documented at this unit.

Observations:

No evidence of this unit currently exists. Crude Tank #46 no longer stores leaded gasoline.

SWMU 6

Former Storage Area

Unit Description:

This former 10-foot by 40-foot unit was used for the storage of hazardous tank bottom waste from Crude Tank #46 (SWMU 5) (Photo 5). This former unit was located within the diked area of Crude Tank #801 in the Northwest Crude Tank Field.

Date of Startup:

1981.

Date of Closure:

This unit is inactive. The tank was removed in 1981. The waste was stored in both SWMU 5 and 6 combined for greater than 90 days. Clark claims that both of these units do not need closure since IEPA was tardy in approving a disposal permit for the waste. EPA has not made a decision on this issue.

Wastes Managed:

Leaded tank bottoms/K052.

Release Controls:

This former unit was outdoors. The unit has a earthen floor. A dike surrounds Tank #801 and the former unit area. The gravel covered earthen dike is 5 feet high and has a secondary containment capacity of 115,000 barrels (Clark, 1990).

History of Release:

No releases have been documented at this unit.

Observations:

No evidence of this unit currently exists.

SWMU 7

Satellite Accumulation Area

Unit Description:

This 3-foot by 3-foot area is used to accumulate and store waste sulfur in 55-gallon steel drums. This waste is generated from cleaning the sulfur pits and vessels associated with the desulfurization process (Photo 6). When a sulfur pit or vessel is shut down for cleaning or maintenance, the molten sulfur is pumped directly into tanker trucks and sold as product. The unpumpable sulfur is allowed to cool. Jackhammers are used to crack the hardened sulfur. The sulfur rock is removed and placed into

55-gallon steel drums. This waste is then shipped off-site by flatbed truck to a landfill for disposal.

Date of Startup:

1976.

Date of Closure:

This unit is currently inactive. It is only active when the sulfur pits or vessels are being cleaned or serviced.

Wastes Managed:

Sulfur scrap.

Release Controls:

This unit is outdoors. The unit sits on gravel covered soil. No secondary containment exists.

History of Release:

No releases have been documented at this unit.

Observations:

The unit looked sound. Powdered sulfur product on the graveled covered soil was noted in two areas near the unit.

**SWMU 8** 

Storage Treatment Tanks

Unit Description:

This unit consists of 6 gravel-covered earthen diked fields with six 5,100-barrel tanks (Photos 7 and 8). These tanks, #61 through #66, are part of the Wastewater Treatment Plant (SWMU 19). All skimmed oil and oily sludges are pumped to the #60s tanks from the API separators, Tank #59 and the DAF unit for further treatment and/or storage. Tank #66 is a Sludge Tank (Clark, 1990). Tanks #63 and #65 (SWMU 8) are oil water separator tanks. Since each type of oil has a different specific gravity many different layers of oil are formed. Solids settle at the bottom with water lying directly above. The oils are piped back to the Refinery Process Area for reuse. The water is sent back to the overflow pit and the cycle restarts. The sludge is pumped to Tank #66. All Wastewater Treatment sludges are RCRA listed wastes because of possible high levels of chromium and lead constituents. These sludges are removed off-site within 90 days of generation and used for fuel blending.

Date of Startup:

1968.

Date of Closure:

These units are currently active.

Wastes Managed:

DAF float/K048, API separator sludge/K051, Slop oil emulsion

solids/K049, waste oil, wastewater.

Release Controls:

These units are outdoors. The units have a earthen floor. A dike surrounds each #60s Tank. Each gravel-covered earthen dike is 5 feet high and has a secondary containment capacity of 37,500 barrels (Clark,

1990).

History of Release:

No releases have been documented for this unit.

Observations:

The treatment tanks appeared to be in sound condition. The soil was stained extensively at the pipeline connection from Tank #66 on the outside of the west dike. This connection is used to vacuum pump sludge from Tank #66 into tanker trucks. A 20-gallon sampling dip pan was sighted on the ground next to this connection filled with what appeared to be oily sludge. Empty sample cans were also observed.

SWMU 9

Former Container Storage Treatment Area

Unit Description:

In Clark's Hazardous Waste Part A Permit Application a map was provided showing that this unit was a container storage treatment area. (Photo 9) (Clark, 1980b). Facility representatives claim that this unit never existed. The unit is of unknown size.

Date of Startup:

Unknown.

Date of Closure:

This unit is currently inactive. The date that use was discontinued is

unknown.

Wastes Managed:

Unknown.

Release Controls:

Unknown.

History of Release:

No releases have been documented at this former unit.

Observations:

No evidence of this unit exists. This unit is currently a gravel covered soil

area.

**SWMU 10** 

Former Container Storage Treatment Area

Unit Description:

In Clark's Hazardous Waste Part A Permit Application a map was provided showing that this unit was a container storage treatment area (Clark, 1980b). Facility representatives claim that this unit never existed.

The former unit is of unknown size.

Date of Startup:

Unknown.

Date of Closure:

This unit is currently inactive. The date that use was discontinued is

unknown.

Wastes Managed:

Unknown.

Release Controls:

Unknown.

History of Release:

No releases have been documented at this unit.

Observations:

No evidence of the former storage area exists. The unit is located in the current vicinity of the southern edge of Tank #52's diked area.

SWMU 11

Former Container Storage Treatment Area

Unit Description:

In Clark's Hazardous Waste Part A Permit Application a map was provided showing that this unit was a container storage treatment area (Clark, 1980b). Facility representatives claim that this unit never existed. The former unit is of unknown size.

Date of Startup:

Unknown.

Date of Closure:

This unit is currently inactive. The date that use was discontinued is

unknown.

Wastes Managed:

Unknown.

Release Controls:

Unknown.

History of Release:

No releases have been documented at this unit.

Observations:

No evidence of this former storage area exists. This unit is located in the current vicinity of the northeastern corner of BTL Industries' Chemical Plant. RAI was unable to view this area since it was on BTL Industries

property.

**SWMU 12** 

Former Storage Treatment Tank

Unit Description:

In Clark's Hazardous Waste Part A Permit Application, a map was provided showing that this unit was a storage treatment tank (Clark, 1980b). Facility representatives claim that this unit never existed. The former unit is of unknown size.

Date of Startup:

Unknown.

Date of Closure:

This unit is currently inactive. The date that use was discontinued is

unknown.

Wastes Managed:

Unknown.

Release Controls:

Unknown.

History of Release:

No releases have been documented at this unit.

Observations:

No evidence of the treatment tank exists. The approximate location of this former unit houses Tank #76, a 15,500-barrel gas blend tank in

sound condition (Photo 10).

**SWMU 13** 

Former Drum and Waste Storage Area

Unit Description:

In Clark's Hazardous Waste Part A Permit Application, a map was provided showing that this unit was a drum and waste storage area (Photo 11) (Clark, 1980b). Facility representatives claim that this unit never existed. The unit is of unknown size.

Date of Startup:

Unknown.

Date of Closure:

This unit is currently inactive. The date that use was discontinued is

Wastes Managed:

Unknown.

unknown.

Release Controls:

Unknown.

History of Release:

No releases have been documented at this unit.

Observations:

No evidence of the former storage area exists. The approximate location of this former unit is in the northwest corner of BTL Industries' property. Currently, an empty gravel-covered soil area was observed through the fence between Clark Corporation's Blue Island Terminal and the BTL facility.

SWMU 14

Former Container Storage Area

Unit Description:

In Clark's Hazardous Waste Part A Permit Application, a map was provided showing that this unit was a container storage area (Photo 12) (Clark, 1980b). Facility representatives claim that this unit never existed. The unit is of unknown size.

Date of Startup:

Unknown.

Date of Closure:

This unit is currently inactive. The date that use was discontinued is

unknown.

Wastes Managed:

Unknown.

Release Controls:

Unknown.

History of Release:

No releases have been documented at this former unit.

Observations:

No evidence of the former storage area exists. The approximate location of this former unit is under the control of Clark Blue Island Terminal.

**SWMU 15** 

Former Container Storage Area

Unit Description:

In Clark's Hazardous Waste Part A Permit Application, a map was provided showing that this unit was a container storage area (Photo 13) (Clark, 1980b). Facility representatives claim that this unit never existed.

The unit is of unknown size.

Date of Startup:

Unknown.

Date of Closure:

This unit is currently inactive. The date that use was discontinued is

unknown.

Wastes Managed:

Unknown.

Release Controls:

Unknown.

History of Release:

No releases have been documented at this former unit.

Observations:

No evidence of this former storage area exists. The approximate location of this unit is at the northern property boundary of Clark Corporation's Blue Island Terminal. Currently, the location of the former storage area

houses former electrical connections for a former flare unit. This flare unit was moved into BTL Industries property when Clark sold the property.

**SWMU 16** 

Former Waste Pile Area

Unit Description:

In Clark's Hazardous Waste Part A Permit Application a map was provided showing that this unit was a past waste pile area (Photo 13) (Clark, 1980b). Facility representatives claim that this unit never existed. The unit is of unknown size.

Date of Startup:

Unknown.

Date of Closure:

This unit is currently inactive. The date that use was discontinued is

Wastes Managed:

Unknown.

unknown.

Release Controls:

Unknown.

History of Release:

No releases have been documented at this unit.

Observations:

No evidence of the former storage areas exists. The approximate location of this former unit is at the northwestern corner of Clark Corporation's Blue Island Terminal property. Currently, the location of the former storage areas houses electrical connections for a former flare unit. This flare unit was moved into BTL Industries property when Clark sold the property.

**SWMU 17** 

Former Waste Piles and Impoundment Area

Unit Description:

In Clark's Hazardous Waste Part A Permit Application a map was provided showing that this unit was a past waste pile and impoundment area (Photo 14) (Clark, 1980b). Facility representatives claim that this unit was never an impoundment. The representative did state that the

unit was once used for construction waste piling. The size of the unit is approximately 3 acres.

Date of Startup:

Unknown.

Date of Closure:

This unit is currently inactive. The date that use was discontinued is

unknown.

Wastes Managed:

Unknown.

Release Controls:

Unknown.

History of Release:

No releases have been documented at this unit.

Observations:

The approximate location of this former storage area is an empty field at the northern portion of land behind the Northwest Crude Tank Field.

Some evidence of construction debris exists. There is no vegetation on this unit, although the area around this unit resembles a touch of prairie.

**SWMU 18** 

Former Impoundment Area

Unit Description:

In Clark's Hazardous Waste Part A Permit Application, a map was provided showing that this unit was a past impoundment area (Photo 15) (Clark, 1980b). Facility representatives claim that this unit was never an impoundment.

Date of Startup:

Unknown.

Date of Closure:

This unit is currently inactive. The begin date of inactivity is unknown.

Wastes Managed:

Unknown.

Release Controls:

Unknown.

History of Release:

No releases have been documented at this former unit.

Observations:

No evidence of this former unit exists. The approximate location of this former unit is at the northwestern corner of Tank #805's diked area in the Northwest Crude Tank Field.

**SWMU 19** 

Wastewater Treatment System

Unit Description:

Most of the wastes generated at the Clark facility are produced from the Wastewater Treatment System. All of the refining processes release wastewater. This wastewater enters the Wastewater Treatment System through dozens of drains (Photo 16). These steel drains lead to a vast pipeline system connected throughout the whole facility. Eleven electric sump pumps pump the wastewater to the Wastewater Treatment Area in the Southwest Crude Tank Field (Photo 17) (Clark, 1990). Some of this wastewater is treated in an alkylation neutralization pit before being pumped to the Wastewater Treatment Area (Photo 18). This pit is concrete lined. After it reaches the Wastewater Treatment Area, it is pumped into the above ground steel 5,100-barrel Tank #59 (Photo 19). If the volume of wastewater is greater than the volume that Tank #59 can hold, the wastewater overflows into a 72,000-gallon pit (Photo 20) (Clark, 1991d). This pit is made of concrete and is pitched to one side. As the wastewater settles in Tank #59, the oil floats to the top. The oil is pumped to one of two in-ground API oil water separators. The oil wastewater is settled allowing for oil to float on top and the sludge to collect on the bottom. The oil is then pumped to the #60s Storage Treatment Tanks (SWMU 8) for further processing. The water from both Tank #59 and the API oil water separator (Photos 21 and 22) are pumped into the DAF unit (Photo 23) which saturates the wastewater with air bubbles causing the oil to float to the top of the unit. The oil is skimmed off and pumped back to #60s Storage Treatment Tanks (SWMU 8). The water is drained into the Metropolitan Water Reclamation District Sewer System. A discharge flow meter exists at this point (Photo 24). The sludge (K051) material is vacuum pumped to Tank #66 (SWMU 8). Overflow pit sludge bottoms are also vacuum pumped to Tank #66. Tank #66 is a 5,100-barrel Sludge Tank (Clark, 1990). Tanks #63 and #65 (SWMU 8) are oil water separator tanks that operate like Tank #59. Since each type of oil has a different specific gravity, many different layers of oil are formed. Solids settle at the bottom with water lying directly above. The oils are piped back to the Refinery Process Area for reuse. The water is sent back to the overflow pit. The sludge went to Tank #66. All Wastewater Treatment sludges are RCRA listed wastes because of possible high levels of chromium and lead constituents. These sludges are removed off-site and used for fuel blending.

Date of Startup:

1968.

Date of Closure:

This unit is currently active.

Wastes Managed:

DAF float/K048, API separator sludge/K051, Slop oil emulsion solids/K049, waste oil, wastewater.

Release Controls:

The electric sumps are concrete walled. Tank #59 has a earthen floor. A dike surrounds it and Asphalt Tank #51. The dike is a gravel covered earthen 5-foot high dike with a secondary containment capacity of 85,000 barrels (Clark, 1990). The overflow pit, DAF unit, and the API separator pits are all concrete walled.

History of Release:

No releases have been documented at this unit.

Observations:

All tanks appeared sound and no signs of release were noted.

SWMU 20

Asbestos Satellite Accumulation Areas

Unit Description:

These 10-foot by 40-foot areas accumulate and store asbestos waste from insulation removal processes. The material is wrapped in plastic before placement in a roll-off box. These units are site specific. When the abatement process is finished the unit will be permanently removed.

Date of Startup:

1978.

Date of Closure:

These units are currently inactive. This waste stream only occurs when

insulation replacement is performed.

Wastes Managed:

Asbestos.

Release Controls:

The asbestos is plastic wrapped. The roll-off box is made of steel and is

kept sealed when waste is not being added to it.

History of Release:

No releases have been documented from these inactive units.

Observations:

No evidence of these inactive units currently exists.

**SWMU 21** 

Spent Catalyst Satellite Accumulation Areas

Unit Description:

These 3-foot by 3-foot areas accumulate and store spent catalyst fines in 55-gallon steel drums in various locations throughout the gasoline product process. These catalysts fines are sent off-site for reprocessing.

Date of Startup:

Before 1964.

Date of Closure:

This units are currently active.

Wastes Managed:

Spent catalyst fines.

Release Controls:

The units are situated on gravel-covered soil or cement pavement.

History of Release:

No releases have been documented at these units.

Observations:

One 55-gallon steel drum was observed in sound condition. No evidence

of release were observed.

#### **SWMU 22**

#### Water Treatment Plant for Boilers

Unit Description:

This unit consists of a water treatment system, a boiler, and a cooling tower. The cooling tower unit is 300-foot by 100-foot and is used to cool heated boiler water (Photo 25). All three of these units are located near the north property boundary in the Refinery Process Area. Calumet Sag Channel water is pumped into the unit. This water is treated with water softeners. The water is used as once-through cooling waters. The water is then pumped into the cooling tower unit. Cooling tower basin sludge is generated from this process. This sludge is pumped into a Wastewater Treatment System (SWMU 19) sewer. The once-through cooling water is pumped into the Metropolitan Water Reclamation District Sewer System.

Date of Startup:

Before 1964.

Date of Closure:

These units are currently active.

Wastes Managed:

Cooling tower sludge, wastewater.

Release Controls:

These units are located outdoors. The cooling tower basin has a single unit concrete floor and berm. The berm is 1-foot high and 6-inches wide. These units have several wastewater drains.

History of Release:

No releases have been documented at these units.

Observations:

All units seemed to be in sound condition. The berm and cooling tower exterior wall showed signs of sludge splattering. Also noted was a unknown chemical deposit on the ground next to this cooling tower. The facility representative indicated that the deposit is caustic connected to the cooling tower process, although it lies beneath a sulfuric acid product tank.

#### 4.0 AREAS OF CONCERN


RAI identified 2 AOCs during the PA/VSI. These are discussed below.


#### AOC 1 Asphalt Tank

During the VSI, ponding of an oily substance was observed at the base of Tank #51 (Photo 26). This unit is a 80,600-barrel asphalt product tank located in the Southwest Crude Tank Field. The Calumet Sag Channel forms Clark's southern boundary for this tank field. This unit has an earthen floor. A 5-foot gravel-covered earthen dike with a secondary containment capacity of 85,000 barrels surrounds this unit and Wastewater Storage Treatment Tank #59. This area is an AOC because contamination of soil was observed and no sampling or remediation has been conducted.

#### AOC 2 Underground Fuel Product Storage Tanks

This unit consists of two 4,000-gallon underground metal bulk storage tanks (UST) for dispensing regular (leaded) and unleaded gasoline to company vehicles (Clark, 1990). These USTs are located in the Southwest Crude Tank Field. According to facility representatives, these USTs were installed in the early 1970s. Since the USTs are approximately 20 years old and there is no secondary containment, leakage of the product may be occurring. This area is an AOC because the aged USTs may be releasing gasoline product to the soil.





#### 5.0 CONCLUSIONS AND RECOMMENDATIONS

The PA/VSI identified 22 SWMUs and 2 AOCs at the Clark facility. Background information on the facility's location, operations, waste generating processes, release history, regulatory history, environmental setting, and receptors is presented in Section 2.0. SWMU-specific information (such as the unit's description, dates of operation, wastes managed, release controls, release history, and observed condition) is discussed in Section 3.0. The AOCs are discussed in Section 4.0. Following are RAI's conclusions and recommendations for each SWMU and AOCs. Table 3 identifies the SWMUs and AOCs at the Clark facility and suggested further actions.

SWMU 1

Outdoor Drum Storage Area

Conclusions:

This outdoor unit stores hazardous and special waste, as well as asphalt product in steel 55-gallon drums. The waste is stored for less than 90 days per current company policy. Three drums of TCA (F001) and 1 drum of PCB-contaminated oil (special) were observed in sound condition on a plastic pallet. Some stains were noted on the concrete floor. The threat of release via various pathway is summarized below.

Ground Water: Low. The barrels of waste are situated on a plastic pallet on cement pavement. A release can be contained before it has the opportunity to enter the ground water.

Surface Water: Low. A release can be contained before it has the opportunity to reach the nearest surface water (1/2 mile south).

Air: Low. Although TCA is a volatile chemical, the spent TCA is sealed in sound 55-gallon steel drums on a plastic pallet located on cement pavement. Thus the potential threat of release is low.


On-Site Soil: Low. The barrels of waste are situated on a plastic pallet on cement pavement. A release can be contained before it has the opportunity to enter the on-site soil.

Recommendations:

No further action is recommended at this time.



# TABLE 3 SWMU AND AOC SUMMARY



	<u>SWMU</u>	Operational Dates	Evidence of Release	Recommended Further Action
1.	Outdoor Drum Storage Area	1990 to present	Concrete Floor Stained	No further action at this time.
2.	Sampled Product Waste Accumulation Storage Area	Before 1964 to present	None	No further action at this time.
3.	Cooling Tower Units	Before 1964 to present	None	No further action at this time.
4.	Bundle Cleaning Pad Storage Tank Area	Mid 1970s to Present	None	No further action at this time.
5.	Former Satellite Accumulation Storage Area	1981	None	No further action at this time.
6.	Former Satellite Storage Area	1981	None	No further action at this time.
7.	Satellite Accumulation Storage Area	1976 to present	Powdered sulfur found on on-site soil	No further action at this time.
8.	Storage Treatment Tanks	1968 to present	Soil Staining	Soil should be sampled for petroleum product contamination.
9.	Former Container Storage Treatment Area	Unknown	Unknown	No action at this time, pending further information.
10.	Former Container Storage Treatment Area	Unknown	Unknown	No action at this time, pending further information.
11.	Former Container Storage Treatment Area	Unknown	Unknown	No action at this time, pending further information.
12.	. Former Storage Treatment Tank	Unknown	Unknown	No action at this time, pending further information.




### TABLE 3 (continued)

# ENFORCE SENT CONFIDENTIAL

### SWMU AND AOC SUMMARY

	SWMU	Operational Dates	Evidence of Release	Recommended Further Action
13.	Former Drum and Waste Storage Area	Unknown	Unknown	No action at this time, pending further information.
14.	Former Container Storage Area	Unknown	Unknown	No action at this time, pending further information.
15.	Former Container Storage Area	Unknown	Unknown	No action at this time, pending further information.
16.	Former Waste Pile Area	Unknown	Unknown	No action at this time, pending further information.
17.	Former Waste Pile and Impoundment Area	Unknown	Unknown	No action at this time, pending further information.
18.	Former Impoundment Area	Unknown	Unknown	No action at this time, pending further information.
19.	Wastewater Treatment Plant	1968	None	Soil and ground water should be tested for petroleum contamination.
20.	Asbestos Satellite Accumulation Storage Areas	1978	None	No further action at this time.
21.	Spent Catalyst Satellite Accumulation Storage Areas	Before 1964	None	No further action at this time.
22.	Water Treatment Plant for Boilers	Before 1964	Sludge splat- tering, unknown deposit on ground exterior to cooling tower basin	Deposit should be tested for caustic contamination



## TABLE 3 (continued)

# ENFORCEMENT CONFIDENTIAL

## SWMU AND AOC SUMMARY

	<u>AOC</u>	Operational Dates	Evidence of Release	Recommended Further Action
1.	Asphalt Tank	About 1970	Oil contam- inated soil	The soil and ground water should be sampled for petroleum contamination
2.	Fuel Product Under- Storage Tanks	About 1970	Possible fuel leakage	The soil and ground water should be sampled for petroleum contamination. The USTs should be tested for integrity.

SWMU 2<sup>1</sup> Sampled Pr

ENFORCEMENT COMPRESSIVAL

#### Sampled Product Waste Accumulation Areas

Conclusions:

These outdoor units are used to collect drippage and overflow product sampling fluids in 35-gallon steel drums. The waste is stored for less than 90 days per current company policy. The drums are situated on circular metal pallets on cement flooring. The threat of release via various pathways is summarized below.

Ground Water: Low. The waste is in sound 35-gallon steel lidded drums on metal pallets situated on cement pavement. A release can be contained before it has the opportunity to enter the ground water.

Surface Water: Low. A release can be contained before it has the opportunity to reach the nearest surface water (1/2 mile south).

Air: Low. Although some of the petroleum product sample waste may be volatile, the drums are lidded. Thus, the potential release to air is low.

On-Site Soil: Low. Some very minor cracking in the cement pavement was noted. The waste itself is stored and accumulated in sound 35-gallon steel drums on metal pallets. The drums are lidded. Any release can be contained before it has the opportunity to enter the soil.

Recommendations:


No further action is recommended at this time.


SWMU 3

Cooling Tower Units

Conclusions:

These units cool heated process water. Nonhazardous sludge is generated. Before 1988 it was removed and disposed at a landfill. Currently it is power-washed into the wastewater sewer. The sludge collecting basins have a single unit concrete floor and berm. The units appeared to be in sound operating condition. The threat of release via various pathways is summarized below.





Ground Water: Low. The units have adequate secondary containment via the foot high berms and wastewater drains. A release can be contained before it has the opportunity to enter the ground water.

Surface Water: Low. A release can be contained before it has the opportunity to reach the surface water (3/4 miles south).

Air: Low. The non-volatile nature of the waste in this unit does not pose a threat of release to air.

On-Site Soil: Low. Any release can be contained via the foot high berms and wastewater sewers, before it has the opportunity to enter the soil.

Recommendations:

No further action is recommended at this time.

SWMU 4

**Bundle Cleaning Pad** 


Conclusions:

This outdoor unit manages the cleaning of heat exchange bundles. The resulting sludge waste is K050 and RCRA listed for chromium and lead constituents. The concrete pad is pitched shallowly to a trench which leads to a wastewater chain. Both the sludge and wastewater are power-washed into the sewer. The pad is bermed on three sides. The threat of release via various pathways is summarized below.

Ground Water: Low. This unit is a concrete slab which is pitched toward a wastewater sewer and trench. Although the unit is only bermed on three sides. A release can be contained before it has the opportunity to enter the ground water, since the concrete slab is pitched away from the unbermed side.

Surface Water: Low. Any release can be contained before it has the opportunity to reach the nearest surface water (3/4 mile south).

Air: Low. The non-volatile nature of the waste in this unit does not pose a threat of release to air.



On-Site Soil: Low. Although the unit is only bermed on three sides the concrete pad is pitched toward a wastewater trench and wastewater sewer. Thus a release can be contained before it has the opportunity to enter the ground water.

Recommendations:

No further action is recommended at this time.

SWMU 5

Former Satellite Accumulation Area

Conclusions:

This unit was used for the accumulation and storage of hazardous leaded tank bottoms (K052) waste from Crude Tank #46. The waste was stored in a plastic lined roll-off box on an earthen floor within a diked area. The unit was moved to the dike area surrounding Crude Tank #801. The unit has not been formally closed. The threat of release via various pathways is summarized below.

Ground water: Low. The waste was stored in a plastic lined roll-off box on an earthen floor within a diked area. A release could have been contained before it had the opportunity to enter the ground water. Currently, the unit is empty and inactive; thus no threat exists.

Surface water: Low. A release could have been contained before it had the opportunity to reach the nearest surface water (1/4 mile north). Currently, no threat exists since the unit is inactive.

Air: Low. Due to the inert nature of the waste, the potential of release would have been low. Currently, no threat exists since the unit is inactive.

On-site soil: Low. Due to the inert nature of the waste, the potential of release would have been low. Currently, no threat exists since the unit is inactive.

Recommendations:

No further action is recommended at this time.

SWMU 6

Former Storage Area

Conclusions:

This unit was used for the storage of hazardous leaded tank bottoms (K052) waste from the Crude Tank #46. The waste was stored in a plastic lined roll-off box on an earthen floor within a diked area surrounding Crude Tank #801. The waste was removed in 1981. The unit has not formally been closed. The threat of release via various pathways is summarized below.

Ground water: Low. The waste was stored in a plastic-lined roll-off box on an earthen floor within a diked area. A release could have been contained before it had the opportunity to enter the ground water. Currently, the unit is empty and inactive; thus no threat exists.

Surface water: Low. A release could have been contained before it had the opportunity to reach the nearest surface water (1/2 mile south). Currently, no threat exists since the unit is inactive.

Air: Low. Due to the inert nature of the waste, the potential of release would have been low. Currently, no threat exists since the unit is inactive.

On-site soil: Low. Due to the inert nature of the waste, the potential of release would have been low. Currently, no threat exists since the unit is inactive.

Recommendations:

No further action is recommended at this time.


50 ·

SWMU 7

Satellite Accumulation Area

Conclusions:

This unit accumulates and stores waste sulfur in 55-gallon steel drums. It is generated from cleaning sulfur pits and vessels associated with the desulfurization process. This unit is currently inactive. It is only activated when the sulfur pits or vessels are being cleaned or service. This unit is situated on gravel-covered soil. The unit appeared to be in sound condition. The threat of release via various pathways is summarized below.



Ground water: Low. Since the scrap sulfur is a solid and in an inert form, it poses no threat to the ground water.

Surface water: Low. Since the scrap sulfur is a solid and in an inert form, it poses no threat to the surface water.

Air: Low. Since the scrap sulfur is an inert form, it poses no threat to the air. On-site soil: Low. Since the scrap sulfur is an inert form, it poses no threat to the on-site soil.

Recommendations:

No further action is recommended at this time.

SWMU 8


Storage Treatment Tanks

Conclusions:

This unit consists of 6 wastewater treatment storage tanks. Tanks #63 and #65 are oil water separator units. Tank #66 is a sludge storage tank which manages DAF float (K048), API separator sludge (K051), and slop oil emulsion solids (K049). These wastes are RCRA listed since all of them have a potential for high levels of chromium and lead. These six tanks are in sound condition. Each has an earthen floor and a 5-foot high earthen dike. The pipeline connection from Sludge Tank #66 to tanker trucks showed evidence of leakage onto the soil. Heavy soil staining was noted. A full sampling dip pan was also noted. These units were installed in the late 1960s. The threat of release via various pathways is summarized below.

Ground water: Moderate. Although the treatment tanks appear to be in sound condition, and have sound lateral secondary containment (earthen dikes), there is a moderate potential for ground water contamination. The floor of each diked area is earthen. Thus, the floor does not serve as secondary containment for vertical movement. If a release did occur, it would be prevented from spreading laterally but not necessarily vertically. Hence if the soil becomes saturated with large amounts of oil, it is moderately possible for the ground water also to be contaminated. The age of the tanks suggest that releases may have occurred in the past, although none have been documented.





Surface water: Low. A release can be contained by the earthen dikes before it has the opportunity to reach the nearest surface water (1/2 mile south).

Air: Low. The nature of the waste in this unit does not pose a threat of release to the air.

On-site soil: High. Due to the age of the tank field and the lack of adequate vertical secondary containment there is a high potential for release to on-site soil. On-site soil appears to be contaminated at the pipeline connection used for Tank #66 sludge removal.

Recommendations:

RAI recommends that each tank field be sampled for petroleum product contamination in both the on-site soil and the underlying ground water. RAI also recommends that the soil near the pipeline connection be tested, and if a verification is made that the soil staining is a result of a petroleum release, remediate the area.

#### SWMU 9

#### Former Container Storage Treatment Area


Conclusions:


This unit was shown in Clark's Hazardous Waste Part A Permit Application's facility map. Facility representatives claim that this unit never existed. No information about wastes managed, exact location or history of release is known. Currently, the approximate location of the unit is an empty gravel-covered soil area near the Water Treatment System for Boilers (SWMU 22). The threat of release via various pathways is summarized below.

Ground water: Unknown. No information about wastes managed, exact location, or history of release is known.

Surface water: Unknown. No information about wastes managed, exact location, or history of release is known.

Air: Unknown. No information about waste managed, exact location, or history of release is known.

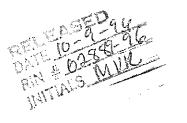



On-site soil: Unknown. No information about waste managed, exact location, or history of release is known.

Recommendations:

RAI recommends no further action at this time. If additional information regarding exact location, constituents managed, or potential release becomes available, testing may be indicated.

**SWMU 10** 

Former Container Storage Treatment Area

Conclusions:

This unit was shown in Clark's Hazardous Waste Part A Permit Application's facility map. Facility representatives claim that this unit never existed. No information about wastes managed, exact location, or history of release is known. Currently, the approximate location of this unit is in the vicinity of the southern edge of Tank #52's diked area. The threat of release via various pathways is summarized below.

Ground water: Unknown. No information about wastes managed, exact location, or history of release is known.

Surface water: Unknown. No information about wastes managed, exact location, or history of release is known.


Air: Unknown. No information about waste managed, exact location, or history of release is known.

On-site soil: Unknown. No information about waste managed, exact location, or history of release is known.

Recommendations:


RAI recommends no further action at this time. If additional information regarding exact location, constituents managed, or potential release becomes available, testing may be indicated.







#### Former Container Storage Treatment Area



Conclusions:

This unit was shown in Clark's Hazardous Waste Part A Permit Application's facility map. Facility representatives claim that this unit never existed. No information about wastes managed, exact location, or history of release is known. Currently, the approximate location of this unit is in the vicinity of the northeastern corner of BTL Industries' Chemical Plant.

Ground water: Unknown. No information about wastes managed, exact location, or history of release is known.

Surface water: Unknown. No information about wastes managed, exact location, or history of release is known.

Air: Unknown. No information about wastes managed, exact location, or history of release is known.

On-site soil: Unknown. No information about waste managed, exact location, or history of release is known.

Recommendations:

RAI recommends no further action at this time. If additional information regarding exact location, constituents managed, or potential release becomes available, testing may be indicated.


**SWMU 12** 

Former Storage Treatment Tank

Conclusions:

This unit was shown in Clark's Hazardous Waste Part A Permit Applications facility map. Facility representatives claim that this unit never existed. No information about wastes managed, exact location, or history of release is known. Currently, the approximate location of this unit houses Tank #76, a 15,500-barrel gas blend tank.

Ground water: Unknown. No information about wastes managed, exact location, or history of release is known.





Surface water: Unknown. No information about wastes managed, exact location, or history of release is known.

Air: Unknown. No information about waste managed, exact location, or history of release is known.

On-site soil: Unknown. No information about waste managed, exact location, or history of release is known.

Recommendations:

RAI recommends no further action at this time. If additional information regarding exact location, constituents managed, or potential release becomes available, testing may be indicated.

**SWMU 13** 

Former Drum and Waste Storage Area

Conclusions:

This unit was shown in Clark's Hazardous Waste Part A Permit Application's facility map. Facility representatives claim that this unit never existed. No information about wastes managed, exact location, or history of release is known. Currently, the approximate location of this unit is in the vicinity of the southern edge of Tank #52's diked area. The threat of release via various pathways is summarized below.

Ground water: Unknown. No information about wastes managed, exact location, or history of release is known.

Surface water: Unknown. No information about wastes managed, exact location, or history of release is known.

Air: Unknown. No information about waste managed, exact location, or history of release is known.

On-site soil: Unknown. No information about waste managed, exact location, or history of release is known.

Recommendations:

RAI recommends no further action at this time. If additional information regarding exact location, constituents managed, or potential release becomes available, testing may be indicated.

SWMU 14

Former Container Storage Area

Conclusions:

This unit was shown in Clark's Hazardous Waste Part A Permit Application's facility map. Facility representatives claim that this unit never existed. No information about wastes managed, exact location, or history of release is known. Currently, the location of this unit is under Clark Corporation's Blue Island Terminal.

Ground water: Unknown. No information about wastes managed, exact location, or history of release is known.

Surface water: Unknown. No information about wastes managed, exact location, or history of release is known.

Air: Unknown. No information about waste managed, exact location, or history of release is known.

On-site soil: Unknown. No information about waste managed, exact location, or history of release is known.

Recommendations:


RAI recommends no further action at this time. If additional information regarding exact location, constituents managed, or potential release becomes available, testing may be indicated.

**SWMU 15** 

Former Container Storage Area

Conclusions:

This unit was shown in Clark's Hazardous Waste Part A Permit Application's facility map. Facility representatives claim that this unit never existed. No information about wastes managed, exact location, or history of release is known. Currently, the location of the former unit houses former electrical connections for





a former flare at the northern property boundary of Clark Corporation's Blue Island Terminal.

Ground water: Unknown. No information about wastes managed, exact location, or history of release is known.

Surface water: Unknown. No information about wastes managed, exact location, or history of release is known.

Air: Unknown. No information about waste managed, exact location, or history of release is known.

Recommendations:

RAI recommends no further action at this time. If additional information regarding exact location, constituents managed, or potential release becomes available, testing may be indicated.

**SWMU 16** 

Former Waste Pile Area

Conclusions:

This unit was shown in Clark's Hazardous Waste Part A Permit Application's facility map. Facility representatives claim that this unit never existed. No information about wastes managed, exact location, or history of release is known. Currently, the approximate location of the unit is at the northwestern corner of Clark Corporation's Blue Island Terminal property. This area currently houses former electrical connections for a former flare unit.

Ground water: Unknown. No information about wastes managed, exact location, or history of release is known.

Surface water: Unknown. No information about wastes managed, exact location, or history of release is known.

Air: Unknown. No information about wastes managed, exact location, or history of release is known.

Recommendations:

RAI recommends no further action at this time. If additional information regarding exact location, constituents managed, or potential release becomes available, testing may be indicated.

**SWMU 17** 

Former Waste Piles and Impoundment Area

Conclusions:

This unit was shown in Clark's Hazardous Waste Part A Permit Application's facility map. Facility representatives claim that this unit was never an impoundment. The representatives did state that this area was once used for construction waste piling. Currently, this former unit is an empty field without vegetation. Some evidence of construction debris exists. The vegetation is thriving outside the scope of this unit. The threat of release via various pathways is summarized below.

Ground water: Unknown. No information about wastes managed, exact location, or history of release is known.

Surface water: Unknown. No information about wastes managed, exact location, or history of release is known.

Air: Unknown. No information about wastes managed, exact location, or history of release is known.

On-site soil: Unknown. No information about wastes managed, exact location, or history of release is known.

Recommendations:


RAI recommends no further action at this time. If additional information regarding exact location, constituents managed, or potential release becomes available, testing may be indicated.

**SWMU 18** 

Former Impoundment Area

Conclusions:

This unit was shown in Clark's Hazardous Waste Part A Permit Application's facility map. Facility representatives claim that this unit was never an impoundment. The representatives did state that this area was used for



construction waste piling Currently, the approximate location of this unit is at the northwestern corner of Tank #805's diked area in the Northwest Crude Tank Field.

Ground water: Unknown. No information about wastes managed, exact location or history of release is known.

Surface water: Unknown. No information about wastes managed, exact location, or history of release is known.

Air: Unknown. No information about waste managed, exact location, or history of release is known.

On-site soil: Unknown.

Recommendations:

No further action is recommended at this time.


**SWMU 19** 


Wastewater Treatment System

Conclusions:


This system treats all wastewater at the facility. The system includes hundreds of drains; a split storm water/wastewater pipeline system; an overflow pit; Tank #59, a oil water separator; a DAF unit, and an alkylation neutralization pit. All units appeared to be in sound condition. All sub-units of the Wastewater Treatment System have sound secondary containment except for Tank #59. Tank #59 has no vertical secondary containment since the field floor is earthen. Thus, any release to the field would result in soil contamination. The tank was installed in the late 1960's. All units in this system are situated from 1 block to 3/4 mile north of the Calumet Sag Channel. The threat of release via various pathways is summarized below.

Ground water: Moderate. The vertical secondary containment of Tank #59 is inadequate. A release to the soil would have a moderate potential to leach into the ground water for this reason. Also due to the age of the tank, past releases might have occurred or are currently occurring. All other units have adequate





SELECTION SECONDARY CONTAINMENT that would



secondary containment that would contain a release before it had an opportunity to enter ground water.

Surface water: Low to Moderate. Most units within the Wastewater Treatment System have adequate secondary containment except for Tank #59. Releases from these units can be contained before it has the opportunity to reach surface water (1 block to 3/4 miles south). Tank #59 has inadequate vertical secondary containment. Future releases will pollute the soil and ground water. Since Tank #59 is within 1 block of the channel, it is moderately possible that surface water may be come contaminated.

Air: Moderate to High. Both API separator and the Overflow pit are exposed to air. Vapor inhalation may have harmful effects to health. The waste are volatile in nature. Therefore the potential threat to air is moderate to high.

On-site soil: Low to High. All units except Tank #59 have adequate secondary containment that could prevent a release from reaching on-site soil. Therefore the potential threat to on-site soil is low. However Tank #59 has inadequate secondary containment. The potential threat to on-site soil is high since soil contamination occurs instantly after a release.

Recommendations:

RAI recommends soil and ground water sampling be performed around Tank #59 to determine if releases have occurred in the past or are presently occurring as a result of age of the tank and lack of secondary containment.

**SWMU 20** 


#### Asbestos Satellite Accumulation Areas

Conclusions:

These units accumulate and store asbestos waste in steel roll-off boxes at various locations throughout the facility during pipe insulation removal and replacement. These units are currently inactive. These units are only activated when pipeline insulation replacement process are instigated. The threat of release via various pathways is summarized below.

Ground water: Low. The nature of the waste in these units does not pose a threat of release to ground water.





Surface water: Unknown. No information about wastes managed, exact location, or history of release is known.

Air: Moderate. Asbestos fibers are carcinogenic. When asbestos insulation is removed, there is a moderate potential for release of fibers into the air. This waste is then plastic wrapped before placement into the roll-off box.

On-site soil: Low. The nature of the waste in these units does not pose a threat of release soil.

Recommendations:

No further action is recommended at this time.

**SWMU 21** 

Spent Catalyst Satellite Accumulation Areas

Conclusions:

These units accumulate spent catalyst fines in 55-gallon steel drums at various locations throughout the facility. The units are situated on gravel-covered soil or cement pavement. The waste is removed within 90 days per current company policy. The threat of release via various pathways is summarized below.

Ground water: Low. The nature of the waste in these units does not pose a threat of release to ground water.

Surface water: Unknown. No information about wastes managed, exact location, or history of release is known.

Air: Low. Although these catalyst fines may be toxic by inhalation, the drums are sealed and are in sound condition. Hence the potential threat to air is low.

On-site soil: The nature of the waste in this unit does not pose a threat of release to ground water.

Recommendations:

No further action is recommended at this time.

#### SWMU 22

#### Water Treatment Plant for Boilers

This unit treats channel water before and after its use as once-through cooling water for cooling the facility's boilers. These sub-unit consists of a water treatment system, a cooling tower, and a boiler. The units appeared to be in sound condition. Sludge splattering was noted on a cooling tower basin berm and exterior wall. Also noted was an unknown deposit on the ground next to this cooling tower. The facility representative indicated that it was lime, although it lie beneath a sulfuric acid product tank. The units have secondary containment in the form of berms.

Ground water: Low. The nature of the waste in this unit does not pose a threat to ground water since a release can be contained before it has the opportunity to enter the ground water.

Surface water: Low. A release can be contained before it has the opportunity to reach the nearest surface water (3/4 mile south).

Air: Low. The nature of this waste in this unit does not pose a threat to air.

Oil-site soil: Low. Any release can be contained before it has the opportunity to enter the soil. However, if deposit located next to cooling tower on ground is something other than lime, a potential release to on-site soil may occur.

Recommendations:

Soil sampling is recommended to test deposit found on ground next to cooling unit.

#### AOC 1

#### Asphalt Tank


Conclusions:

During the VSI an oily substance was observed at the base of Tank #51. This unit is a 80,600-barrel asphalt product tank. This unit has a earthen floor.

Recommendations:

RAI recommends that soil and ground water sampling be performed for petroleum contamination.







AOO 2 10 9 QUnderground Fuel Product Storage Tank


Conclusions:

This unit consists of two 4,000-gallon underground metal bulk storage tanks (UST) for dispensing regular (leaded) and unleaded gasoline to company vehicles. These UST were installed in the early 1970s. Since the USTs are approximately 20 years old and they have no secondary containment, leakage of the product may be occurring.

Recommendations:

RAI recommends that soil and ground water be sampled for petroleum contamination and that the two tanks be tested for integrity.





#### REFERENCES

- Bergstrom, R.E., J.W. Foster, L.F. Selkregg, and W.A. Pryor, 1955. "Ground Water Possibilities in Northeastern Illinois". Illinois State Geological Survey Circular 198; Urbana, Illinois.
- Clark Oil and Refining Corporation Clark (Clark), 1972. Application for Permit for Treatment Worksor Wastewater Sources, October 24.
- Clark, 1974. Letter from William H. Busch, IEPA, to Robert H. Bruggink, Clark, re: Inadequate renewal of operating permit, October 31.
- Clark, 1980a. Notification of Hazardous Waste Activity, August 13.
- Clark, 1980b. RCRA Part A Permit Application, November 17.
- Clark, 1981. IEPA Special Waste Disposal Application, August 24.
- Clark, 1983. Letter from John T. Bernbom, Clark, to Andrew Vollmer, IEPA, re: request to modify Part A permit, August 2.
- Clark, 1985a. Letter from John Bernbom, Clark, to Karl Klepitsch, EPA, to requesting withdrawal of Part A Permit application, January 10.
- Clark, 1985b. Letter from John Bernbom, Clark, to Arthur Kawatachi, IEPA, re: withdrawal of Part A Permit application, July 24.
- Clark, 1985c. Letter from John Bernbom to Valdus Adamkus, IEPA, requesting change in designation from a TSD facility to a generator only, October 8.
- Clark, 1988. Letter from John Bernbom, Clark, to Karl Klepitsch, Jr., IEPA requesting an Accumulation Period Time Extension and Withdrawal of RCRA Interim Status as TSD facility, July 15.
- Clark, 1989. IEPA 1988 Generator Annual Hazardous Waste Report, February 10.
- Clark, 1990. Spill Prevention Control and Countermeasure Plan, August.
- Clark, 1991a. 1990 Generator Annual Hazardous Waste Report, February 15.
- Clark, 1991b. Toxic Chemical Release Inventory, June 25.
- Clark, 1991c. Conversation between Stafford Jacques and Ronald Snook, Clark, and Scott R. Tajak, RAI, re: visual site inspection, August 21.
- Clark, 1991d. Letter from Ronald D. Snook, Clark, to Scott Tajak, RAI, re: information requested during visual site inspection including chemical plant permits and process maps, August 28.
- Clark, 1991e. Conversation between Stafford Jacques, Clark, and Scott Tajak, RAI, re: information provided during the visual site inspection, September 19.
- Clark, 1991f. Conversation between Ronald Snook, Clark, and Scott R. Tajak, RAI, re: information requested during the visual site inspection, September 20.

- Clark, 1991g. Conversation between Ronald Snook, Clark, and Scott R. Tajak, RAI, re: information requested during the visual site inspection, September 23.
- Environmental Protection Agency (EPA), 1981. Acknowledgement of Notification of Hazardous Waste Activity verification, September, 28.
- EPA, 1984a. Letter from Karl Klepitsch to John Bernbom, Clark, acknowledging receipt of letter requesting withdrawal of Part A Hazardous Waste Permit application, January 27.
- EPA, 1984b. Letter from Karl Klepitsch, EPA, to John Bernbom, Clark, re: withdrawal of Part A Permit application request response, December 18.
- EPA, 1985a. Letter from Arthur S. Kawatachi, EPA, to John T. Bernbom, Clark, re: Permit Part A withdrawal request, June 12.
- EPA, 1985b. Letter from Arthur Kawatachi, EPA, to John Bernbom, Clark, acknowledging request for withdrawal of Part A Permit, June 19.
- Federal Emergency Management Agency (FEMA), 1983. National Flood Insurance Program, City of Chicago, Illinois, Cook and Du Page Counties.
- Hughes, G.M., P. Kraatz, and R.A. Landon, 1966. "Bedrock Aquifers of Northeastern Illinois". <u>Illinois State Geological Survey Circular 406</u>; Urbana, Illinois.
- Illinois Environmental Protection Agency (IEPA), 1981. Letter from William Busch, IEPA, to Clark reincomplete submission of the Part A Permit application, October 31.
- IEPA, 1982. RCRA Interim Status Standards Inspection report, May 7.
- IEPA, 1987a. Memorandum re: oil spill at Clark, April 25.
- IEPA, 1987b. DWPC Emergency Report: Field Operation Section, June 7.
- IEPA, 1988. Conversation record between Mary Nillanid, IEPA, and Rick Findley, IEPA re: on-site soil contamination at Clark, July 28.
- IEPA, 1989. RCRA Land Disposal Restriction Inspection Report, November 16.
- IEPA, 1990. Letter from Paul Dimock, IEPA, to John Bernbom, Clark, re: IEPA RCRA inspection, January 8.
- IEPA, 1991a. Letter from Robert Voss to Clark re: operator certification, May 6.
- IEPA, 1991b. Emission Inventory System: Permit, Source, Control and Stack List, May 13.
- Rand McNally, 1991. Rand McNally Chicago Tribune Streetfinder: Chicago and Vicinity.
- Ruffner, J.A. and E. Bair, eds., 1985. Weather of U.S. Cities, vol. 1; Gale Research Co., Detroit, Michigan.
- Ruffner, J.A. ed., 1985. Climates of the States, vol. 1; Gale Research Co., Detroit, Michigan.

- United States Department of Agriculture (USDA), 1979. "Soil Survey of DuPage and Part of Cook Counties, Illinois". <u>Illinois Agricultural Experimental Station Report No. 108</u>.
- United States Department of Commerce (USDC), 1968. Climatic Atlas of the United States. U.S. Printing Office, Washington, D.C.
- Willman, H.B., 1971. "Summary of the Geology of the Chicago Area". <u>Illinois State Geological Survey Circular #460</u>. Urbana, Illinois.

# ATTACHMENT A VISUAL SITE INSPECTION FIELD NOTES

CLARK OIL OF RELINING CORP. (CLARK)

BLUE ISLAND TERMINAL BLUE ISLAND REFINERY

THIS IS RUN AS SEPARATE

Blue Island Terminal-Clark oll Different Clark Division Control Terminal Loading Out of Stilous

MAY BE NOT

STILL CLARK'S PROPERTY LUADING PROPARE & OFFICE

BTL- 1985

Residences Some have been our by Clark SRT 9/21/91

	Jeh KPie			
2 2 2 0	- L			
2 5 0		7 37		
3 300		2 = -	3 7	
1 20	A 5 5	2		2 2
0 ¥0 ×	Se F	7 (0)	v 0 3 3	$\infty$
0 200		100		3 1
2 300			5 50 0	Z Z
LY ZZWI		2 2	S 50 00	2 2
<u> </u>			3 5 5	5
	Tale of	2 2 3 3	70	x 2 3
3 y 2 5 y 3			¥ 53 +	+ ± 2
SA STELL O		1 0 5 5	13 th	

Heavy Indusing to the West Heavy Industry - Then residential

Clark - No wells Firest Preserves ? Deep tennel Well Measuring Depth Mt. Greenwood IN Kreepitar tunnel Gresto Calement Plant

Pulaski · Pumps

WIRETON CREEK

electrical Substation is Edison. Is Clark

Unideaporated Cook Gounty
Only Pertions are in Alsip and Blue
Island

800 8/21/5/

			<del></del>
<del></del>	<u> </u>		
5		2 2	·-····
			1 1
	07		
·		i d	i i
		<u> </u>	
. <b>\</b>			<b>A</b>
	W V		
<del>-</del>			
<u>_</u>	# 1		\$ 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0
<del></del>	<u></u>	<del></del>	
	Q_ +	0 v3	0 0
	. 0	- '4	<u> </u>
	5 4	<del></del>	
:- <del></del> :- <del> </del>			
<u> </u>	<del></del>	3 53	6 3 3
	2 - P	Macuom (	13 2 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1
	7	<u> </u>	<del>- 3 - 5 - 4 - 4 - 4 - 4 - 4 - 4 - 4 - 4 - 4</del>
<u> </u>	7 2 2	5 35	
7 2	<u> </u>	<u> </u>	3 2 4 5
58 0	4 3 7	$\Delta$	3 500 0
			- 6 + + + + + + + + + + +
	1 2 2	カー・ダラセク	<del></del>
0 2 = 0 3 0 - 3	3 6 5		
		Fed The Fed Th	5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5
- 3 - 3 - 3 - 3 - 4	<del> </del>		
6 0 - 0 - v + r - 2		1	9 5 500
3333333		87	0 2 5 50 0
Series of the se		<del>- 57 2 - :</del>	<del>-1</del> 573 32 3
# 030 0 M 0 M 0	<del></del>	<u> </u>	- 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5
9) 1		5	5 - 5 - 5 - 5 - 5 - 5 - 5 - 5 - 5 - 5 -
Service Services		<b>√√</b> √	9 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5
		V / U	

Knock out Drums - water is drapped OFF gas line like a line dryer condensation

Desalfer-Remove Soits that may
cornede Pipe Hattelott
Waterfoil - Electric plates. Emulsion
15 broken up berween Has and

Oil wast water-not a high ph

FCC- fluid autalytic gracker.

FUEL BUS 15 Produced Burnes in CWN Heaters

C3 C4 Gas Sent to Alkalination

Factor of the Color ×

16/18/18/

FUEL GAS- MAY be sent to Desulfyrization Process before sheed aspedant Flash Drum - Volntile and they vaporized.

A Liquid is Firmed and CAN the Drained

D Stor 8/21/9/ Neutralized - Sudium Mybrokide AIKAIATE -TYPE OF GASSING Kneckouts-CoLescers HyproFlourie Acid Isomate Gassline Norman Butane AIKALATION Sewered Fuel GAS TSOMAX Mapiha Product I sowate **~**∂

Stewn Knackouts LPG Serubbers Desvituaizedinn Plant

Product Treated Firel Gass Used Far Durning on Site

Takes Fuel GAS Serubb out Julfur Open Drain Tank - Residuals Sumppump to oil wask water Drain Reused in Surgaton K

Secritake Straper Discharga 1) To Sewer 2) Must sont to Desalter and reusal

16/16/8

6

Process water Squeers Gran Refinely
Ondergrand to Tank STI

Ondergrand to Tank STI

Crection for Storn water Discharge

Nonder Thru County Had Cadule Grund
Storn water 38 3 Jung Cadule Grund
Storn water 38 3 Jung Cadule Grund
Storn water 438 3 Jung Cadule Grund
Storn water 538 3 Jung Cadule Grund
Storn water 538 3 Jung Cadule Grund
Storn water 538 3 Jung Cadule Grund
Storn water 59 Storn School Storn

Storn water 50 In Case of News 3 Jung Cadule Storn

Subserved tank Grund Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved tank Grund

Subserved

Sewer overflow. Each dike is drained separately.

API separaters - bottom are 18051

Oil Floated from this piped to 60s fan Ks and Reyeled. Separators are in greenel.

API Sepander bottems

acyrs old? harvier with truck CuerGlow port Chemind Separater) - Frok 59 also overflos in it concrete pit.

KOSI - bettens
PCI - East Chiago
EWR
EVANS-Cottage Grove
Terre Haute

Transporters are subuntuations

Sludge from API up to 1989

Ser 8/21/9)

Soviets Contest of the Soviets of th

slep of Nation transported to dientifying

Sludge tanks sits on Stilts
It is a separater tank. Oil fleat
sent to bos tank.

Studges are then sent to bus tonk also for recycling

As particulates break dawn. The middle layer gues to eventlew pit and then in tank 59

Warker goves thro overflow with wier and then put into the steditheater-unit which is a separater also. Cilis pumped back to the 60s tank.

Clean works discharge to Metro Sever Systems.

unce every 2 years this tank bottoms is vacuumed pumped directly into truck.

The fleat 13 Kotts - Apr. B. then 2886

Best A did not anderstand whites 1 B. then 2886

Then Dent a did not anderstand whites 2886

Boundary Cott 58 anion downs one of one 1980

Boundary Standard Short Standary west to bound on the sand downs of

drier Cortalyst

aluminism Bostalyst-land disposa 1

directly from ourt Nacucin 
dounged and disposed of

at Oid. Once every 2 or

3 years.

Sand-used to clean up aspiralt

Sulfer, Sand, Soil

Pit used to ward sulfur independent Waste CID

Sulfor pits - main tendance

Do 3ds.

detallyst the same

Aspiralt. Spills means Tanks 52 + Tanks 39 large velome, (wask)

14/16/5 +2KS

					<u> </u>	والمستحمريات		
			·		— <del>7</del>	足の	<b>~~</b>	
- =		<del>-</del>	<del></del>					
- C:		¥		<del></del>	- Z	<del></del>		
77	. 🗸	<u> </u>	•		۵	<del> </del>		) — <sub>1</sub> ,
	<del></del>		†			<del></del>		<del>चि </del> हा ====
	<u></u>	<del> </del>	-		<del></del>			
		_ 5	I			- w-a		/ ' (Z) : :
		3	1			T 'W_CJ T		
			<del></del>					<del></del>
		<u> </u>	<u> </u>	<del></del> -	9 A	इंग्री	<del></del>	<del>5   5   -    </del>
$\simeq$	<u>'</u>	_g	i i		n J	<u> </u>		J 15
			· <del>·</del>		5)	_ ==		, , ,
<del>- 54 · · · · · · · · · · · · · · · · · · </del>			<u> </u>			42 1-44		
	<u> </u>				5			
	r)					المحرارة ا	7	<del></del>
			<del></del>			المستحيد الم	<del></del>	~~_~~ `
<del></del>	<del></del>						$\Delta$	<u>₩</u> .J.J. : ∧
A 1	·	<b>र</b>	1	,	()		)	う <b>ま</b> ーー・
	<del></del>		<del></del>	<del></del>				
		<del></del>	<del></del>	<del></del>	<u> </u>	<del></del>	<u> </u>	
	C						T	<u> </u>
J-G				:			<u> </u>	
				·	<del></del>	_ <del></del>	<del>⋶────</del> - <del></del> -	١ !١
	<u>````````````````````````</u> ``V	o bo	· · · · · · · · · · · · · · · · · · ·				<u>~</u>	
- I	<u>ب</u> ے		;;	1	, i	<b></b>	حَد اره	$\sim$ $\sim$ $\sim$ $\sim$
- <del> </del>			1	·			73	<b>₹</b> ₹
			\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\		<u> </u>	100 -	1	\$ 5
ــــــ ــــــــ			<u> </u>	1 *		د_ن_ف	~	∑
<b>~</b>	20		1 21:		··· (~)		$\rightarrow$	
	200	( <del></del>		<u>~_</u>		<del>- (1)</del>		
_ ;	<del> ( 1) -</del>		+ ==	<del></del>	<u> </u>	<u> </u>	<del>, '</del> -	
<u> </u>	· ' ' ' ' ' ' ' ' ' ' ' ' ' ' ' ' ' ' '		1 71	വ	ים -	_ i	<u> </u>	, , ,
<u> </u>			_	- 1		7		· · · · · · · · · · · · · · · · · · ·
<del></del>	है उ	<del></del>	2 0 +	<del></del>		177	<del>}:</del>	
3 2	<u> </u>	<u></u>	G G+			100 - C	ري به جري	1'
ക്കി	<del>( )</del>	<del></del>	-ر ا <sup>-</sup> ا	10	1	- 13C	73 143	
4X C	-7	4 7			<del></del>			
	<del></del> থ ়	<del></del>	<del>il ⊊† c</del>	<del></del>	<del></del>		<i>f</i>	
				<u></u>			V	
c. 7			ゴー ニーラ	t.	1000			:
U	. 2		<del></del>	1			<u> </u>	<del></del> i
ــــــــــــــــــــــــــــــــــــــ			<del></del>	~ <b>!~</b>	— <u>;</u> ×——-			
<u> </u>	N			イシー	- 1	. U	<u> </u>	
-		- 6- 5 -	7 7 7 (2)		72 -2	I		
<del></del>	<del></del>	10 - 5 -	<del>~                                    </del>	<del>13 15 -</del>		<del></del>		<del></del>
	التناري	<u> </u>		_G_()				
- ^)	0 00 00	<b>Y</b> _ !	<u> </u>	<u> </u>	<i>⊆</i>		:	
		2 A			<del>-</del> 11		- : -	
\$7.5 ***			·	$\sim$		000		
			4 -			_; <u>~~</u>		
ر س		<del>-</del> <del>-</del> <del>-</del> <del>-</del> -	3 <u> </u>	43 D	سلا سنس	<u>-ب</u>	: 00	
A 75	<del></del>	10 100	<u>بر- ب</u>	380				· · · · <del></del>
<u>/ &gt; '/                                 </u>	3-43		شرىنات ميسسد	380	## ## ## ## ## ## ## ## ## ## ## ## ##			
- V	<u> </u>	,					<del></del> _	
								-
								87
						_		1 2

M-June 1991. Tonk 38 - overflow Jus yd3
Wheel Barrel feet orther OFF Scil/Spill

Fire Training, Alsip Blue Island Fire of Flance

Maintenance A) Exfety Klen 6) 1, 1, 1 Trichiere Dip tant Secund Centrainment Recycle by Satety Klein Phags revoed when Dry Electrical Instrument get 1,1,1 Trichlac First Wer Clear

Direction drows of water Structure of the Control o

	Lube Oils - Some can
Under Eurh Salars Pour gallens Va Cours purpeds 1985	Asbestos - Central III, mois landeill
liquidy Studge, sent to CID witil	S. t. i.C.
90 Safety rien cleans out.	Stage and t
In past 1, 1, I TCA used all the fine.	
170 Contamination for Chlorine Contourate	
FOOL Must Be Less Than 170	Estal There Transport
Mizecl with Tanks 605	Clark Olland Refinery Carporatrion
3 diptonk.	TSP I GENERAL MANUEL TOWNES TOWERS
Spray cleaners	The Boo tank field by underground
approx 10 drums of waste or year.	45 MIL GAL GORT DIAMERI
(19) SAT S/21/91.	(0b) 1.6/1/8/ 124S

Dike fields at Terminals stormwake Implies . One of tanks contain gas cit (Vasiline has to be heated to move

dike fields - valve.

Jank 804 had a leak of gas oil , Spillage. Sewer continuated the sewer January Froze. Sewage Was assumed Closed Sail aleaned

Last 7 years no leaded gas on 514c

Samples Now hazandous but RORA tested 1981. Leaded tank bottom cleaned.

Independent wask syskms bang In 8 yd 3

16/16/8 -XX

Chule oil brought in by P. prine  Denognt in by P. pri	Chieras that Ends fuel to Hamourh	West Shore comes up in bothern left having	Outside Pipeline - Infernal pipeline pumper into them forms. Pipes go underlicent to refine the Them of to topping	Then It gress to thinee different processes.  File unit gas	high comments and the second s		Set 8/21/91
Waskwasker Sump Pump	OIL Recon OFF  Hab - Dissolved Air Fleatation Unit	District User Change + Parameters	est maer constant	BOID HAD Meniter Sometimes duecks at	Wastemater Hazardon's Constituents API Separator Bottom's	Benzene KOSA - Leaded Tank bottoms	(3) EN 191

Asphalt - must be Kepil hot have Insulation on

Round tanks are Butane Spheres.

3. Upon 6-Tenk 59

6.7 S1 011 around

18 12,3 Flow rate 500gar/min each on P

19- DaF Skimmer

Deep Tunnel hies under lat Sagobsecuation well Gordeep Terminals

Tank 46 Leaded Tank Bottuns


Raileure Warker merkers

SAT 8/21/41

F.

SAT 8/21/9,

	***	<u>-</u>	
ļ		j j	
<u> </u>			
<u> </u>	7 4		<del></del>
<del></del>	30		2
0 5	) .0 3 0		
		70	<u> </u>
<del>8</del> <del>8</del> <del>8</del> <del>8</del> <del>8</del> <del>8</del> <del>8</del> <del>8</del> <del>8</del> <del>8</del>		<b>₩</b>	
		<del></del>	
1 7 1 1 C			9 -
, <u>c</u>		· · · · · · · · · · · · · · · · · · ·	
	1000	<del></del>	3 9
7 2 2	3 5 5	F	
		<del></del>	
1 1 1		4 9 -	7
	2 2	Jack the	J P
3 4 0 4	6 9		
	2)		
رو <del>سابات ا</del>	, telling		
された。	5	3.7	
	- 5 6		5
	, 9 20		
7 2 5	s) <u> </u>		6 2 2
7 7 7 1	3 3	100 X	
2 2 2 2 3			7,5
		1	
3 70 0 7	2 9	\$ 3	7 7 6 7 6 7
3 6 3 6			0 0 0 0 0
			1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1
3 3 3			
3 5 5 5 5 5		7 0	
5 5 0 1° V	30 4 7	7 4 - 00	10 SY 3 00 12 1
2 0 - 0 -	5 7 7 <del>6</del>		
2 0 - 1	3 1 2 0		4 0 0
E	- W -		古法当年自己
		う <u>・</u> ・ ・	$\mathcal{L}$
	ا ما سار کرد. راس خ		9
	<u> </u>		
- P 09 -	9		

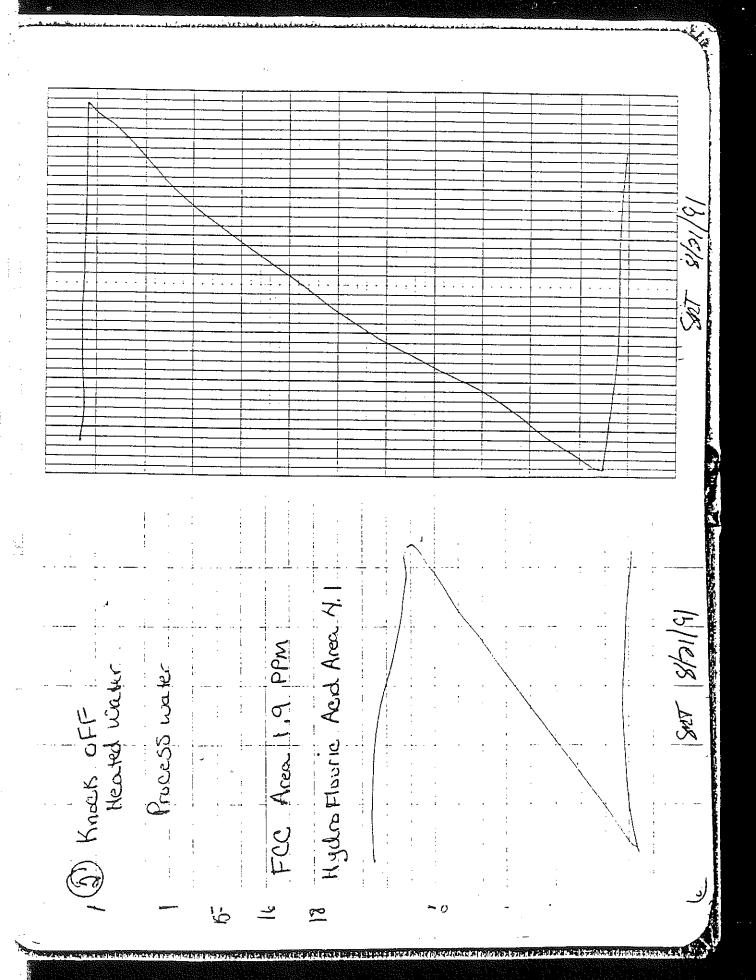

#### ATTACHMENT B

VISUAL SITE INSPECTION SUMMARY AND PHOTOGRAPHS

#### VISUAL SITE INSPECTION SUMMARY

Clark Oil & Refining Corporation (Clark)
131st & Kedzie Avenue
Blue Island, IL

Date:

August 21, 1991

Facility Representatives:

Ronald Snook, Clark Oil & Refining Corporation Stafford Jacques, Clark Oil & Refining Corporation

Inspection Team:

Scott R. Tajak, Resource Applications, Inc. Cynthia Tarka, Resource Applications, Inc.

Photographer:

Scott R. Tajak

Weather Conditions:

Sunny, Temperature 85°F

Summary of Activities:

RAI conducted a VSI at the Clark facility at 8:30 A.M. on August 21, 1991. Mr. Ronald Snook and Stafford Jacques were present as facility representatives, and explained facility operations and waste management practices. The facility is an operating refinery which produces many petroleum based products. The size of the facility is 160 acres. A significant volume of oil was observed around the base of the Asphalt Tank (AOC 1), lying on bare earth. With this exception, RAI concluded that wastes at the Clark facility are well managed. RAI concluded the VSI at 5:30 P.M.



Photograph No. 1 Orientation: East

Location: SWMU 1 Date: 08/21/91 Description: Outdoor Drum Storage Area. The pallet in middle contains spent TCA and PCB-

contaminated oil waste. The barrels to the left and right contain asphalt product.



Photograph No. 2 Orientation: North Location: SWMU 2

Date: 08/21/91

Description: Sampled Product Waste Accumulation Areas in Refinery Process Area.



Photograph No. 3 Orientation: South

Description: Bundle Cleaning Pad located in Refinery Process Area.

Location: SWMU 4 Date: 08/21/91



Photograph No. 4 Orientation: Northeast

Description: Former Satellite Accumulation Area.

Location: SWMU 5 Date: 08/21/91



Photograph No. 5
Orientation: East
Description: Former Storage Area. Tank #801 is in background. The empty area in right hand


bottom corner is where unit was located.



Photograph No. 6 Orientation: South

Description: Satellite Accumulation Area for Scrap Sulfur.

Location: SWMU 7 Date: 08/21/91

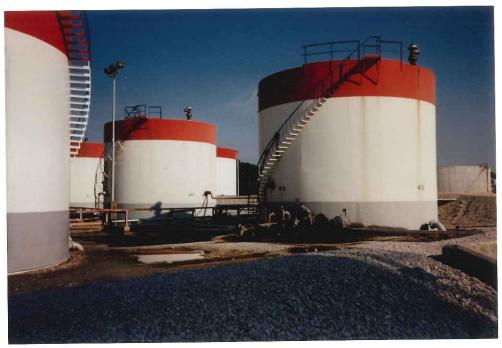

Photograph No. 7 Orientation: Southeast

Description: Storage Treatment Tanks. Tanks #63 and #65 (center and right) are oil-water separator

Location: SWMU 8

Date: 08/21/91

units. Tank #66 (left) is a storage tank.



Photograph No. 8 Location: SWMU 8 Orientation: East Date: 08/21/91

Description: Storage Treatment Tanks and pipeline connection to tanker truck waste disposal pumping



Photograph No. 9 Location: SWMU 9
Orientation: North Date: 08/21/91
Description: Approximate location of Former Container Storage Treatment Area in foreground.



Photograph No. 10

Orientation: West

Description: Approximate location of Former Storage Treatment Tank. According to the RCRA Part

A Permit application map, this former unit was located where the dike is currently.



Photograph No. 11

Orientation: East

Date: 08/21/91

Description: Approximate location of the Former Drum and Waste Storage Area, currently owned by BTL Industries. The unit location lies on east side of fence.



Photograph No. 12

Orientation: Southwest

Date: 08/21/91

Description: Approximate location of a Former Container Storage Area. Currently, Clark

Corporation's Blue Island Terminal is situated on this former waste area.



Photograph No. 13 Orientation: West Location: SWMU 15 & 16

Date: 08/21/91


Description: Approximate locations of a Former Container Storage Area (SWMU 15) and the Former Waste Pile Area (SWMU 16). Note electrical connection for a former flare unit in bottom right-hand corner.



Photograph No. 14 Orientation: Southwest Location: SWMU 17 Date: 08/21/91

Description: Location of the Former Waste Piles and Impoundment Area. Note lack of vegetation in


center.

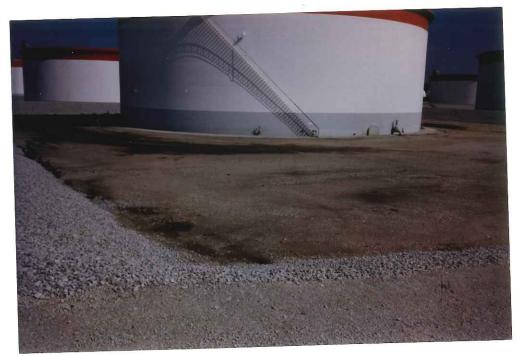

Photograph No. 15 Orientation: Southwest

Description: Former Impoundment Area.

Location: SWMU 18 Date: 08/21/91

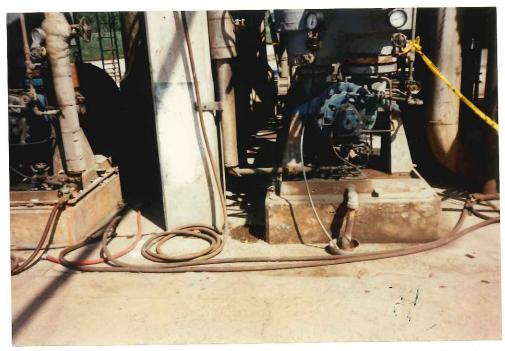

Photograph No. 16 Orientation: East

Location: SWMU 19 Date: 08/21/91

Description: An example of wastewater drain which leads into Wastewater Treatment System.



Photograph No. 17
Orientation: North
Location: SWMU 19
Date: 08/21/91

Description: An example of an oily waste pump for the Wastewater Treatment System.



Photograph No. 18


Orientation: West

Location: SWMU 19

Date: 08/21/91

Description: Some of the wastewater is neutralized in this alkylation neutralization permit. The

neutralized wastewater is pumped to the Wastewater Treatment System.

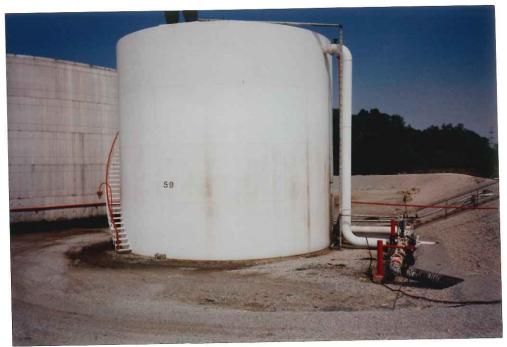


Photograph No. 19 Orientation: East

Location: SWMU 19

Date: 08/21/91

Description: Treatment Tank #59 (center). This unit is an oil water separator. Note Tank #51 (left),

an Asphalt Tank (AOC 1) leaking oil at base on left side of photo.

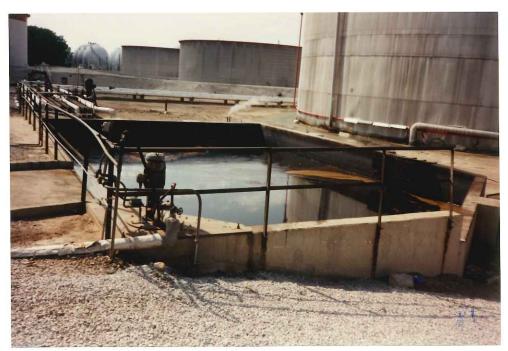

Photograph No. 20 Orientation: Northwest Location: SWMU 19

Date: 08/21/91

Description: This 72,000-gallon overflow pit captures wastewater that Tank #59 cannot handle.



Photograph No. 21 Orientation: South

Description: An oil water skimmer, part of DAF oil water separator.

Location: SWMU 19 Date: 08/21/91




Photograph No. 22 Orientation: West

Description: Location of 2 API oil-water separators.

Location: SWMU 19

Date: 08/21/91

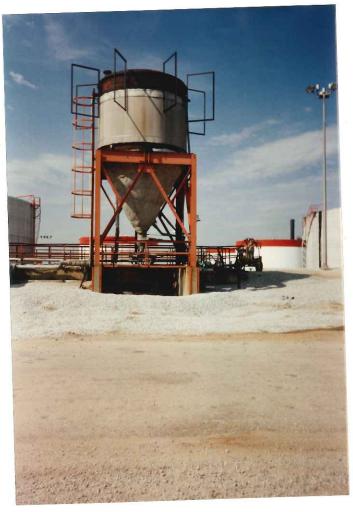

Photograph No. 23 Orientation: West Description: The DAF oil water separator unit.

Location: SWMU 19 Date: 08/21/91



Photograph No. 24
Orientation: West Date: 08/21/91
Description: Flow Meter location. Discharge point of clean water to MWRD Sewer System. Location: SWMU 19




Photograph No. 25 Orientation: South

Orientation: South Date: 08/21/91

Description: Cooling tower used by Water Treatment Plant for cooling boilers. Note sludge splattering


on unit wall. Also note caustic on ground under sulfuric acid tank.

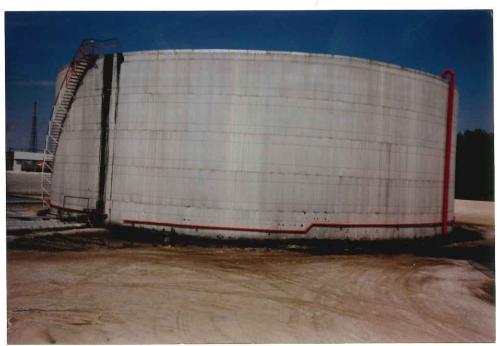

Photograph No. 26 Orientation: Northeast

Description: Asphalt Product Tank. Note oily liquid on soil at base of tank.

Location: AOC 1 Date: 08/21/91

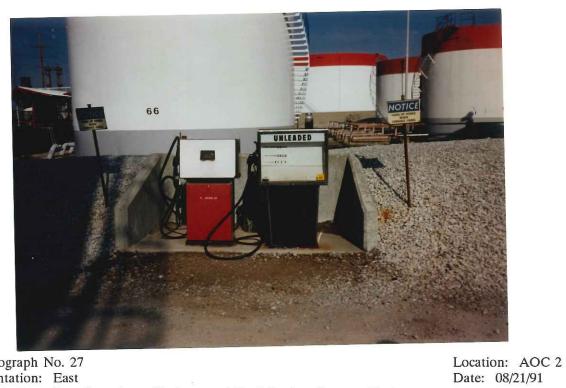

Photograph No. 27
Orientation: East
Description: Location of two Underground Fuel Product Storage Tanks.



# UNITED STATES ENVIRONMENTAL PROTECTION AGENCY REGION 5 230 SOUTH DEARBORN ST. CHICAGO, ILLINOIS 60604

WMD RCRA
RECORD CENTER

WMD RCRA

WMD RCRA

REPLY TO ATTENTION OF: 5HR-12

August 14, 1991

Mr. John Bernbom Clark Oil & Refining Corp. 131st & Kedzie Avenue P.O. Box 297 Blue Island, IL 60406

Re: Visual Site Inspection
Clark Oil & Refining Corp.
ILD 005 109 822

Dear Mr. Bernbom:

The United States Environmental Protection Agency (U.S. EPA) Region V will conduct a Preliminary Assessment and Visual Site Inspection (PA/VSI) at the referenced facility. This inspection is conducted pursuant to the Resource Conservation and Recovery Act, as amended (RCRA) and the Comprehensive Environmental Response, Compensation, and Liability Act, as amended (CERCLA). The PA/VSI requires identification and systematic review of all solid waste streams at the facility. The objective of the PA/VSI is to determine whether or not releases of hazardous wastes or hazardous constituents have occurred or are occurring at the facility which may require further investigation. This analysis will also provide information to establish priorities for addressing any confirmed releases.

The visual site inspection of your facility is to verify the location of all solid waste management units (SWMUs) and areas of concern to make a cursory determination of their condition by visual observation. The VSI supplements and updates data gathered during a preliminary file review. During this site inspection, no samples will be taken. A sampling visit to ascertain if releases of hazardous waste or constituents have occurred may be required at a later date.

Assistance of some of your personnel may be required in reviewing solid waste flow(s) or previous disposal practices. The site inspection is to provide a technical understanding of the present and past waste flows and handling, treatment, storage, and disposal practices. Photographs of the facility are necessary to document the condition of units at the facility and the waste management practices used.

The VSI has been scheduled for August 21, 1991. The inspection team will consist of Cindy Tarka and Scott Tajak of Resource Applications, Inc., contractors for the U.S. EPA.

Representatives of the Illinois Environmental Protection Agency may also be present. Your cooperation in admitting and assisting them while on site is appreciated.

The U.S. EPA recommends that personnel who are familiar with present and past manufacturing and waste management activities be available during the VSI. Access to any relevant maps, diagrams, hydrogeologic reports, environmental assessment reports, sampling data sheets, manifests and/or correspondence is also necessary, as such information is needed to complete the PA/VSI. Enclosed is a summary of our current knowledge and data gaps.

If you have any questions, please contact me at (312) 886-4448 or Sheri Bianchin at (312) 886-4446. A copy of the Preliminary Assessment/Visual Site Inspection Report, excluding the conclusions portion may be made available upon request.

Sincerely yours,

Kevin M. Pierard, Chief

OH/MN Technical Enforcement Section

Enclosure

cc: Cliff Gould, IEPA - Maywood

#### **ATTACHMENT**

Clark Oil & Refining Corp. 131st & Kedzie Avenue Blue Island, IL 60406

#### PROBABLE SOLID WASTE MANAGEMENT UNITS (SWMUs)

 Little information was available to compile a list of SWMUs at Clark Oil & Refining Corp. Please list all waste management units active or inactive at your facility. Please provide as complete information as possible for the waste units in response to the questions below.

## From the list of probable SWMUs please address the following questions:

- Do the above SWMUs still exist at the facility and are they in operation?
- · What are the start-up and closure dates of the above SWMUs?
- What types of wastes are the SWMUs currently/formerly used for?
- Name any SWMUs at your facility that have not been listed above. These would include hazardous waste storage areas, treatment units, or any other area or system at your facility dealing with hazardous waste.
- 2. Please supply as much information as possible concerning the site history. This would include any information you have regarding any other owner/operators at this location.
- 3. Please provide a description of the primary processes taking place at your facility and the waste streams which are generated.
- 4. Describe the methods of treatment and disposal of generated waste utilized by your facility.

#### If available, the following items are requested:

- A detailed map of the facility showing the location of the SWMUs and production stations.
- Flow diagrams showing waste streams and waste management practices.

## UNITED STATES ENVIRONMENTAL PROTECTION AGENCY REGION V

**DATE:** 2/27/91

SUBJECT: Clark Oil- Blue Island, Site Visit and Fact Sheet

ILD 005 109 822

Re: Clark Oils Request for 30-day extension

FROM: Robert Fuhrer

TO: File

**GENERAL** 

On February 11, 1991, Robert Fuhrer of the U.S. EPA, visited the Clark Oil, Blue Island facility. Mr. Tom Snook, Clark Oils Environmental Specialist discussed the site history, the issues of the request for a 30 day extension, and then gave a tour of the facility. This site visit summary will briefly review the site history, waste water treatment unit, and the extension issue.

When discussing this site and reviewing some of the files we found out that Mr. John Mahler of the IEPA Maywood office conducted his biennial site inspection last week. The only major violation was that a Safety-Kleen truck came in and took some hazardous waste material without manifesting or calling up Clark Gils environmental office, because he thought Clark was a small quantity generator. In 1989, Donna Check of the IEPA conducted a thorough inspection of the Clark Oil site.

When asked about the new Petroleum Refinery Sludge Rule (FR v.55, n.213, 11/2/90), Clark Oil said the only concerns were if they had any spills of gasoline product. I asked about the new TCLP rule and how it would effect this site and they said not unless there were benzene levels in their non-hazardous waste piles.

When touring the site we discovered that the flare area on site has been paved over in the past two (2) years and is now a part of the Clark Oil distribution system and has a independent manager.

We saw the booms that would be placed across the Cal-Sag Canal if there was a spill.

We also saw some caustic on the ground, by the caustic tanks in the refinery area.

HISTORY

Mr. Emery T. Clark started the Clark Oil and Refining Company in the early 1930's. In 1981, Clark Oil was sold to Apex Oil. Apex Oil sold Clark Oil in 1988 to the Horsham Company. The Horsham Company has worked to try and limit Clark Oils liability problems. Clark Oil's Blue Island facility began operations in September of 1945.

In 1985, the chemical portion of the Clark Oil site was sold to a company called BTL Resins. IEPA inspectors (Rich Finely and Tom Enno) seem to indicate that

there is "gross contamination" of the chemical portion of this part of the site with KO22. distillates, bottoms tars, cumene, and phenol contamination.

Currently Clark generates KO48-51, has 250 to 280 employees and is located in parts of Blue Island, Unincorporated Cook County, Worth Township and Alsip. The Blue Island facility produces about 70,000 barrels of petroleum product per year.

All sampling currently performed at the site is performed by EMT and Gabriel laboratories. An example of a EMT lab report taken at the flume exit to the MSDGC is attached. They are currently storing 3 roll off boxes of construction debris in the north west property which is waiting to be tested for raw benzene. If raw benzene was discovered they would then conduct a TCLP test. Six boxes were recently removed from this area following negative tests for benzene. I did not visit this area because it was said to have no roads and Clark Oil did not have an off road vehicle available.

#### WASTE WATER TREATMENT

Clark Oil generates API separator sludge (KO51), DAF float (KO49), and leaded tank bottoms (KO52). The wastes (except KO52) end up in the API separator, overflow pile which are the major components of their wastewater treatment system.

The waste water treatment area can be considered a SWMU. Tank 59 is where all the refinery influent water goes and is then sent to the oil water separator. From there it goes to two (2) API separators then to the DAF separator eventually entering the Municipal Sanitary District of Greater Chicago (MSDGC) sewer connection. The sludge is currently sent to Avganics in Terra Haute IN. A vacuum truck comes (supposedly) within 90 days to pick up the sludge. The overflow (oil slop) area is currently at a low level and has been frozen for the past 2 months. This area is concrete lined similar to a tank. There is a cone bottom tank that is used on a irregular schedule that seems to have contributed to some local contamination to the ground surface.

The slop oil "overflow" area directly north of the API and DAF separators was at a low level, but still takes oily waste from the refinery and the separators (see map).

Before this site visit, Clark Oil was allowed to bypass their DAF and API separators and directly place their waste in the MSDGC sewer while "upgrades" were performed on their waste water treatment plant (see map).

#### **EXTENSION ISSUE**

The reason for this site visit was to discuss the Clark Oil's requested extension of hazardous waste storage for 30 days. Clark wants this 30 day extension for storage of hazardous waste because they stored leaded tank bottoms (K052) for over 90 days in 1981. An example of unleaded tank bottoms was displayed which consisting of a fine brown clayey soil. Clark Oil stated that they deserve a 30 day extension because they had no control over the storage beyond 90 days.

If Clark received a 30 day extension they would be able to apply to the IEPA for withdrawal. Clark Oil does not want to be a closed TSD, they want to be "off the books" so that their credit rating and liability does not suffer.

The KO52 material was placed into a lined roll-off box and after sampling it, it did not exhibit hazardous characteristics even though it was a listed waste.

The incidence of leaded tank bottoms occurred (as Clark states) as a one time event and cleaning of Tank #46 where 8 yards of the material was placed into a plastic lined roll-off box. This roll-off box was moved from the Tank 46 area in the South West property (sometime after sampling on 7/7/81) and moved to the "800 Tank Farm" specifically in the south west corner on the grounds of Tank 801 (see map).

Clark Oil said that no other tanks were "cleaned" because they never had any problems. This suggested that there was some problem with Tank #46, but no one knows for sure.

The issue arises that Clark Oil "accumulated" eight (8) yards of KO52 (leaded tank bottoms) longer than 90 days. This material was disposed of on 11/3/81 at CID. According to §262.34 (b) accumulation time can be decided at the discretion of the Administrator.


Clark Oil indicated that they would pursue this issue to the top of the chain of command.


#### CONCLUSION

We said that a decision and a letter would be sent to Clark in about 2 months.

## Chronology Clark Oil, Blue Island, ILD 005 109 822

Part A application submittal Generation of waste Sampling and delivery of waste to lab (GCL) Sample tests completed and mailed to Clark Sample tests results received from GCL Sample profile sheet sent to CID landfill Sample analysis completed by CID landfill Application sent to IEPA for permit by landfill Application received by IEPA 90 days after sampling of waste Permit issued by IEPA to CID landfill Copy of permit received by Clark Waste taken off site to CID landfill 120 days after sampling of waste Clark request to IEPA & U.S. EPA for withdrawal Clark letter to U.S. EPA, requesting withdrawal U.S. EPA letter to Clark, certification request Clark letter to U.S. EPA, requesting withdrawal U.S. EPA letter to Clark, certification request Clark letter to U.S. EPA, requesting withdrawal U.S. EPA letter to Clark, certification Clark letter to U.S. EPA, certification Clark letter to U.S. EPA, certification Clark letter to U.S. EPA, certification Clark letter to U.S. EPA, API bottoms analysis U.S. EPA, RFA visual site inspection (VSI) Clark letter to U.S. EPA, appl bottoms analysis U.S. EPA, RFA sampling visit (SV) Clark letter to IEPA (Maywood) sampling, withdraw	11/18/80 unknown 7/7/81 7/22/81 7/23/81 7/24/91 8/10/81 8/24/81 8/27/81 10/5/81 10/16/81 10/30/81 11/3/81 11/4/81 8/2/83 8/23/83 1/27/84 7/24/84 12/18/84 1/10/85 6/19/85 7/24/85 10/11/85 8/12/87 8/24/87 12/2/87 12/10/87 2/18/88
U.S. EPA, RFA visual site inspection (VSI) Clark letter to U.S. EPA, API bottoms analysis	8/12/87 8/24/87
Clark letter to IEPA, generator only status?	12/10/87
IEPA letter to Clark, must submit closure Clark letter to IEPA, request variance	2/19/88 3/3/88
IEPA letter to Clark, <u>denied variance</u> Clark letter to IEPA, response, want extension	3/28/88 3/31/88
IEPA letter to Clark, not empowered for extension Clark letter to U.S. EPA, request variance Clark letter to IEPA, withdrawal request followup	7/15/88
U.S. EPA letter to Clark, results of RFA sampling Clark letter to U.S. EPA, variance followup Clark letter to U.S. EPA, variance followup	9/22/88 10/31/88 4/14/89
Clark letter to U.S. EPA, asking for extension U.S. EPA letter to Clark, reviewing request	9/12/89 11/16/89
U.S. EPA letter to Clark, <u>denial of extension</u> Clark letter to U.S. EPA, extension request Clark letter to U.S. EPA, extension followup U.S. EPA site visit & discussion about extension	1/8/90 8/2/90 12/26/90 2/11/91
Clark letter to U.S. EPA, ext. visit followup	2/27/91

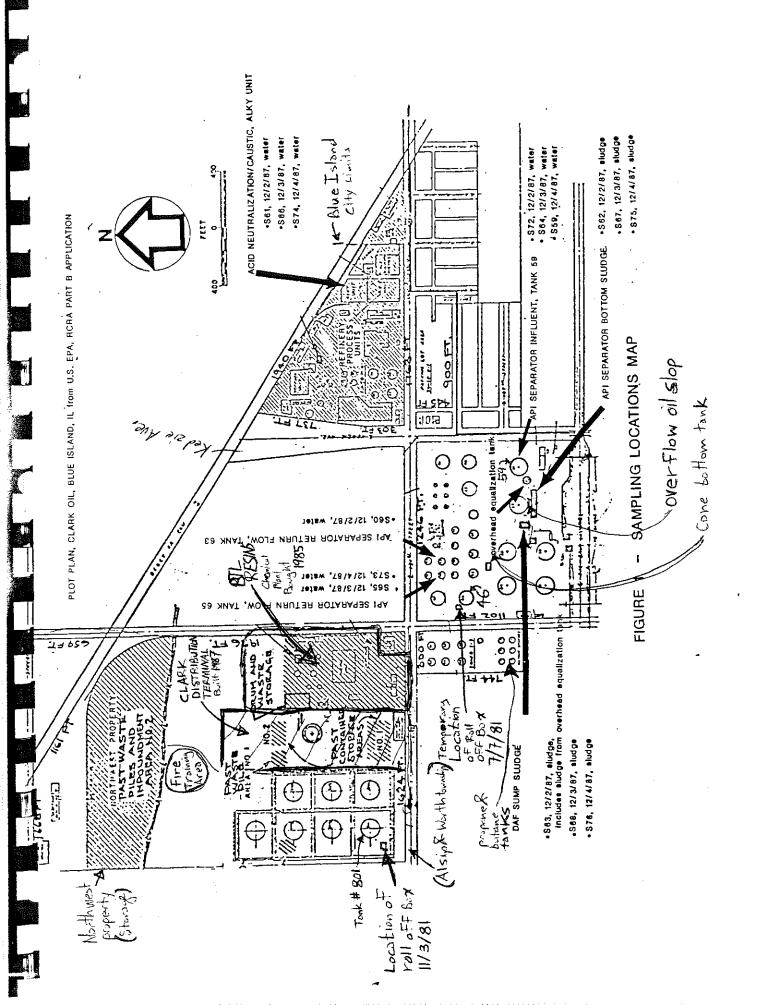

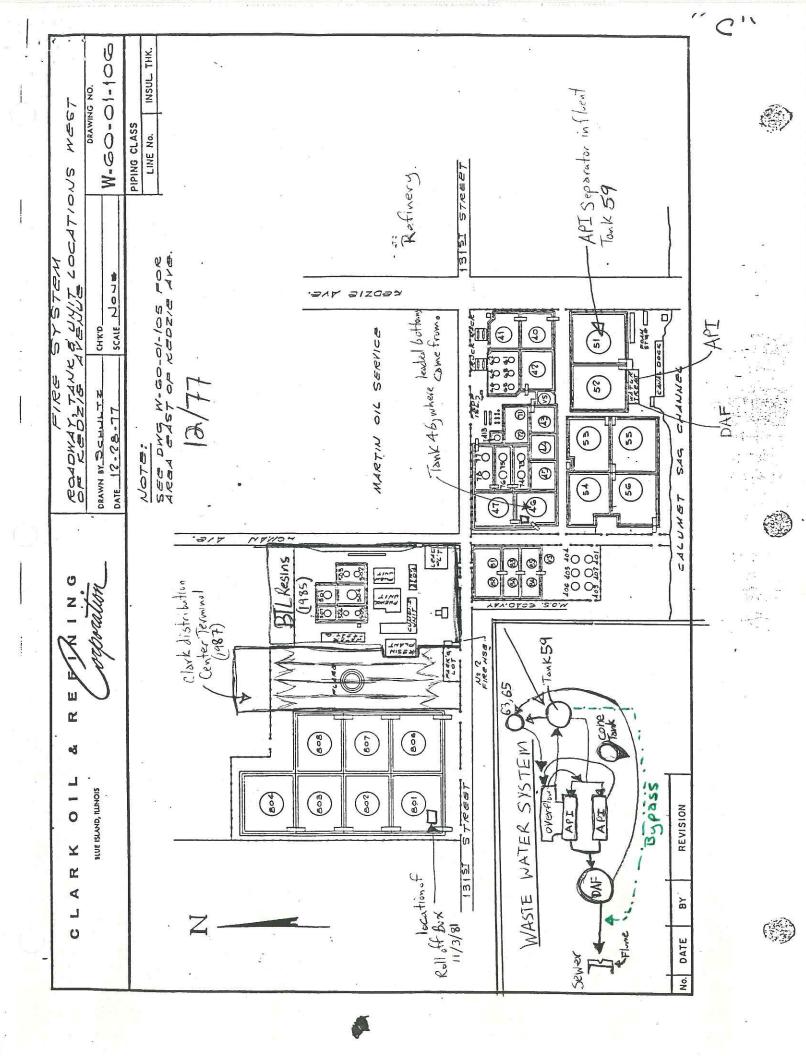



## **ENVIRONMENTAL** MONITORING AND TECHNOLOGIES, INC.

8100 North Austin Avenue Morton Grove, Illinois 60053-3203 708/967-6666 FAX: 708/967-6735

#### LABORATORY REPORT

09680-A

Clark Oil Corporation 131st & Kedzie Avenue Blue Island, IL 60406

Report Date: February 4, 1991

Sample Received: As Listed

Sample Description: GRAB - 1A Fluxe effluat - dis Charge to district

Date	Time	Sample No.	Ammonia	Oil & Grease	
1/16	Midnight	2654	10.6	26	
1/16	4:00 am	2652	11.2	13	
1/16	8:00 am	2653	6.7	13	
1/17	Midnight	2655	5.2	11	
1/17	8:00 am	2656	3.1	19	
1/17	4:00 pm	2695	3.5	22	
1/18	Midnight	2696	3.6	14	
1/18	8:00 am	2697	11.5	28	
1/18	4:00 pm	2796	11.2	36	•
1/19	Midnight	2788	9.5	17	
1/19	8:00 am	2789	15.4	40	
1/19	4:00 pm	2790	6.4	37	
1/21	Midnight	2795	14.0	22	
1/21	8:00 am	2794	15.1	28	
1/21	4:00 pm	2908	8.4	19	
1/23	Midnight	2916	7.6	49	•
1/23	8:00 am	2912	8.8	30	
1/23	4:00 pm	3025	7.3	13	

All results expressed as ppm unless otherwise indicated. Analyses performed using "Standard Methods for the Examination of Water and Wastewater", 17th Edition.

LABORATORY DIRECTOR

SHA

O

# POTCHTIAL HAZARDOUS WASTE SHE SHED:SPECTION REPORT

PART 3 DESCRIPTION OF HAZARDOUS COMUNITIONS AND INCIDENTS

STANDER TO MANGE 11

EPA - DLP.C. STATE OF ILLINOIS

PAHLS OF SCHOOL STATES	AND THE RESIDENCE AND ADDRESS OF THE PARTY O
B. MAZARDOUS CONOMIONS AND BYCHEMIS	DARLE LA PROPERTIES DE
Gronoware community of the surrounding bottoms, but Elections and the surrounding community of the surrounding community of the surrounding community of the surrounding community communi	words
OSPERNATION INTERNATION IS A POSSELL.	1 hard skeptischigan waterfor
bottome, but Eluc I clank and the surrounding common	And the Riverse and many
Lander Employee	The second secon
March 201 25	DATE DEDITION CANTINO
OLGE SURVACIONALINGONIALINGATION O OFFICE STATES	scarione la la la surface materrinota.
OF POPULATO THORITIMES A PARTIE SALY if bet	of write is washed up T
Special walk comments is little bept within the date	all maker report to the the emptice into the cat-bag.
Sugar was a community of a portantial and if but the de to the transfer and if but the de to the transfer and if but the de to the transfer and if the and in the transfer and transfer and the t	Pene. 156
Charles and the control of the contr	Canada California
63 POPULATION OF ARE 63 POPULATION OF THE APPLICATION C	
63 PD/100/100 100/100	
Market Committee	
	CHILGID.
000 000 000 000 000 000 000 000 000 00	1 Call Control of the
Stella Petroleum Strings terminent to the boned tenk to the	al so a sucle flosion and was le
Stella Petroleum Itural	ours mentardin the might
that not due to the buried the	CARGO.
The state of the s	All Pages and the contract of
OF THE CAPCITONACI OF POPULATION OF THAT IS A CAPCILLARY OF THE CA	Company of the second of the s
S. K. i Guerd	**
	BEOTHAMA DAILGED
OF AREA POTENTIALLY AFFORED 2.5	and a the executing soils are most
	EE.
Some of the disposal areas have never her runs	
and the second of the second o	O OARE
OT POLICE POLICIANTALLY TO ESCATE OF THE OF ANY AND THE OFFICE AND	
Blockshad and surrounding communities	receive crinking water
Blockshid and surrounding communities	
CZ O CSSERM	TAILGEO
OF CONCESSES	distribution of the state of th
OF ME HOSPINIA GENERALIME	DISCRETION
the state of the s	
the state of the s	
the state of the s	
or heavener of the but and the but the	places.
or near energy of the but any or or occasion	places. TO POTENTIAL OWINGS
or heavener of the but and the but the	places. TO POTENTIAL OWINGS
or hoard as roll and terminal curvey are not entempered by the bu	pleyees.
or hoard as roll and terminal curvey are not entempered by the bu	places. TO POTENTIAL OWINGS

GEFA	•		PARTZ WAST	RUOUS WASTE TION REPORT E IN ORMATION	×	L DO 9	
II, WASTESTATE USTATISTATE STATE TO COMMENTER THE CHURCE THE CHURCE THE CHURCE	OC LAS OC LAS	Process Of services	SZ. Y	OFFICE CONTROL OF STATE OF STA	Elime Cocamina	IL US ON THE CONTROL OF THE CONTROL	1001
HI, WASTE TYPE							
Z. STILLAT	ه . الاستوع ع الاستواري	est.	010-023 11474	2000000	DACKET CHIS	~=·	
Siu	STORGE				WAITE COST	INTO OR TANK	BATTOMS
01 W	ORYWASIE		524	cuyds.	FROM TAN	IS UF OILS	Diller Tue
sol	50: V[ NI S		e		CASOLING (1	1,000,000	WHAYD)
and the second second	PUSOR OUS				AND FULL OF	, ter ,	
1150	OTHER OPERING CH				Armekan	skgradily 1	lyurd by
OCC	DIRECTIONS CHICKES	particular and the control of the control of			I the Citming		
,oc .	The second section of the second section of the second	The second of th			3,124 6	116 6 70	KID AFFILIAL.
ACD	AC105	٠ الكيسان الرابر		<u> </u>	I lot of a	7. 1. 1. 1.	all by the
5.45	\$4% \$				1 1 4 4 3	1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1	Life Jief the
LAES.	MUTAL TALE			<u> </u>	3	14.2	
IV. MAZARDOUS	SUPSTANCES BOOK	الله المنظمين علاقة المنظمين الله المنظمين الله المنظمين المنظمين المنظمين المنظمين المنظمين المنظمين المنظمين المنظمين المنظمين ال	。。	* (c. \$10.5 kg) (3.5		CALC TURNION	7
OT CHITTISAY	025 -5124665 -	, held				Annual Control of the	100
	and the second second		and the second s				
				The state of the s		and the second	
			the state of the s	vandroja.			
			The state of the s				
	and the second second section of			Clause			
	and the second second second second second						and the second second
	A section of the section						
	المتعلقة أأكارينات سيويان	and the second second second second					
	And the state of t			to the second se			
			! !	\$ -,			and the same of th
	and the second s	and the second section of the second	ļ	<u> </u>		The second control of the second seco	
	and the second second second second		\$				
		·	<u> </u>				
	2						
- 1		÷	-	in the second			ـــ ــ أـــ
1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1							and the second s
	0111105105	e waster	のさられないという経典	CHICORT	. 011(0510	CRIVAME	02 545 NUMBE
CANECALL.	The second secon		<u> </u>	105	The second secon		
108		<u> </u>	<u> </u>	Fos			1
105				105		<u> </u>	1
105				FOS			1
105			1	L		and the control of the same of	
On sola Sage	officer and	A mache	ALL J. Kur	Wood Granti	and Ray Sagan -	RECEI	VED
		A market and a market and a market and		The second secon	,	MAR 22	1984
ice ococ sand the	5.57)	•		* · · · · · · · · · · · · · · · · · · ·		EPA - D STATE OF IL	

# SHEMULTECHOTREPORT

HOP WHITE THE

PART 1 - SITE FOCATION AND HIS PECHON PUT ONITATION MONTAGE OUT THAN THE H MARTIN Ble IsLAND TERMINAL 13100 S. Kedere Ave IL 60406 | Cook BY POTATE DEFICERS ... I GO STATE OF COUNTY DE INVACEMENT 1955 1 1980 De THE ENDER LA TRE BIRALACE ON IPA SER CONCERNS CONTROL ENLINE ENLINE TO COMER OF THE PROPERTY CONTROL WASHIE DESIMBLE HENCHOR Early 1 Environ A 308 663-4415 Evologist Biologist PANCOZZA FRAN Allans 13121345-9380 Cliff Gould TEPA ightharman bo AUIPIL 60658 1312 1385-6500 J. KRKLAND GREER IT 13100 S. KEDELL ALL TECHNINAC GIZ 1385 6500 Ray Sheen Blue JULAND 16 60406 ENTOYLE RECEIVED - MAR 22 1984 EPA-DLPC STATE OF ILLINOIS SERVERS SCOTT FORE clears sunny, high of 380F wind out of THE USET \$10 mgh OBSELL FROM ( NO. Illinois EPA 1312 1345-9780 JUINITHO 1100. Eclosy -312 663 9415 Lavianut.

EPA - DLP.C. 35-3718-2 SAG RASE 8245 4861 22 AAM 13116-3145-011111 ¥ 866 747494 00000 ILLINOIS GEOLOGICAL SURVEY, URBANA Takengan È ් ක Reference not of drawings 4040 pp.2.5 in map fillos. Colcinal surface - black dirt Calumot-Sec Canal Prior to 10-1-46 corps of Inglusers 596.5 1SL 174., 2I., SE, Corps of Englishers Mue lelend quantiquele. Blue clay and man THE HEAL YEAR Cook CIO. BOX Maring No. DAIN DRILLED AUTHORITY ELEVATION. LOCATION COMPANY COMMEN - +8.E. いいいないというできない 00 0 TANGE CANADA Well No. Wollom sat at sal, per min. Temperatura high Static level from sort. Charlachimm o ta Finished In Libral of Property of Sack If recessary! Santa Santa LOG OF WATER WELL 11. 12. in described Lot 12, Plock 1, Jas. T. Smith & Co. Description of location Second 12th 120 1 Mercardiana sassed through 75,75 GOL Whole Sire Tarlestal Server a subdiva. C Racelyad 11-27-68 Inch. Size bole below casing. Diam Tradater of William Bilosher Permit # 5702 Water lowered in Tested capacity. Township name. Length of test. Claimont Property owner. Signed I Cased with and. Drilled by-

700

OUT OF AGE 37.378.7 SUB S 專 0°F'6'C **7861 23** AAM C12210-2024-29251 ILLINOIS GEOLOGICAL SURVEY, URBANA 17 4 4 9 W Talkha ass COUNTY MO. ರ ೫: Reference set of drawings 4040 p5-25 Critical surface - basck dirt Earles to 15-1-46 Corps of Includer's 596.5 151 IN., SI., SE., Compa of Englishment Calumetases Canal Elu Inler quadrangle. Bine clay and sand reliera mura eng THE HOLL THE \$08.00 38 Linost on in may rules. Service No. CALL DALLED AUTHORITY EL EVATION TOWNER COMPANY COUNTY **新人民** 34 Pr. 34 3 TO THE TANK TO SEE . T. Well No LD 9. Trick. Depth of Q-Q-3 tana tata tan an as colon ball *∽* Bottom sat at neh, Static lavel from surfagal, per min. Temperature CALLACKING O to 5 Continue on back if necessary min, Screen LOG OF WATER WELL County in described Lot 12, Plock 1,Jas,T.Smith & Co. Description of location Second 18 drive to primarians passed through marlor. to though State Goalegies! Surray Finished far Llassetter s subdivm. Received 11-27-58 Siza hole below casing-100 とというとうとう 11111am Biloche Permit # 5702 Water lowered to Township name. Teated capacity. Length of test Clairmont Property owner Cased with Drilled by. では

1

SER

#### POTENTIAL HAZAROOUS WASTE SITE SITE INSPECTION REPORT PART 10-PAST RESPONSE ACTIVITIES

TOURS CANON

PAST RESPONSE ACTIVITIES		and a very second a common second on the second of the sec	er alle ser ette englische sterr i system i mengen i selektiftete i men fill i men fill i sich i me
DE O Y MATER SESSIA CLOSES	OF DATE	USAL CHET	gane a commence of the contract of the contrac
os of sciencia			
	a production of the second second second second second second second second second second second second second	03.405.407	The state of the s
OF DESTRUCTION WATER SUPPLY PROVIDED OF DESCRIPTION	or dark		
OF O C MENTALM WHITE SPENIS PROPERO	DA BARROLLO	D3 ACC MEX	
01 D C 9620/428/40 (A) 01 10 10 10 10 10 10 10 10 10 10 10 10			
OF O SHOT WITH THE OF O OF O	6864度	mig actioned &	
O4 OL COMPLEX			
OF DECOMMENTO SOL STANDE	3.3.4.5.4.5.5.5.5.5.5.5.5.5.5.5.5.5.5.5.	的生 中国北京	
OF OLSCHOOM			
CA DA WARL AND ELL MARK	END CONTY	SA A WEST CHANGE	
the letter with the			
on O C 1, 2502 reserved to St. Compared to the compared to the	110 1 ATB	· · · · · · · · · · · · · · · · · · ·	
U. C. S. C. LENGA.			
or the Company of the	1.2 性後間	· · · · · · · · · · · · · · · · · · ·	•
D. O. M. CALLINSON			
artific winds on a market	And the state of t	19 S 能信 · 哪儿管	
इस्त के प्रान्त के राज्या के में अली	And the second s		Ŷ
the sales returned as a contract of the report was	The state of the s		
	de de la companya de	· · · · · · · · · · · · · · · · · · ·	
The first of the section of the sect	The state of the s		
		從後 垂烷石 烟烷甲	
AND THE STATE OF T			
the transfer of the second of the second of		原理 爾克斯 网络沙野	
The state of the s	o de la companya del companya de la companya del companya de la co		
STATE CHIEF CHES	and the second	1 × mily modific	
A CONTRACTOR OF THE CONTRACTOR	W. C. C. C. C. C. C. C. C. C. C. C. C. C.		
AND THE RESIDENCE OF THE SECOND STATE OF THE S		Same State of the	. *
And the second second			
and the state of t	A STATE OF THE STA	in a wall of the first	manufaction and the second second second second second second second second second second second second second
10 (10 m) 10 m) 10 m)			
	9.50 10.275	the second of the	

### SEPA

#### POTENTIAL HAZARDOUS WASTE SITE SITE INSPECTION REPORT PART 10-PAST RESPONSE ACTIVITIES

IL DO 6 by 644 66

OT O A CASHLA WALLS COUSTAUCTED	DYDATE	OTACKAT T	
D. D. Charles			
OLD'S CHPOSCOVEROS	07 0 % 1%	03.800.907	
O4 Of SCRIPTION			
OT O T. BULK TATICAGE IN PARTO.	SP DATE	0) %G* *C*	رون در در در در در در در در در در در در در
OF CHOOP CONTRACTOR THOUSES	₩ \$ \$.	में है क्या ब्लीड	
OF ON HOLOGY MARCO A	54 54 57	13 \$ \$\infty \text{3.5} \text{3.6} \text{3.6}	
of O wices comison	公金 公集書簡	经专业证明 "	•
· · · · · · · · · · · · · · · · · · ·			
AN CONTRACTOR CONTRACTOR	<b>发光 李林等</b>	Zong var Ang sada Mar	
De Chine a Symmer Table by State of Sta	2.6 艾唑季酮。	CEY MOLL MEUN	
ON ON THE STREET	四年 主義主管	13 地名美国	
OF CLAUSE THE SECTION OF SECURITION	No town	to a second with the	
ASA (In the sour New Year)			
राज के हैं के करिकार के देशका स्थाप कर कर कर कर है ।	and the second	61 ME M.	
ફાલ ફાલ્પ મહો વધુ લઇ કોલોમું કાર્યકાર હતા. જ	· Marian in the second of the		
হৈছে হিছু আৰু প্ৰাণ্ড আৰু সংগ্ৰহণ কৰা স্থাই ইংগাই আৰু জিন্ত ৰাম বুজা কৰা কৰা কৰা সংগ্ৰহণ কৰা আৰু জিন্তা বিশ্বাসীৰ বিশ্বাসীৰ বিশ্বাসীৰ বিশ্বাসীৰ বিশ্বাসীৰ বিশ্বাসীৰ বিশ্বাসী	general de la companya de la company	રફ જ અને ફર્મ અને ફર્જ	

RECEIVED

(1)

 $\langle \cdots \rangle$ 

Y\* ( )

1. 19

#### POTENTIAL HAZARDOUS WASTE SITE SHE INSPECTION REPORT PART 11 - ENFORCEMENT INFORMATION

MOLEY DI HERITOLE 12 200 6464666

II. ENFORCEMENT INFORMATION


OF PAST HI CONTACTOR AND CHOCKET ACTION OF YES TO THE

DY DESCRIPTION OF FEEL ARE STATE FOCAL MEDICATORY OF OFFICIAL IT ACTION

Constantion in Common in Common with J. Kirthard Gier. II on 21.84 RECEIVED

Enology and Environment, USEAR Polor

STATE OF ILLINOIS

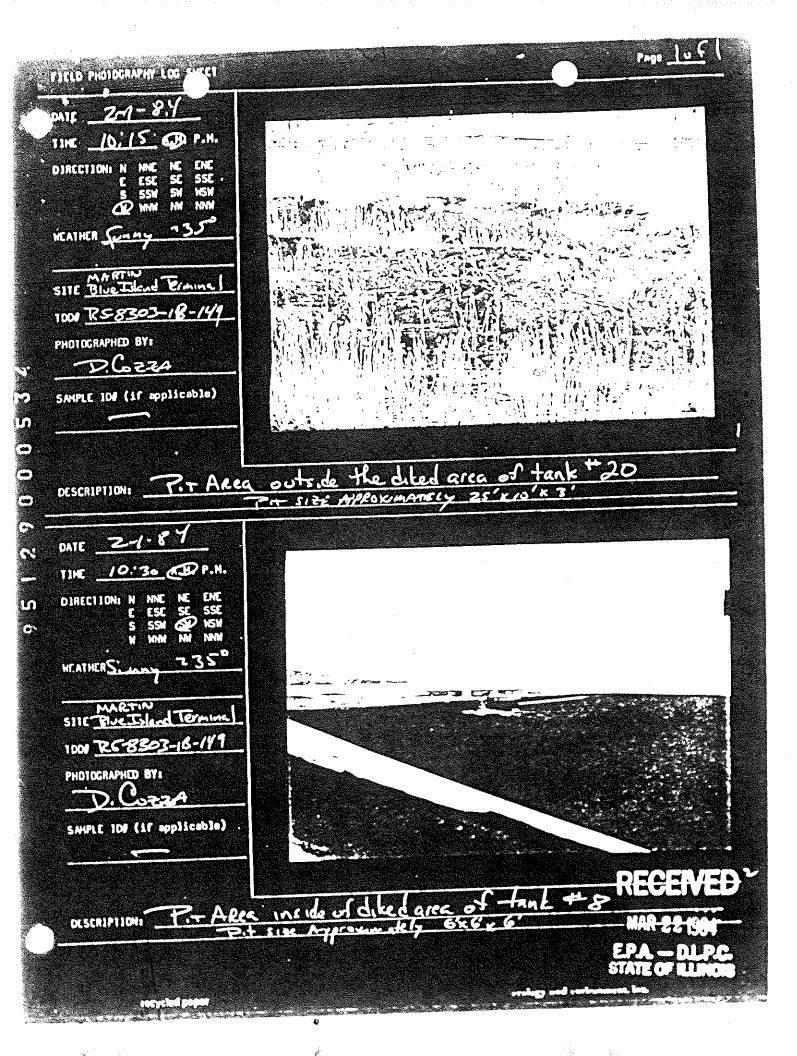

#### **CLARK OIL & REFINING CORPORATION**

May 13, 1987



Ms. Shirlee Brauer
U.S. Environmental Protection Agency
Region V
RCRA Enforcement Section 5HE-12
230 S. Dearborn Street
Chicago, Illinois 60604

Dear Ms. Brauer:

In response to the correspondence dated April 17, 1987, received April 21, 1987, enclosed please find the requested certification.

Please contact me if you have any questions or if you require any additional information.

Sincerely,

**1**0hn T. Bernbom

Director of Environmental Control

ālg

Enclosure

All responses should be sent to Ms. Shirlee Brauer, U.S. EPA Region V, RCRA Enforcement Section, 5HE-12, 230 South Dearborn Street, Chicago, Illinois 60604. Questions may be directed to the RCRA/Superfund Hotline at (800) 424-9346 or to either Ms. Brauer at (312) 886-4591 or Ms. Laura Lodisio at (312) 886-7090.

Sincerely,

Basil G. Constantelos, Director Waste Management Division

Enclosure

After reviewing the information provided, I certify that I am not a marketer or burner of waste-as-fuel and that I do not generate hazardous waste used to produce a fuel. Therefore, I am not subject to the regulations finalized on November 29, 1985, which are codified in 40 CFR Part 266, Subparts D and E. I am aware that there are significant penalties for submitting false information, including the possibility of fine and imprisonment for knowing violations.

Signature

Name and Official Title

Date Signed

of he rentwo

Director of Environmental

May 13, 1987

John T. Bernbom

Control

Clark Oil & Refining Corporation remains a generator-only of hazardous waste and is not subject to, or is exempt from, the requirements of 40 CFR Part 266, Subparts D and E at the following locations:

Wood River Refinery P.O. Box 7 Hawthorne Street North Hartford, Illinois 62048

USEPA I.D. No. ILDO41889023

Blue Island Refinery P.O. Box 297 131st & Kedzie Avenue Blue Island, Illinois 60406

USEPA I.D. No. ILDO5109822